



SERVICE BULLETIN

Classification: BR17-001b	Reference: NTB17-069b	Date: September 25, 2017
-------------------------------------	---------------------------------	------------------------------------

2016-2017 TITAN AND TITAN XD; NOISE FROM REAR PARKING BRAKES

This bulletin has been amended to correct the Parts Information table. No other changes have been made. Please discard all previous versions of this bulletin.

APPLIED VEHICLES: 2016-2017 Titan (A61)
2016-2017 Titan XD (A61)

APPLIED VIN AND DATE: 2016 Titan / 2016 Titan XD **All**
2017 Titan / Titan XD
Built before 1N6(*)A1(*)(*)HN 561155 / July 27, 2017

IF YOU CONFIRM

The rear parking brake shoes are dragging against the drum surface of the brake rotor and causing noise.

ACTION

Replace the rear parking brake shoes and retainer springs on both sides of the vehicle.

- If the parking brake shoes have worn through their lining and scored either the left side or right side drum surface of the brake rotor, or if any other related damage is present, replace the brake rotor on the affected side and replace the disc brake pads.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire Service Procedure as it contains information that is essential to successfully completing the repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the brake shoes and retainer springs on both sides of the rear axle.
 - Refer to the Electronic Service Manual (ESM), section **PB – Parking Brake System** for procedure to remove parking brake shoes.
2. Install new rear brake shoes and new retainer springs on both sides of the rear axle.
 - Refer to the ESM, section **PB – Parking Brake System** for procedure to reassemble the rear brakes and for break in procedure.
3. Inspect the old parking brake shoes and the inner drum surfaces of the brake rotors for metal to metal contact or other contact related damage.
 - If damage is present, replace only the affected brake rotor and replace the left and right rear disc brake pads.

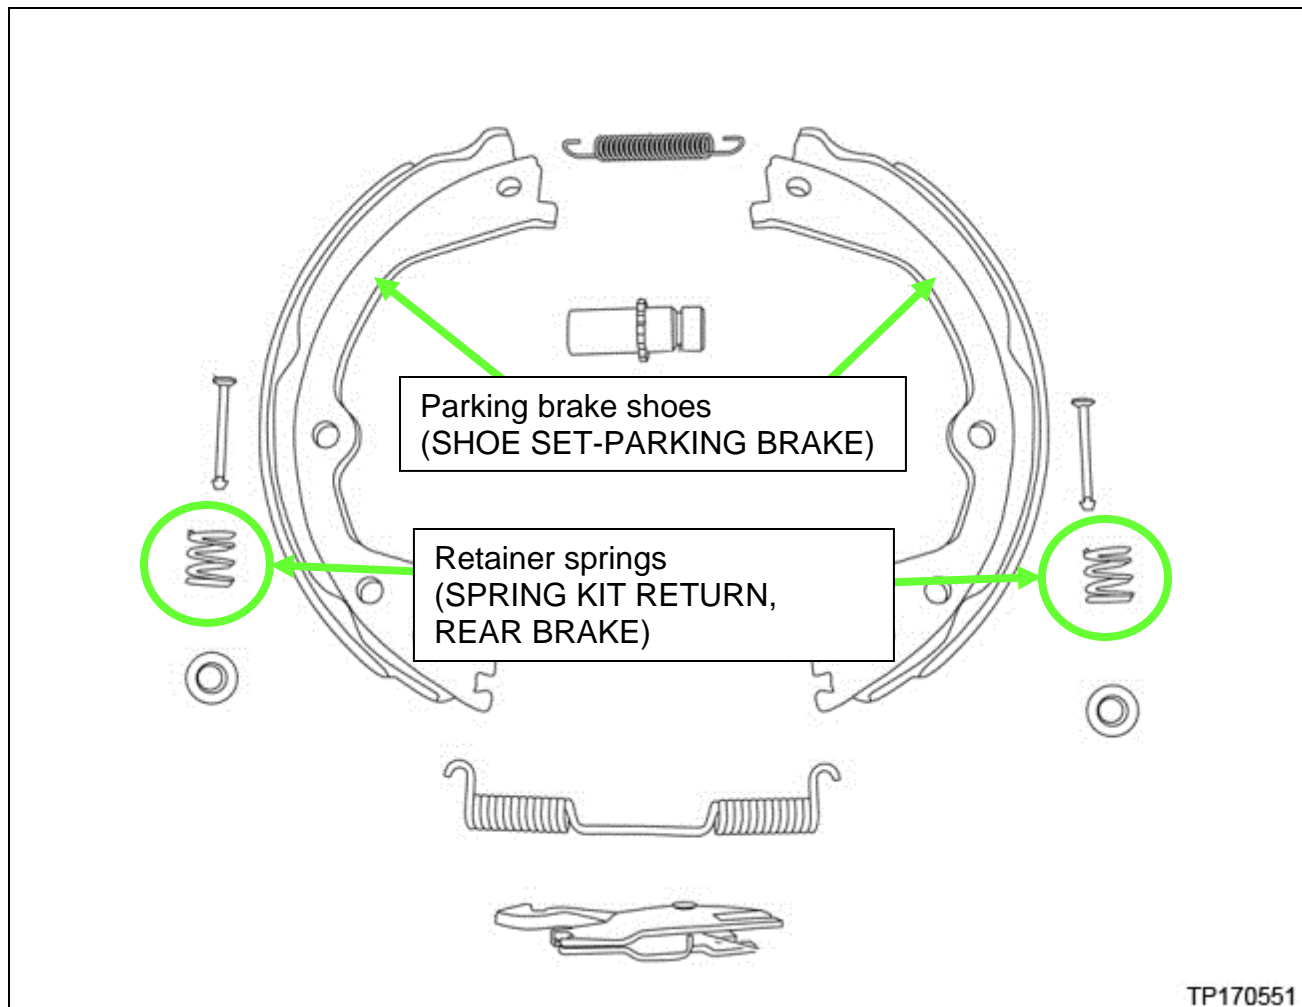


Figure 1

PARTS INFORMATION

MODEL YEAR	DESCRIPTION	PART NUMBER	QUANTITY
2016-2017 Titan	SHOE SET-PARKING BRAKE	D4060-EZ60C	1
	SPRING KIT RETURN, REAR BRAKE	D4090-1PA1B	1
	ROTOR BRAKE	43206-EZ60A	As needed
	PAD KIT-DISC BRAKE, REAR	D4060-EZ60A	(1)
2016-2017 Titan XD	SHOE SET-PARKING BRAKE	44060-1PA0B	1
	SPRING KIT RETURN, REAR BRAKE	D4090-1PA1B	1
	ROTOR BRAKE	43206-EZ00A	As needed
	PAD KIT-DISC BRAKE, REAR	D4060-EZ60A	(1)

(1) With rotor replacement only.

CLAIMS INFORMATION

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Rear Parking Brake Shoes	(1)	PL15AA	ZL	32	(2)

- (1) Refer to the electronic parts catalog (FAST) and use the Parking Brake Shoe (D4060 - XXXXX) as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.