



# Service Bulletin

File in Section: -

Bulletin No.: 17-NA-209

Date: July, 2017

## TECHNICAL

**Subject: Water Found in Rear Compartment and/or Rear Passenger Floor Area**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Malibu (VIN Z)	2016	2016			All	All
Chevrolet	Malibu	2017	2017	SOP	Prior to HF216475		

<b>Involved Region or Country</b>	North America, Israel
<b>Condition</b>	Some customers may comment on finding water in the rear compartment and/or rear passenger floor area.
<b>Cause</b>	The cause of the condition may be that over time, the center high mount stop lamp (CHMSL) fasteners may lose torque and allow water to leak into the rear compartment or floor area. The fasteners may lose torque due to thermal expansion and contraction of the CHMSL material.
<b>Correction</b>	Replace the CHMSL fasteners, and repair/replace any water damaged trim following the Service Procedure below.

### Parts Information


Description	Part Number	Qty
NUT, HIGH MT S/LP (20 nuts per package)	11602012	4, per repair

### Service Procedure

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2041650	High Mount Stop Lamp Replacement	Use Published Labor Operation Time

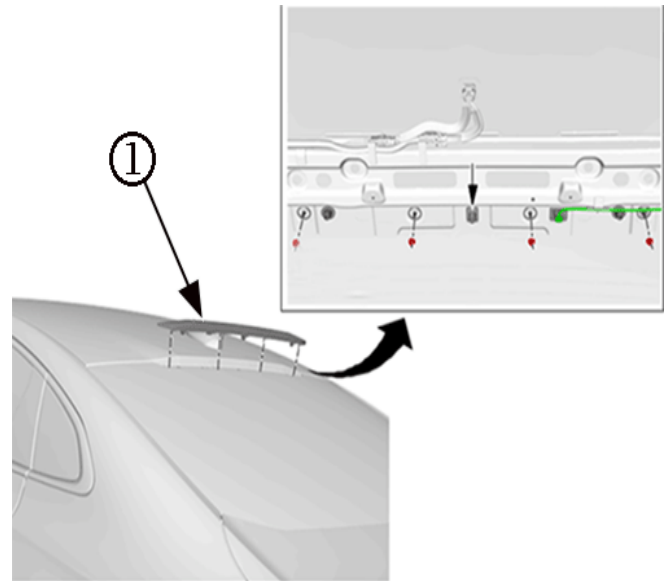

4822952

1. Remove the CHMSL (1). Refer to *High Mount Stop Lamp Replacement* in SI.
2. Reinstall the CHMSL and replace the original fasteners with the service part nuts listed in the part table. Refer to *High Mount Stop Lamp Replacement* in SI.
3. Repair or replace any water damaged trim, as necessary. Refer to *Floor Carpet Drying* in SI.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION