



SI M51 08 17  
Body Equipment

December 2017  
Technical Service

## TRUNK OPEN MESSAGE ON CLUSTER

### MODEL

F55 (Cooper, Cooper S, JCW Hardtop 4 door)

F56 (Cooper, Cooper S, JCW Hardtop 2 door)

### SITUATION

Check Control Message (CCM) "Trunk Open" message is displayed.

Trunk is closed and latched.

### CAUSE


Improper mating of trunk lock connector.

### CORRECTION

Properly attach trunk lock connector.

### PROCEDURE

For conditions that are similar to the situation described:

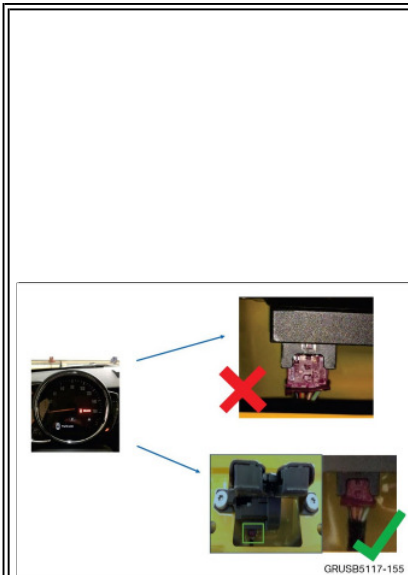

1. Confirm that the situation is as described.

**Is the trunk latched and closed with the CC message displayed?**

**YES-** go to next step.

**NO –** go to step 5.

2. Open trunk and remove trunk trim panel according to "REP 51 46 050 Removing and installing trunk trim panel".
3. Pull gently on trunk lock connection to verify proper latching has occurred.

**Was plug properly joined with the tailgate lock connector as shown in graphic?**

**YES-** go to step 5.

**NO –** reconnect plug into connector (it should click into place when fully inserted).

4. Verify that the CCM is no longer displayed. The repair has been completed.

	5. Follow Non-Electrical Diagnosis in ISTA.
--	---

## WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty.

<b>Defect Code:</b>	<b>5124007900</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
51 46 050	Refer to KSD2	Removing and installing/replacing the trim on the tail panel at the top. (Main work)
Or		
51 46 549	Refer to KSD2	Removing and installing/replacing the trim on the tail panel at the top. (Plus work)
And		
51 99 000	2 FRU	Checking and re-connecting the trunk latch connector

If you are using a Main labor code for another repair, use the Plus code labor operation 51 46 549 instead of 51 46 050.

### Other Repairs

Under the terms of the MINI New Passenger Car Limited Warranty, if other eligible and covered work is performed, claim this work with the applicable defect code and labor operations that are provided in the KSD2 (including diagnosis with separate punch times).

[ Copyright ©2017 BMW of North America, Inc. ]