



SI B13 01 18  
Fuel Supply Systems

March 2018  
Technical Service

## SERVICE ACTION: CHECK ROUTING OF FUEL LINE

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

### MODEL

G01 (X3 xDrive 30iA)	G01 (X3 M40iA)		
----------------------	----------------	--	--

### AFFECTED VEHICLES

This Service Action involves certain X3 vehicles (11,770 cars) produced from 07/13/2017 to 01/22/2018.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

### SITUATION

The fuel feed line is not correctly routed behind the tank ventilation line and may conflict with components of the intake system.




Picture shows incorrectly positioned fuel line (covered in a protective fabric), in front of the tank ventilation line, contacting the rear bracket of the intake manifold.

This may cause abrasion on the protective fabric coating of the fuel feed line.

### CORRECTION

Verify the proper routing of the fuel feed line as shown in the accompanying graphic.

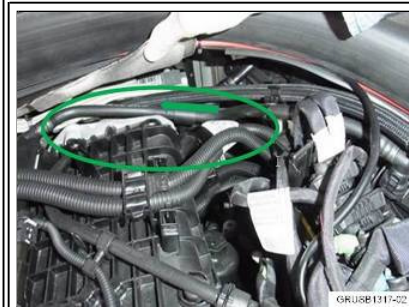

Proper location of the fuel line (behind the tank ventilation hose).

## PROCEDURE

1. Remove the engine acoustic cover. Identify the fuel feed line (covered in protective fabric) and the tank ventilation line (not covered in protective fabric).
2. If necessary, move the fuel feed line so that it is routed behind (slide underneath) the tank ventilation line and is not able to contact the components of the intake system.

## PARTS INFORMATION

No parts required.

## WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

<b>Defect Code:</b>	<b>0013770200</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
00 66 547	3 FRU	Checking hose pipe routing and correct if required (Plus work)

[ Copyright ©2018 BMW of North America, Inc. ]