Preliminary Information

PIT5487D Service Park Assist/Camera/Cruise/ and/or Front Park/Turn/Cornering Light Inop Blown Fuses (Front Fascia/Bumper Harness Chaffing)

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Liigille.	Transinissions.
Cadillac	Escalade Models	2015 - 2018	AII	All	AII	All

Supersession Statement

This PI was superseded to update the model year. Please discard PIT5487C.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this Pl.

Condition / Concern

Some owners may comment of any of the following issues:

- Service Parking Assist System Message
- Service Adaptive Cruise Control Message
- Service Surround Vision Camera Message
- Service Driver Assist Message
- Front park, turn signal, DRL, and/or cornering lights may be inoperative
- Turn signal flash fast
- Any of the following fuses blown: F10DL, F19DR, F43UA, and/or F46DR
- Any of the following DTC's may be set: B101D, B2530, B2575, B2699, B258A, B2580, B2590, B2595, B2600, B2605, B260E, B260D, B3948, B3949, U0075, U209E, U023A, U026B, U026E, U0265, U0268, U0269

These concerns could be caused by the front fascia/bumper harness shorted at the end of the right front bumper bar (2), as shown

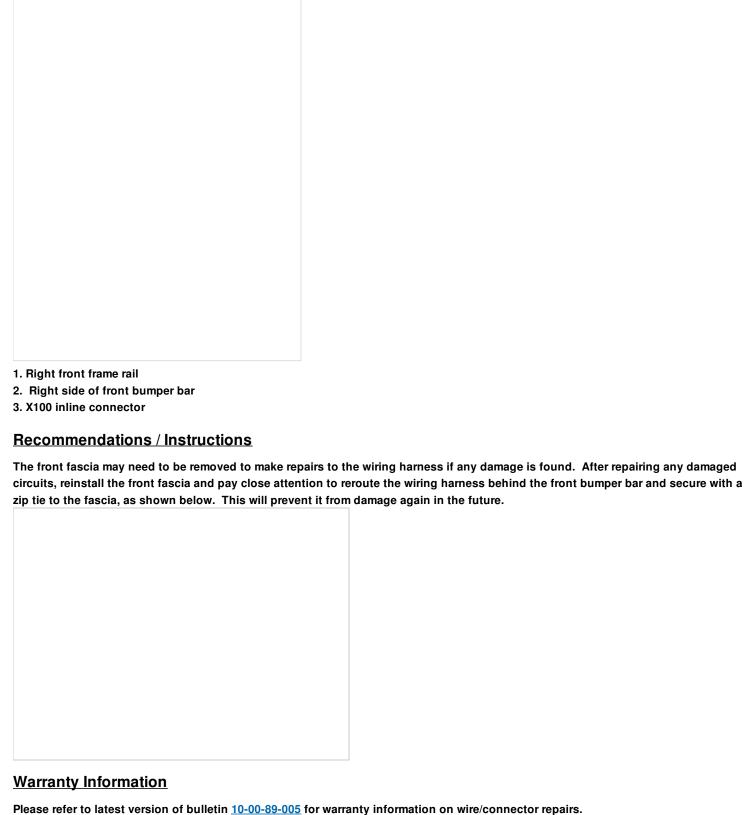

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved

without completing every step, the remaining steps do not need to be performed.



















