

Front Air Lift Strut Leaks

Vehicles Affected

Model	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
911 GT3; 911 GT3 RS	2014 - 2018	991	N/A	I option 474 Front Axle Lift

Revision History


Revision	Release Date	Changes
0	July 11, 2018	Original document

Customer Concern

The customer states that the front axle lift function is not working.

Technical Background

The front strut leaks air. A tool with minor damage at the supplier was causing minor damages to struts during production.

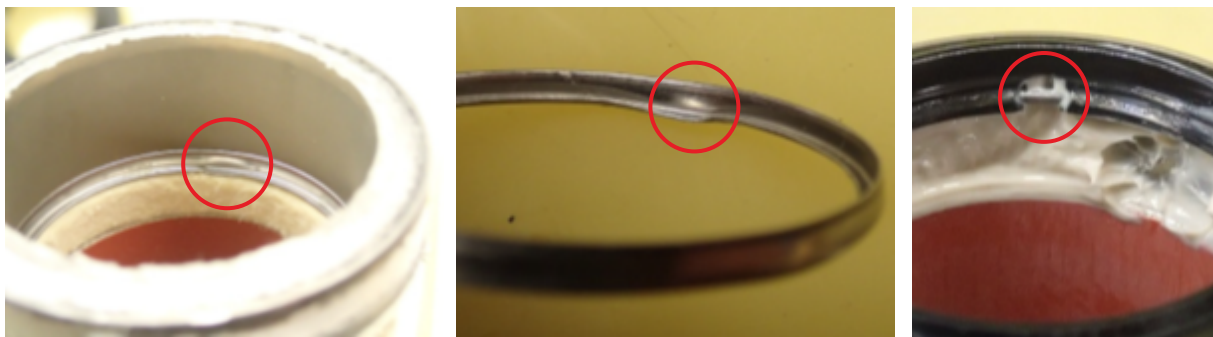

Service Information

The front strut(s) can be replaced. The parts inventory has been purged. All new parts in the supply system are known good parts after July 5, 2018.

Production Information

The damaged tool was replaced. The production solution was implemented May 23, 2018.

Search Items

Strut leak; axle lift; lift function; air suspension; front axle

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.
