Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

POPPING AND/OR SQUEAKING NOISE FROM FRONT SHOCK ABSORBER AND/OR CREAKING NOISE FROM FRONT LOWER ARM BUSHING Bulletin No.: 02-001/18

Last Issued: 07/13/2018

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted below in Red.

Previously Issued TSBs:	Date(s) Issued
02-001/18	01/05/18
02-005/17	03/16/16 and 01/13/17
02-001/16	10/10/16, 04/15/16, 02/23/16 and 01/08/16
02-004/15	05/12/15 and 04/24/15

APPLICABLE MODEL(S)/VINS

2014-2018 Mazda3 vehicles (Japan built and Mexico built) with VINs starting with JM1 and 3MZ

DESCRIPTION

Some vehicles may exhibit one or more of the following noises from the front suspension.

- A squeaking noise from the front shock absorber when turning the steering wheel at a vehicle standstill caused by stick-slip between the front strut bearing and the coil spring.
- A popping noise from the front shock absorber when passing over speed bumps caused by the bump stopper contacting the strut bearing when the shock absorber is compressed.
- A creaking noise from the lower arm when driving over road bumps at 20-40 km/h caused by stickslip of the front lower arm bushing. The noise occurs when the road surface is wet or after a car washing, and becomes more noticeable as the speed bump gets higher.

To correct these problems, the following changes have been made.

- For the squeaking and popping noise, the shape of the bump stopper has been modified and a
 protector has been installed onto the coil spring.
- For the creaking noise, the friction of the lower arm bushing has been reduced by adding a dry coating.

Customers having this concern should have their vehicle repaired using the following repair procedure.

Page 1 of 9

Bulletin No.: 02-001/18	Last Issued: 07/13/2018

REPAIR PROCEDURE


- 1. Verify the customer concern of noise coming from under the front of the vehicle when driving over speed bumps and/or driving on a rough road and/or turning the steering wheel at a standstill.
- 2. If the noise has been confirmed, check the VIN and perform the appropriate repair procedure according to the following tables.

Vehicle Spec	Vehicle Type A	Vehicle Type B	Vehicle Type C
JM1BM******	100001 - 250356	250357 - <mark>355940</mark>	N/A
JM1BN******	N/A	100001 - 156768	156769 - 999999
3MZBM******	100001 - 195510	195511 - 330142	N/A
3MZBN******	N/A	100001 - 999999	N/A

Repair to Perform by Vehicle Type	Vehicle Type A	Vehicle Type B	Vehicle Type C
1. Install Protector onto Spring	Perform	DO NOT Perform	DO NOT Perform
2. Replace Bump Stopper	Perform	Perform	Perform
3. Replace Lower Arm Bushing	Perform	Perform	DO NOT Perform


Protector Installation

- 3. Remove the spring according to the online instructions on MGSS (FRONT SHOCK ABSORBER AND COIL SPRING DISASSEMBLY/ASSEMBLY).
- 4. Degrease 1.5 turns of the spring from the top.
- 5. Cut a thin strip of paper to 138 mm in length (or use a cloth type measuring tape).
- 6. Place the strip of paper (or cloth measuring tape) along the inner side of the coil spring starting at point (A) and mark the spot on the spring where (B) is. (B) is the starting point for the protector installation.

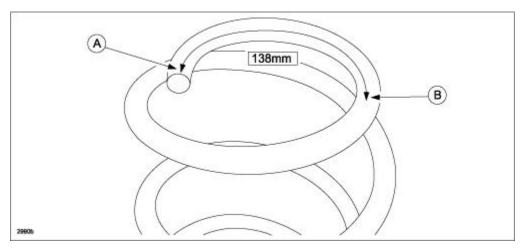

7. Install the protector (A) onto the coil spring aligning the end (slant cut side) with the marking at spot (B).

NOTE: Install the protector so the gap (C) is evenly aligned around the outer edge of the coil spring.

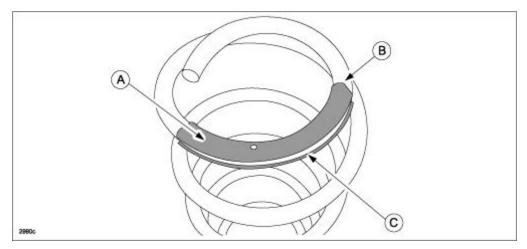

Page 3 of 9


Bump Stopper Replacement

8. Replace the bump stopper with the modified one according to the online instructions on MGSS (FRONT SHOCK ABSORBER AND COIL SPRING DISASSEMBLY/ASSEMBLY).

NOTE:

- Before removing the mounting rubber, mark its original position so it can be re-installed later to the same position.
- When replacing the bump stopper with a modified one, apply grease to upper side of the bump stopper and to the inside of the bump stopper (on the surface that contacts the damper rod).

CAUTION: It is not necessary to adjust the front wheel alignment because the front shock absorber and mounting rubber are not being replaced. However, make sure to install the mounting rubber to the original position.

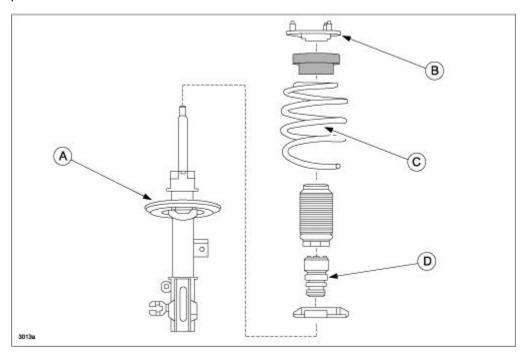

AFront Shock Absorber C Coil Spring


B Mounting Rubber DBump Stopper

Page 4 of 9

Lower Arm Bushing Replacement

CAUTION: Installation of the modified lower arm bushing will affect the road noise and the riding comfort in a negative way. Therefore, only use this modified part for a customer vehicle with consideration of these adverse effects.

- 9. Remove the front lower control arms (both sides) according to the online instructions on MGSS (FRONT LOWER ARM REMOVAL/INSTALLATION).
- 10. Remove the front lower arm bushing using SSTs 49-G030-797 and 49-B025-004.
- 11. Place the SSTs on the front lower control arm as shown below, then press out the bushing.

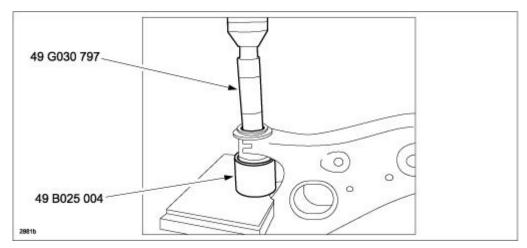


Page **5** of **9**


12. Install the modified bushing using the same SSTs.

NOTE:

- Before installing the new bushing, wipe the inside of the outer tube and make sure it is clean.
- Apply soap suds to the bushing to ease the installation.
- Always wipe off soap suds from the front lower control arm and bushing with a cloth.
- Install the bushing so the projection (A) is pointing toward the front of the vehicle.

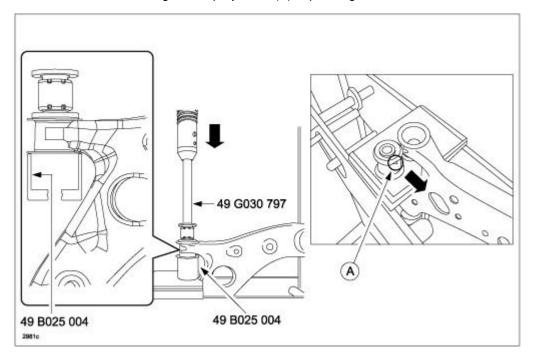


CAUTION: Make sure the bushing has been properly inserted by verifying that the bushing tab **IS FULLY EXPANDED** as shown on the left (A). The bushing tab **IS NOT FULLY EXPANDED** as shown on the right (B).

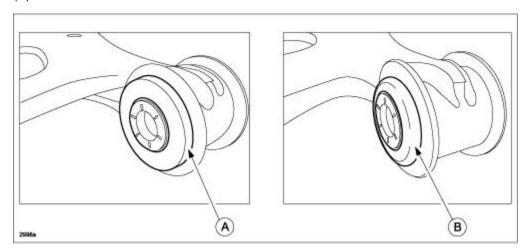


Page 6 of 9

13. After installing the bushing, verify the distance between the front lower control arm (A) and front lower control arm bushing inner pipe (B) equals 5.8 +/- 0.8mm as shown below.

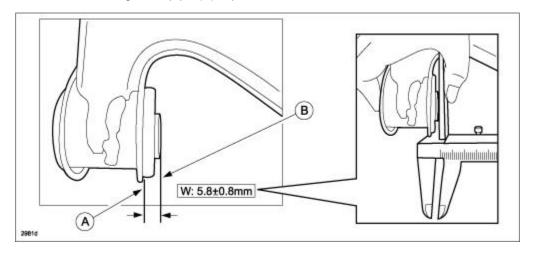

14. Reinstall the front lower control arm according to the online instructions on MGSS (FRONT LOWER ARM REMOVAL/INSTALLATION).

NOTE: For the joint sections with rubber bushings, raise the vehicle using a lift, and then temporarily tighten the installation bolts. Then raise the vehicle using a wheel alignment lift rack (A) or lower the vehicle to the ground (to load the suspension). Use a torque wrench (B) to tighten the bolts (C) to the specified tightening torque.

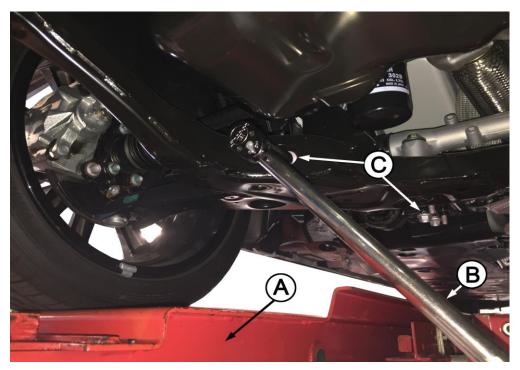

15. Perform wheel alignment inspection and adjust if necessary.

Page **7** of **9**

Bulletin No.: 02-001/18	Last Issued: 07/13/2018

PARTS INFORMATION

New Part Number	Old Part Number	Description	Qty.	Notes
BAYN-34-111	B45A-34-111A	Stopper, Bump	2	For Japan built 2.0L
BPY4-34-111	B45G-34-111A	Stopper, Bump	2	For Japan built 2.5L
KDY5-34-081		Protector	2	Type A vehicles only
9YB0-41-237		Piston Rod Nut	2	Replace part for all models
TK48-34-470A	KD35-34-470E	Front Lower Arm Bushing	2	Type A and B vehicles
	KDY5-34-470A			

NOTE:

- For Mexico-built vehicles that are originally equipped with the Bump Stopper (BJS7-34-111), use BAYN-34-111 for the repair.
- For Mexico-built vehicles that are originally equipped with the Front Rubber Bushing (BSJ7-34-470), use TK48-34-470A for repair.

WARRANTY INFORMATION

Since two different causal parts (front shock absorber and lower arm) are involved in this repair, please submit the claim divided into the following two claims.

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Page 8 of 9

Bulletin No.: 02-001/18	Last Issued: 07/13/2018

Front Shock Absorber

- Vehicle Type A: Install Protector and Replace Bump Stopper
- Vehicle Type B and C: Replace Bump Stopper

Warranty Type	Α		
Symptom Code	82		
Damage Code	97		
Part Number Main Cause	BAYN-34-111 or BPY4-34-111		
Quantity	2		
Operation Number / Labor Hours	XXK8NFRX / 0.6 Hrs.		
Related Part and Quantity	9YB0-41-237	Piston Rod Nut	2Vehicle Type A, B and C
	KDY5-34-081	Protector	2 Vehicle Type A only

Front Lower Arm

• Vehicle Type A and B: Replace Lower Arm Bushing

	Dealer Sublets Wheel	Dealer Performs Wheel Alignment
	Alignment	
Warranty Type	A	
Symptom Code	82	
Damage Code	93	
Part Number Main	TK48-34-470 (Lower Arm	
Cause	Bushing)	
Quantity	2	
Operation Number /	XXK8NARX / 0.8 Hrs.	XXK8NBRX / 1.8 Hrs.
Labor Hours	(Only replacement of front	(Includes front wheel alignment check and adjust
	lower arm bushing)	using 4-wheel alignment tester)
Sublet Code	Z 9	

Page 9 of 9