

N266 UPS12118-1BNAS1 TECHNICAL BULLETIN 03 JAN 2019

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

307-02

SUBJECT/CONCERN:

Update Prior to Sale: Transmission Oil Cooler

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	APPLICABILITY:
Discovery (LR)	2019	081311-090740	TDV6 3.0L Diesel
Range Rover Sport (LW)	2019	815191-832643	TDV6 3.0L Diesel
Range Rover (LG)	2019	518189-534168	TDV6 3.0L Diesel

https://topix.landrover.jlrext.com/topix/content/document/view?id=949257

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

A potential issue has been identified on certain Land Rover vehicles within the listed Affected Vehicle Range with the installation of the automatic transmission fluid cooler pipe to the automatic transmission fluid cooler.

ACTION:

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the Diagnostic/Workshop Procedure detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but must have it completed prior to vehicle handover to the customer.

This program does not apply to any vehicle already registered and in use, either with the retailer or customer. Any vehicle already in use may continue to be driven and any repair instructions deemed necessary will be communicated through a separate bulletin.

PARTS:

△ NOTE:

Order only the expected percentage demand of parts as identified.

DESCRIPTION	PART NUMBER/SUNDRY CODE	QUANTITY/VALUE	EXPECTED PERCENTAGE DEMAND
Fluid - Automatic transmission	ZZZ001	\$26.00	1

An allowance of \$26.00 USD or local equivalent has been provided to cover the cost the automatic transmission fluid.

SPECIAL TOOLS:

Refer to TOPIx Workshop Manual/Workshop Procedure for any required special tools.

WARRANTY:

△ NOTE:

Use the Jaguar Land Rover claims submission system to make sure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that all open Recall and Service Actions are identified to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting the Program Code and the relevant Option Code; this will result in payment of the stated time. The SRO and parts information is included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times/prices are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the December 31, 2019, closure date must be submitted or payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER/SUNDRY CODE	QUANTITY/VALUE
N266	A	Inspect automatic transmission oil cooler	05.10.40	0.4	-	-

N266 UPS12118-1bNAS1 - Update Prior to Sale: Transmission Oil Cooler | TOPIx


PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER/SUNDRY CODE	QUANTITY/VALUE
N266	В	Inspect automatic transmission oil cooler Drive in/drive out	05.10.40 02.02.02	0.4 0.2	-	-
N266	С	Inspect automatic transmission fluid level	44.24.06	0.7	ZZZ001	\$26.00
N266	D	Inspect automatic transmission fluid level Drive in/drive out	44.24.06 02.02.02	0.7 0.2	ZZZ001 -	\$26.00 -

An allowance of \$26.00 USD or local equivalent has been provided to cover the cost.


WORKSHOP PROCEDURE:

\triangle NOTES:

- Some variation in the illustrations may occur, but the essential information is always correct.
- Some components shown removed for clarity.
- Remove the engine undershield (see TOPIx Workshop Manual section 501-02: Front End Body Panels -- Engine Undershield).

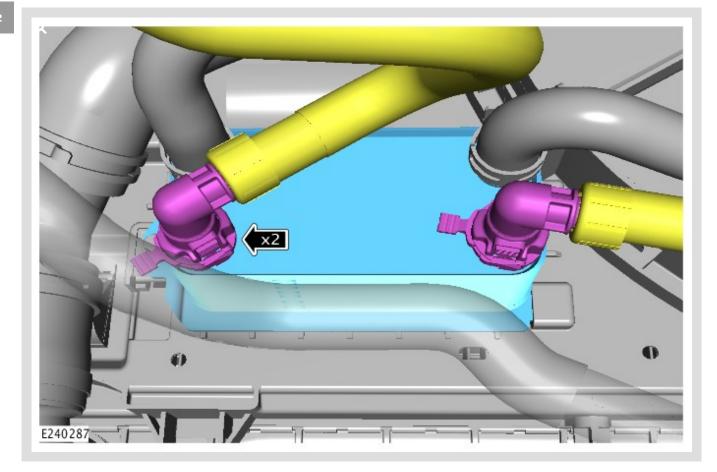

Inspect the automatic transmission to automatic transmission fluid cooler pipe connectors.

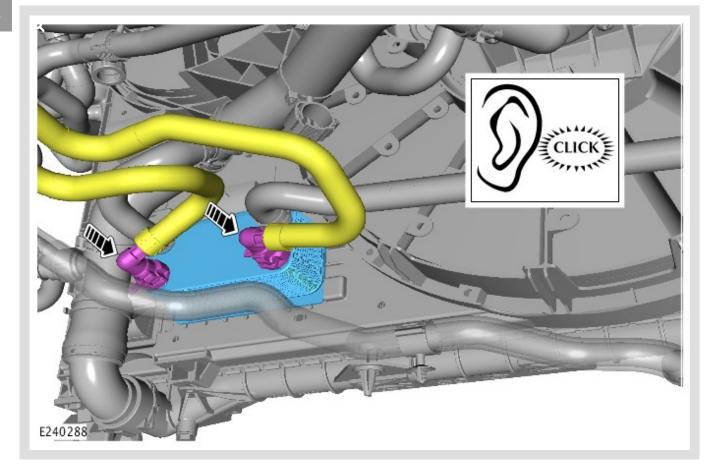

Push the automatic transmission fluid cooler pipes/connectors.

- If there is no movement (no 'click') from both pipes/connectors, the pipes/connectors are fully connected.
 - Install the engine undershield (see TOPIx Workshop Manual section 501-02: Front End Body Panels -- Engine Undershield).
 - Release the vehicle.
- If there is movement ('click') from one or both pipes/connectors, the pipes/connectors are not fully connected.
 - Go to Step 4.
- Inspect the automatic transmission fluid level (see TOPIx Workshop Manual section 307-01:
 Automatic Transmission/Transaxle -- Automatic Transmission Fluid Level Check).
- Install the engine undershield (see TOPIx Workshop Manual section 501-02: Front End Body Panels -- Engine Undershield).