



N279 UPS13518-1BNAS1

# TECHNICAL BULLETIN

18 JAN 2019

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

## INFORMATION

## SECTION:

501-19

## SUBJECT/CONCERN:

Update Prior to Sale: SV-Autobiography - Bumper Blanking Plate

## AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover (LG)	2019	518660	Solihull
Range Rover (LG)	2019	518686	Solihull
Range Rover (LG)	2019	518722	Solihull

---

**MARKETS:**

NORTH AMERICA

---

**CONDITION SUMMARY:****SITUATION:**

A potential issue has been identified on a limited number of Land Rover vehicles within the listed Affected Vehicle Range may have a front bumper with a blanking plate installed when not required, which could lead to the vehicle overheating.

**ACTION:**

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the Diagnostic/Workshop Procedure detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but must have it completed prior to vehicle handover to the customer.

This program does not apply to any vehicle already registered and in use, either with the retailer or customer. Any vehicle already in use may continue to be driven and any repair instructions deemed necessary will be communicated through a separate bulletin.

---

**PARTS:**

No parts required.

---

**SPECIAL TOOLS:**

Refer to TOPIx Workshop Manual/Workshop Procedure for any required special tools.

---

**WARRANTY:** **NOTE:**

Use the Jaguar Land Rover claims submission system to make sure that a vehicle is eligible for this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that all open Recall and Service Actions are identified to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting the Program Code and the relevant Option Code; this will result in payment of the stated time. The SRO and parts information is included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times/prices are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the January 16, 2020, closure date must be submitted or payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER/SUNDRY CODE	QUANTITY/VALUE
N279	A	Front bumper - Blanking plate - Remove	76.22.89.42	0.9	-	-
N279	B	Front bumper - Blanking plate - Remove Drive in/drive out	76.22.89.42 02.02.02	0.9 0.2	- -	- -

Normal Warranty policies and procedures apply.

WORKSHOP PROCEDURE:


### NOTES:

- Some variation in the illustrations may occur, but the essential information is always correct.

- Some components shown removed for clarity.

1 Remove the front bumper for access (see TOPIx Workshop Manual section 501-19: Bumpers - Removal and Installation - Front Bumper).

2

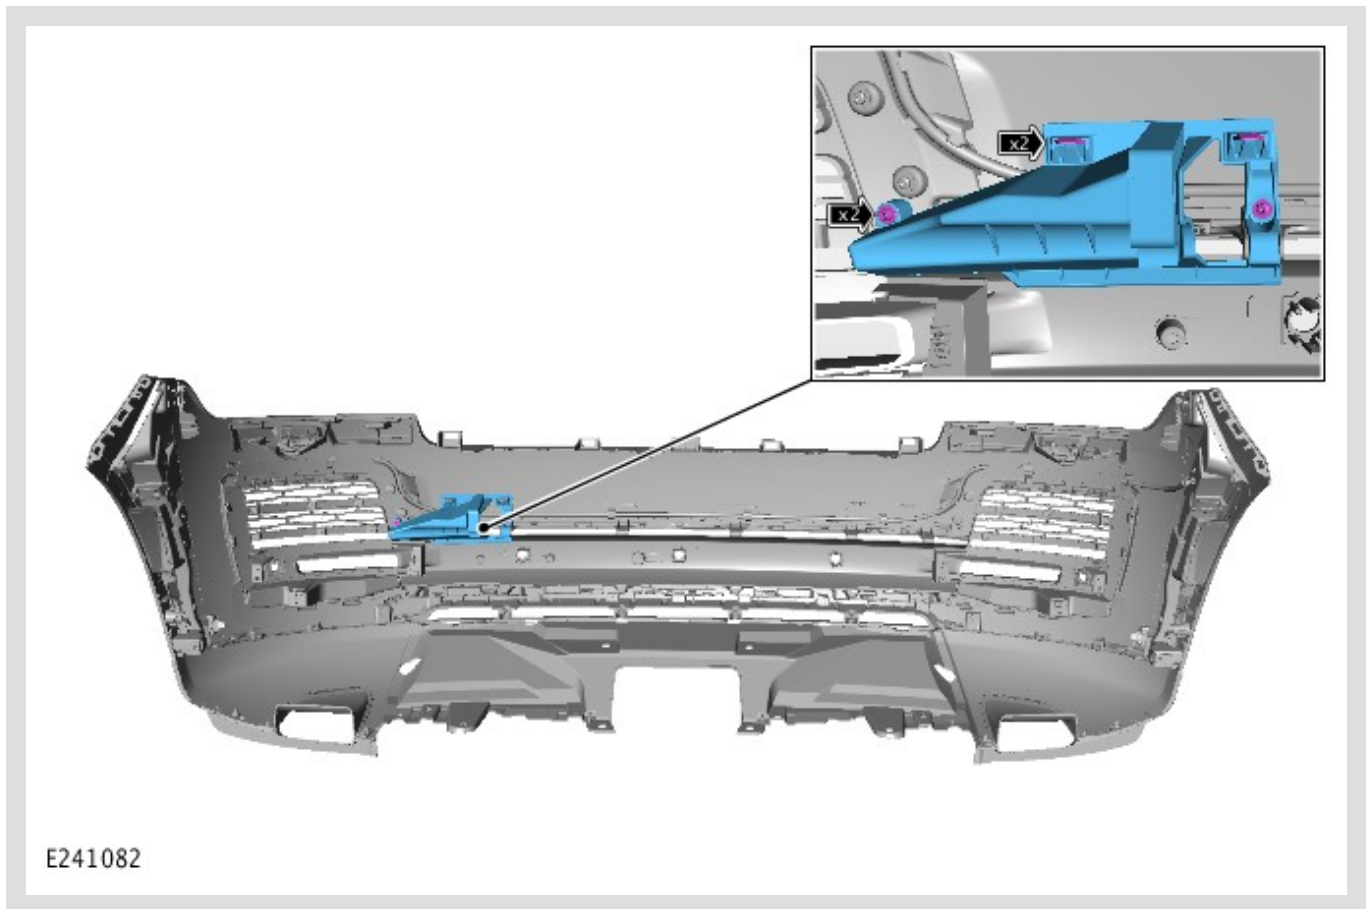

Remove and discard the front bumper blanking plate.

3 Install the front bumper (see TOPIx Workshop Manual section 501-19: Bumpers - Removal and Installation - Front Bumper).