

## **Service Bulletin**


Bulletin No.: 19-NA-008

Date: May, 2019

## **TECHNICAL**

Subject: Upper Inboard Corner of the Rear Body Structure Stop Lamp Has Sharp Edge

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Biallu.		from	to	from	to		
GMC	Acadia (VIN N)	2017	2019			All	All
	Terrain	2018	2019				

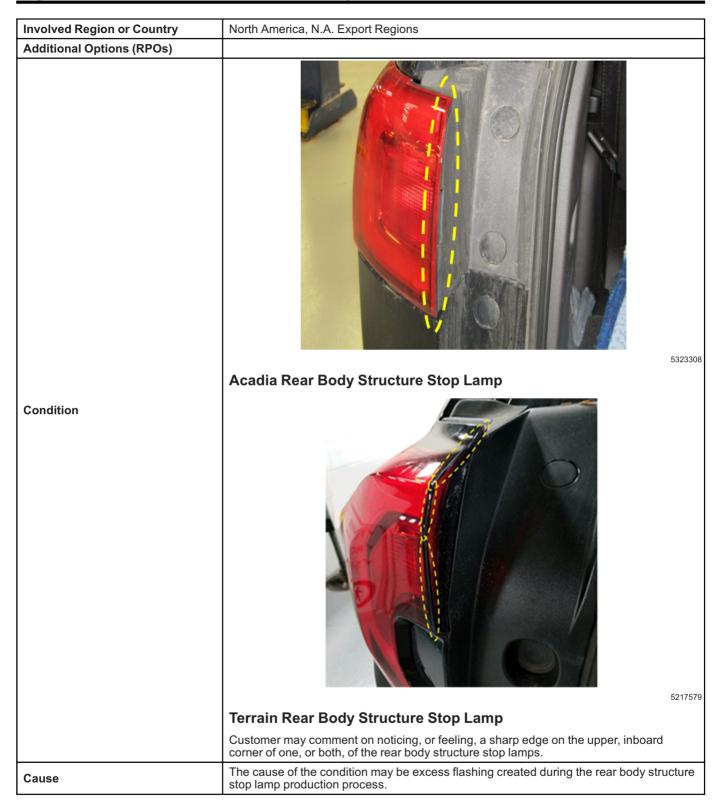

Important: DO NOT replace the lamp for this sharp edge condition.

Raise the rear liftgate and inspect both stop lamps for excess material (flash) at the parting line on the existing lamp, at the location shown above.



Correction

5217582

If sharp edge if verified, using 400–600 grit sandpaper, lightly sand the sharp edge to a smooth roundness.

## **Parts Information**

No parts are required for this repair.

## **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time			
2081098*	Sand Sharp Edge on Both Rear Stop Lamps	0.2 hr			
*This is a unique Labor Operation for Bulletin use only.					

Version	2
Modified	Released January 25, 2019
	Revised April 24, 2019 – Added Acadia Model and Graphic.