

# **Technical Journal**

TITLE:

### No VIDA communication with vehicle

	•				
REF NO:	ISSUING DEPARTMENT:	CAR MARKET:			
TJ 34165.1.1	Technical Service	United States and Canada			
	PARTNER:	ISSUE DATE:	STATUS DATE:		
3 US 7	7510 Volvo Car USA	2019-04-30	2019-05-06		
FUNC GROUP:	FUNC DESC:				
3975	Mobile data services, general	Page 1 of 4			

"Right first time in Time"

### **Attachment**

File Name	File Size
TJ 34165_2.jpg	0.1261 MB
TJ34165.JPEG	0.1450 MB

# **Vehicle Type**

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	('hassis range	Struc Week Range
2XX							2016-8999		-	201505-999952
5XX							2019-9999		-	201746-999952

## **CSC** Customer Symptom Codes

Code	Description
22	Diagnostic communication/Wired diagnostic connection to vehicle does not work
23	Diagnostic communication/WiFi diagnostic connection to vehicle does not work
24	Diagnostic communication/Remote diagnostic connection to vehicle does not work

### **VST** Operation Number

# **DTC** Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

# **Technical Journal 34165.1.1**



#### **Text**

#### DESCRIPTION:

VCM = Vehicle Connectivity Module

OBD = On-Board Diagnostics

DiCE = Diagnostic Communication Equipment

VOE = Vehicle Over Ethernet

CAN = Controller Area Network

This TJ serves as a guide with steps to follow if it is not possible to connect the car to VIDA via OBD connector with an ethernet cable, please see advice under "Service".

#### **SERVICE:**

Please follow these instructions if there is a problem connecting a car to VIDA:

- A. Refer to SPJ 33451 regarding vehicles not showing up in the Connected Vehicles list. Rule out all scenarios in this SPJ before proceeding.
- B. Inspect the OBD connector and VOE adapter pins and terminals for any sign of damage. Also ensure that the terminals on the vehicle's OBD socket have adequate tension (recommend using terminal probe kit 9513036).
- C. If the pins are okay, please try to connect with another known working ethernet cable, VOE adapter and computer.
- D. If it is still not possible to communicate with the car, the VCM may be in a "blocked" mode. Some VCM's can be restored with DiCE and VIDA by following the steps below:
- 1. Connect the car to VIDA using DICE.
- 2. The DiCE interface LED should be lit up on the unit.
- 3. If the VIN number is received by VIDA and a connection is established using DiCE, try to reset the VCM in the *Advanced Test* menu and toggling Programming Mode On and Off (See attached TJ34165. JPEG)
- 4. Disconnect the DiCE and attempt to connect VIDA using the Ethernet/VOE adapter.
- 5. If communication is still not possible with the Ethernet cable, remove & re-install fuse CF35 OR perform a battery reset to power-reset the VCM.
- 6. If there is still no connection between the car and VIDA, try swapping the VCM with a known good VCM from a donor car to see if communication is possible. It is only necessary to plug in the donor VCM to the problem vehicle: **Do NOT reload the donor VCM.**
- \* If communication is restored using the donor unit, re-install the original VCM and check for communication once again. If communication is restored with the original unit, do not replace the VCM and continue diagnostics with the original unit.
- If communication is restored using the donor unit, and communication is not possible with the original, the VCM should be replaced according to VIDA instructions.

Page 2 of 4 2019-05-06



# **Technical Journal 34165.1.1**

7. If there is no communication with the swapped VCM, please check the wiring between the OBD connector and VCM for shorts/opens. (See VIDA wiring diagram for Diagnostic CAN/Diagnostic Socket, OBD II).

If none of the above steps help to restore communication to the vehicle, please submit a TIE report according to instructions under Vehicle Report.

### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support needed", use function group 3975.


Please attach VIDA Diagnostic logs to the Vehicle Report (see attachment <u>TJ 34165 2.jpg</u> for description of which files are needed).


To view TJ attachment continue to next page. This TJ has two attachments.

2019-05-06 Page 3 of 4

# **Technical Journal 34165.1.1**



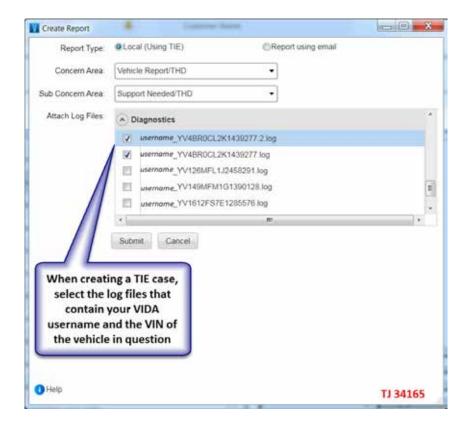

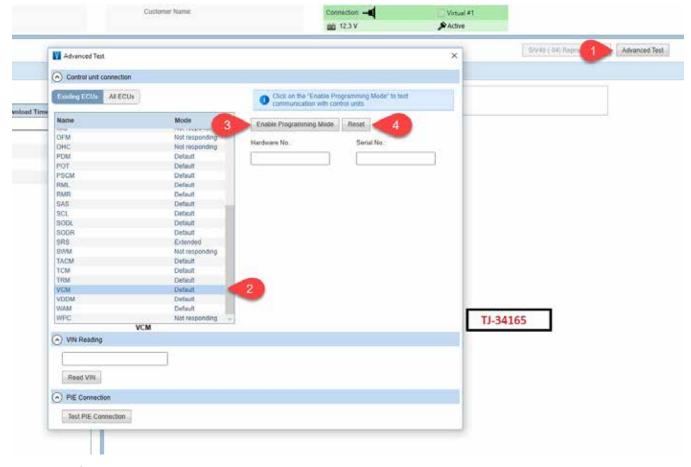

Page 4 of 4 2019-05-06