



**NUMBER:** 08-050-19

**GROUP:** 08 - Electrical

**DATE:** May 17, 2019

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**This bulletin supersedes Service Bulletin 08-024-18, Dated February 10, 2018, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include software level, remove build date, additional symptom/condition and updated LOP.**

**This service bulletin is also being released as rapid response transmittal (RRT) 18-015. All applicable Sold RRT VIN's have been loaded. To verify that this RRT service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.**

**SUBJECT:**

UGQ Radio Enhancements

**OVERVIEW:**

This bulletin involves inspecting and if required, updating the radio software to **\*\*21.9.\*\***

**MODELS:**

2018 (BU) Jeep Renegade

**NOTE: This bulletin applies to vehicles within the following markets/countries: EMEA.**

**NOTE: This bulletin applies to vehicles equipped with Uconnect 4 Navigation With 8.4(Display (Sales Code UGQ)).**

**SYMPTOM/CONDITION:**

Customers may experience one or more of the following:

- **\*\*If the vehicle has been turned off for a long time, the settings for auto folding side mirrors is turned off**
- Radio resets intermittently.
- Radio display screen locks up.
- Park assist chime will continue to chime, after the vehicle is turned off.
- Radio will display the incorrect speed limit in kph, when approaching a road speed camera.**\*\***
- Uconnect Live feature may not function properly.

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. If any vehicle not on the VIN list exhibits the symptom/condition, perform the repair.

**INSPECTION:**

1. Verify the radio software version. Radio must be in Dealer Mode to verify. To put the radio in Dealer Mode, follow these steps:
  - a. Press and hold both lower corners of the display screen, until the Dealer Mode screen appears (approximately seven seconds). Release buttons.
  - b. Select "Radio Part Information". The software level will be listed next to "Application Version".
2. Is the radio currently at software level **\*\*21.9\*\*** or higher (Fig. 1) ?
  - YES >>> This service bulletin has been completed. Use inspection LOP (18-60-02-QU) to close the active RRT.
  - NO >>> The radio software needs to be updated. Back out of Dealer Mode and proceed to [Step 1](#) of the Repair Procedure.



Fig. 1  
Radio Software Level Screen

**REPAIR PROCEDURE:**

**NOTE: A 16 GB USB flash drive is required for this update. The normal 4 GB USB flash drive will not be sufficient.**

1. Has a **16 GB** USB flash drive been created?
  - YES >>> Proceed to [Step 11](#).
  - NO >>> Proceed to [Step 2](#).

**NOTE: When downloading the navigation software file equipped with an Uconnect 8.4 navigation radio, always select the MAC version, regardless of the computer being used.**

2. Go to DealerCONNECT>Service>Uconnect Command Center>Uconnect>More Information >Dealer software downloads to download the files.
3. If a security message appears “Do you want to view only the webpage content that was delivered securely?” ([Fig. 2](#)) . Press “No” to continue.



Fig. 2  
Pop-Up Security Message

**NOTE: If the software cannot be downloaded, make sure you have proper security access. If not, have the Service Manager or Shop Foreman download the software update.**

4. Use a blank USB flash drive with at least 16GB of space. Follow the on-screen instructions to download the software files.

5. Download the software update file to your local PC's desktop. Make sure to select the "MAC" radial button for all downloads (Fig. 3) .

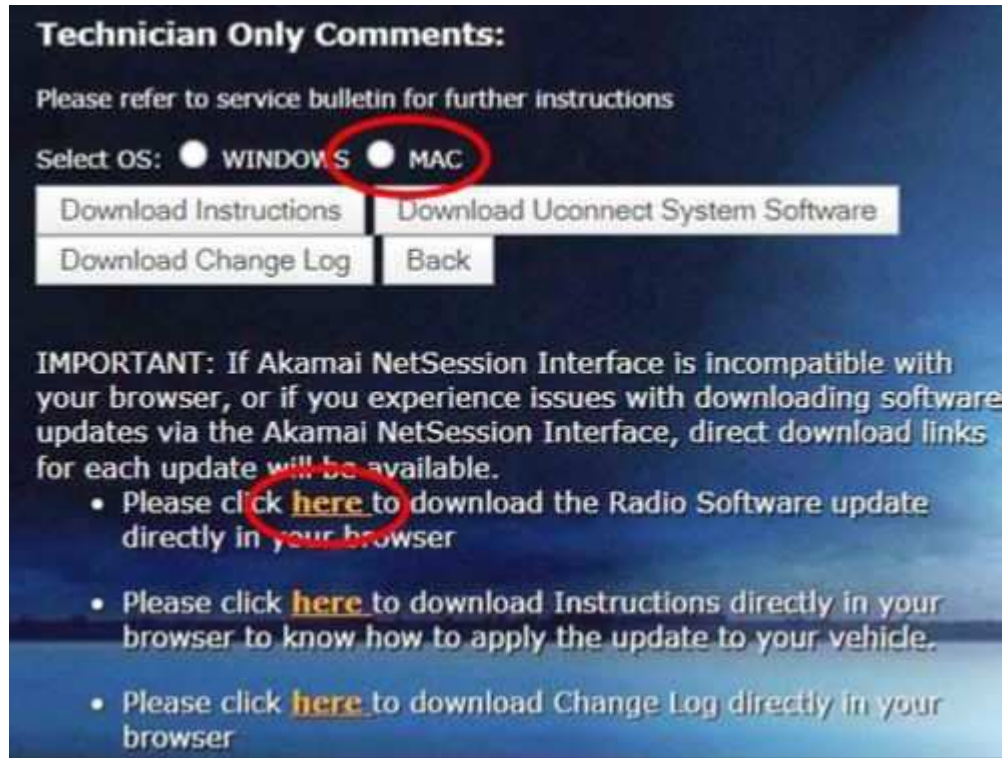


Fig. 3

MAC Download Steps

6. Be sure to download the file to your designated folder before extracting the zip file to the blank USB flash drive.
7. A blank USB flash drive will be needed for each radio update, additional updates can not be on the same USB flash drive.

8. Extract the downloaded zip file to the designated USB flash drive (Fig. 4) and (Fig. 5) .  
**NOTE: It may take a few minutes for an accurate extract time to be displayed.**

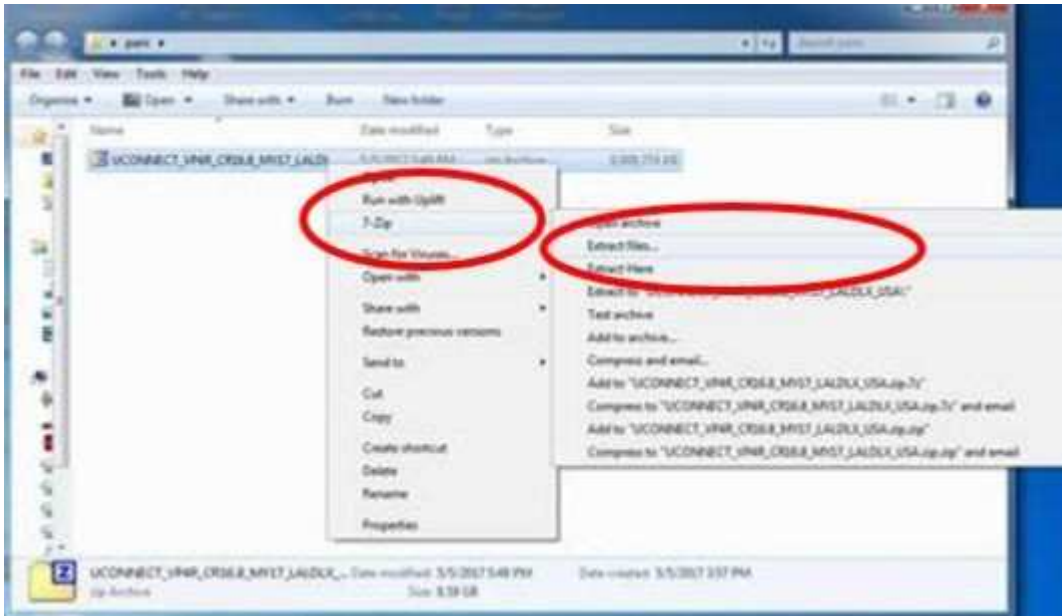


Fig. 4  
Zip File Extraction

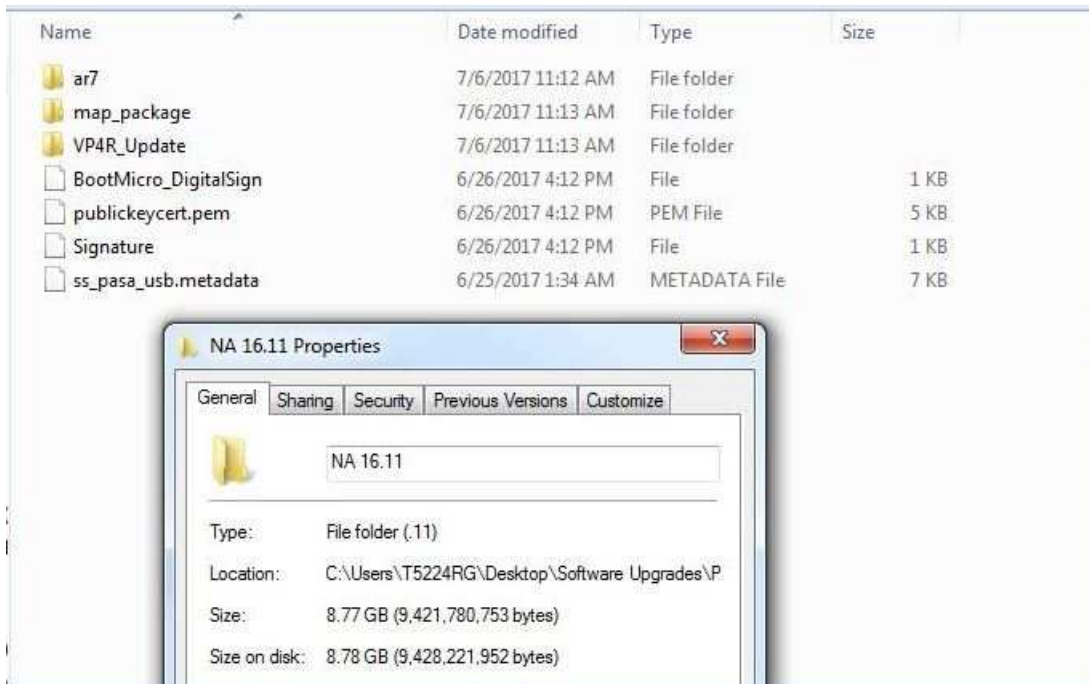


Fig. 5  
Saving File To USB


**CAUTION!** The engine must be running and radio powered on during the update. Failure to do so may result in the radio not being updated and create connectivity issues.

**NOTE: DO NOT** remove the USB flash drive during the update.

9. Verify the content on the flash drive matches (Fig. 6) for Navigation equipped radios and (Fig. 7) for Non-Navigation equipped radios.



**Fig. 6**  
**Navigation Radio Files**

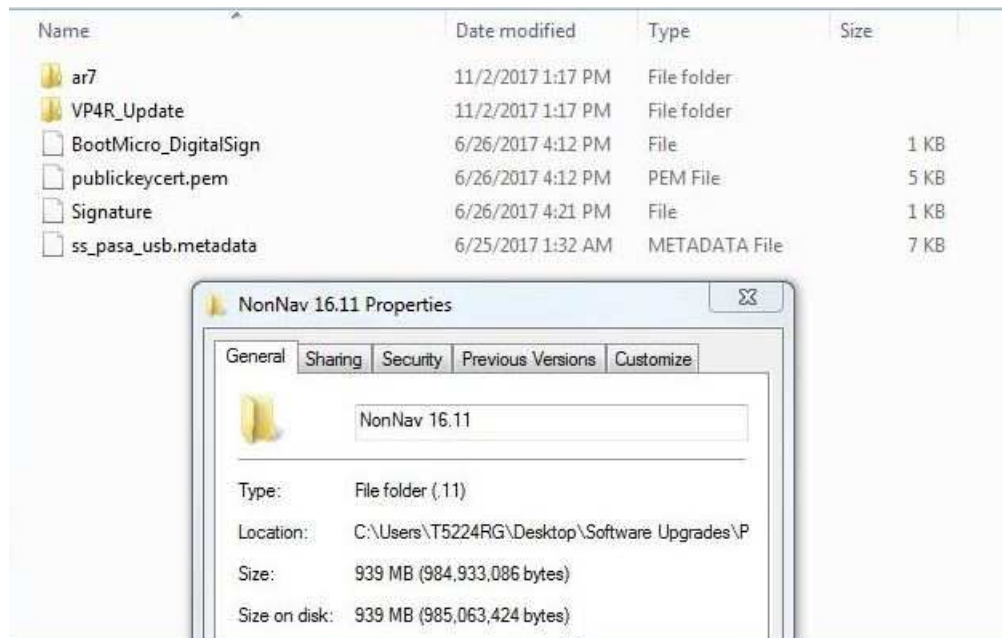

**Fig. 7**  
**Non-Navigation Radio Files**

10. Once the file is extracted to the USB flash drive, it is recommended to label the USB flash drive with the bulletin number and proper radio Sales Codes.
11. Start the vehicle and insert the correct USB flash drive, with new software, into the USB port.

**CAUTION!** Make sure no other device is plugged into any of the USB ports while performing this re-program. If other devices are connected to USB ports during re-programming, it may cause failure of files to be loaded which may cause the radio to need replacement.

12. If the screen in (Fig. 8) is displayed, the USB flash drive was not set up correctly. Use a top name brand USB and create a new flash drive, then start the update again.



Fig. 8  
Software Not Compatible

**NOTE:** If the ignition is turned off before the two minute has expired, the software update will be canceled. The ignition does not have to be turned off to perform this updated. (Fig. 10) .

13. Once the system has verified there is an available update, touch the “Update Now” button. Make sure the vehicle is in park, **DO NOT turn off the ignition** (Fig. 9) .

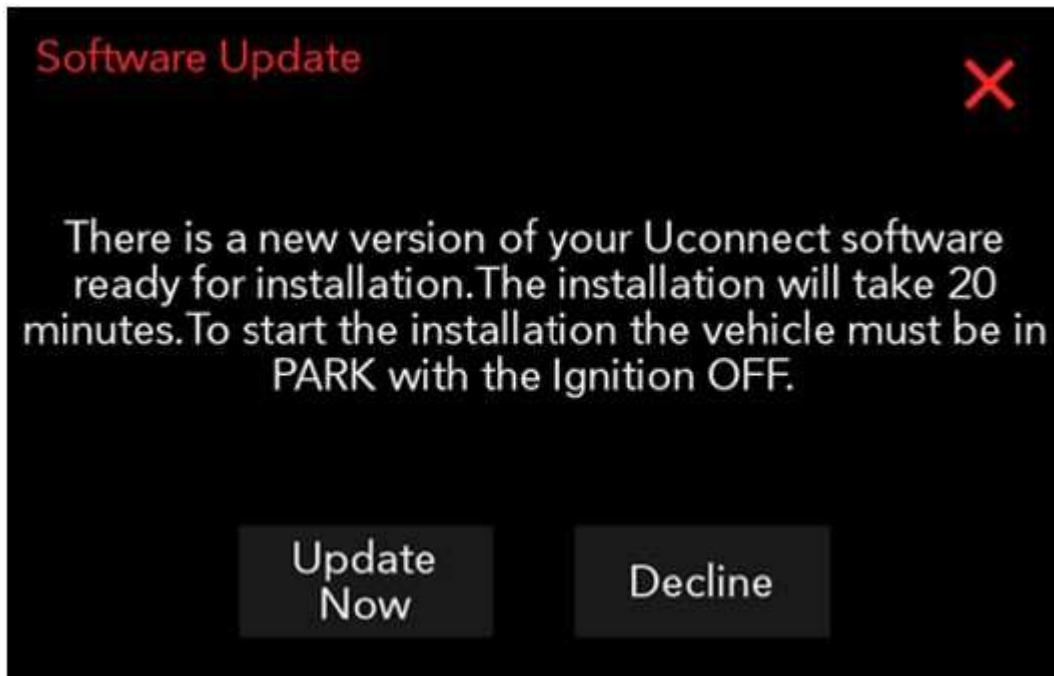


Fig. 9  
Software Update Is Available

14. If the ignition is turned off before the two minute has expired, the software update will be canceled (Fig. 10) .

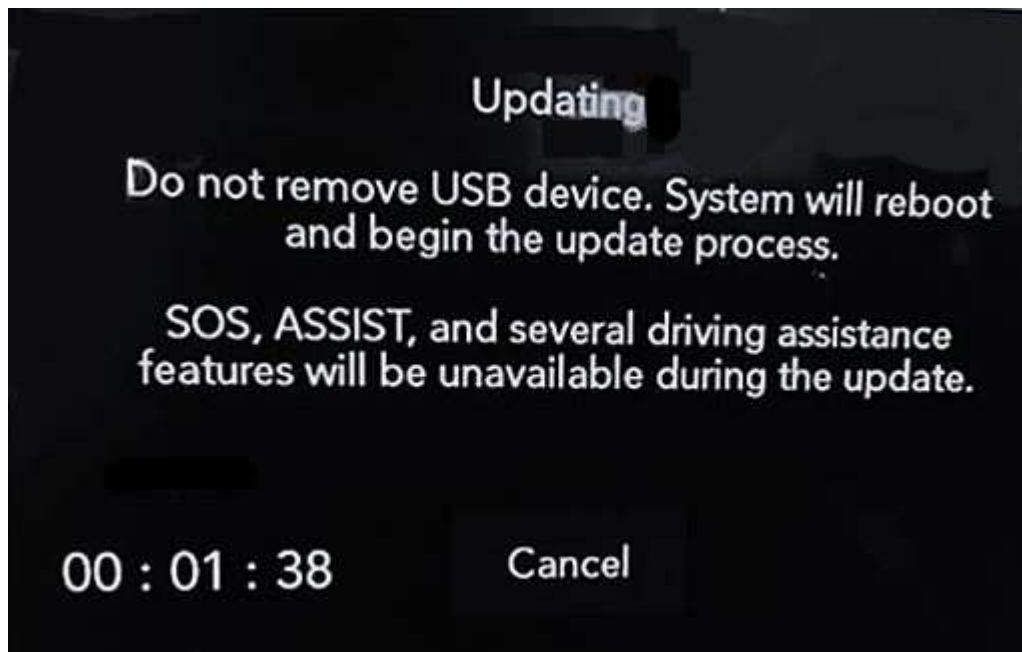


Fig. 10  
Radio Update Process Begins



15. The radio will reboot and the update will begin (Fig. 11) .



Fig. 11  
Software Update In Progress

**NOTE:** Some display screens will not be displayed, if the ignition is turned off during the update.

16. After the update has completed, the radio will shut down. With the USB flash drive still inserted in the USB port, turn the ignition back to the run position. If the radio has been updated correctly, the screen in (Fig. 12) will be displayed. Press "OK" and remove the USB flash drive.



Fig. 12  
Software Levels (The figure is for reference only, actual software levels will be \*\*21.9\*\*)

17. Press the Nav icon at the bottom of the touchscreen. Verify that the Navigation menu comes up on the screen.

18. Using the wiTECH, clear all DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

**NOTE: After performing the radio update, the radio display screen may have a ghost image that will not clear even after turning off the ignition. This ghost image may appear on any radio screens selected. Do not replace the radio for this concern, turn the vehicle off and allow the radio and vehicle to enter a full power down cycle. A full power down cycle may take between 45 to 60 minutes.**

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-60-02-QU	Radio, Check Software Level (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
**18-60-02-ZQ	Create USB Jump Drive from Uconnect Website (One Time Only) (0 - Introduction)	6 - Electrical and Body Systems	1.4 Hrs.
18-60-02-ZR	Check Radio Software Level and Perform Software Update (0 - Introduction)	6 - Electrical and Body Systems	1.1 Hrs.**

**NOTE: The “One Time Only” LOP is used one time per dealer when downloading the software onto a USB flash drive. The dealer can only use the download LOP, one time for each of the radios listed.**

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 60 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

**The dealer must choose which failure code to use depending on if this is a Rapid Response Transmittal (RRT) or Service Bulletin.**

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RRT.
- The failure code “RF” (Required Flash) can no longer be used on Service Bulletin flashes. **The “RF” failure code must be used on an RRT.**
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.

RF	Required Flash - RRT
CC	Customer Concern