



23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Jetta, Jetta SportWagen	2009-2012	2.0L TDI (CBEA, CJAA)	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2041063/11	7/2/19	23-17-06	Add additional warranty claiming instruction.
2041063/10	6/12/19	23-17-06	Removal of fuel pre-analysis requirement.
2041063/1	6/24/15	V231503	Original publication.

One or more of the following fault codes may be stored in the ECM Fault Memory:

DTC	Description
P0087	Fuel Rail/System Pressure - Too Low
P0088	Fuel Rail/System Pressure - Too High
P0191	Fuel Rail Pressure Sensor "A" Circuit Range/Performance

Technical Background

When diagnosing the condition above on a common rail diesel vehicle, if no root cause is found after checking all other components and all GFF diagnostic procedures have been performed, it may be necessary to check for metallic particles in the High Pressure Fuel Pump using the service section of this bulletin.

If such an inspection is necessary, the following guidelines must be observed when removing the **-N290-** Fuel Metering Valve.

Production Solution

No production change required.



23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

Service

Initial Diagnosis of the High Pressure Fuel Pump (HPFP)



Note:

Removing the **-N290-** Fuel Metering Valve to inspect for metallic particles should only be considered as a last step after all GFF diagnostic procedures have been performed. This includes testing supply pressure to the high pressure fuel pump (low pressure side), and checking for internal leakage from the injectors and the **-N276-** Fuel Pressure Regulating Valve.

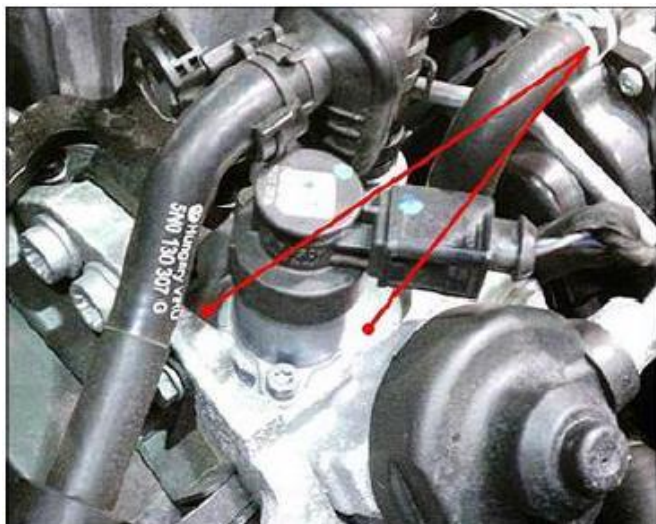


Figure 2. Surrounding Area



Note:

Prior to removing the **-N290-** Fuel Metering Valve, the area surrounding the valve (Figure 2) must be clean and dried with compressed air to remove ALL debris from the area. See Repair Manual Group 20 Fuel Supply, General Information, Clean Working Conditions in Elsa.

If debris enters the fuel system, components may be damaged.



Figure 3. N290 Fuel Metering Valve and Valve Bore

1. Remove the **-N290-** Fuel Metering Valve and inspect the valve and valve bore for the presence of metallic particles (see Figure 3).




23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

2. If metallic particles are found on the **-N290-** Fuel Metering Valve or in the valve bore, replacement of the high pressure fuel pump and major components in the fuel system is necessary. (See High Pressure Fuel Pump Replacement and Fuel System Repair section below).

3. If no metallic particles are found on the **-N290-** Fuel Metering Valve or in the valve bore, do not replace the high pressure fuel pump. Open a VTA case and contact the Volkswagen Technician's Helpline for further assistance diagnosing the vehicle, this bulletin does not apply.

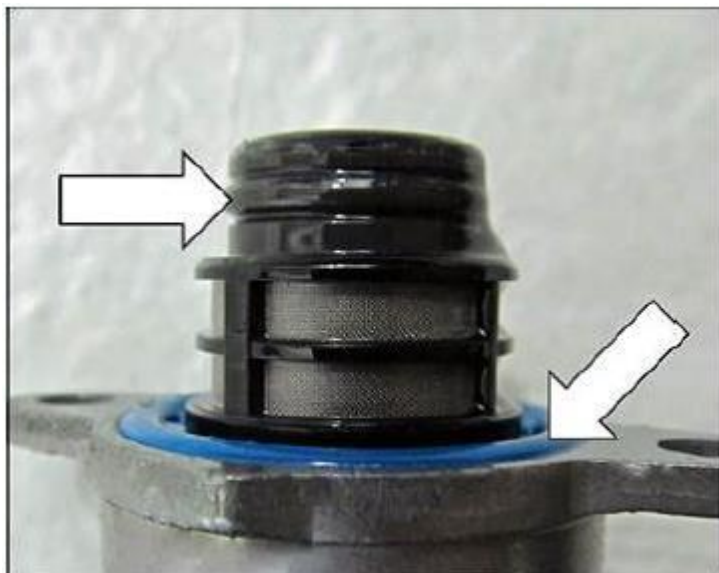

! Note:

To prevent fuel system damage, ensure that the **-N290-** Fuel Metering Valve is free of any contaminants before reinstalling.

Prior to reinstallation of the **-N290-** Fuel Metering Valve, ensure that both O-rings are not damaged. If they are damaged, the high pressure fuel pump must be replaced.

To prevent damaging the O-rings when reinstalling the **-N290-** Fuel Metering Valve, lubricate the O-rings with diesel fuel (see Figure 4).

Figure 4. N290 Fuel Metering Valve O-rings

4. Install the **-N290-** Fuel Metering Valve into the valve bore using light pressure.
 5. Install and hand tighten both M5 fasteners, ensuring that the threads are clean and dry.
- Pre-tighten to 2 Nm, then to 6.5 – 7 Nm.

High Pressure Fuel Pump Replacement and Fuel System Repair

1. Always use the latest information in Elsa for detailed removal and replacement instructions of the components listed in this technical bulletin.
2. Remove in-tank fuel pump (Sending unit).
3. Drain and clean the fuel tank using the suction pump VAS5226.
4. Fill the fuel tank with **(1.3 gallons)** of fresh diesel fuel.
5. Drain and clean the tank completely using VAS5226.
6. Replace the in-tank fuel pump (Sending unit).
7. Flush the fuel lines (both feed and return) from the fuel tank to the bulk head, using either mineral spirits or brake clean with compressed air. Alternate from both ends of the lines while using a shop towel to catch any debris that may still be in the line. Verify all metal is removed from both lines before proceeding.

**23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)**

Release date: 7/2/2019

8. Replace the following components as per Elsa: high pressure fuel pump, high pressure fuel lines, fuel rail (with both sensors included), all fuel injectors, fuel return lines (overflow lines), fuel filter, fuel filter housing, auxiliary fuel pump.

**Note:**

The rubber fuel line insulators from the original injector supply lines should be transferred to the new lines.

9. Once repairs are complete fuel the vehicle.

10. Ensure the fuel injector return lines are properly seated and sealed once it is installed.

**Note:**

The “injector quantity calibration” and the “injector voltage calibration” for the new injectors must be programmed into the -**J623**- Engine/Motor Control Module after replacing one or more injectors. Refer to “Guided Functions” in the vehicle diagnostic tester.

11. Using the VAS tester, perform the guided function “Vent Fuel System”. (see Elsa for additional information under “Fuel System, Filling and Bleeding”).

**Note:**

If the test plan is unavailable through Guided Functions, switch to Self Diagnosis>Engine Electronics>Basic Settings>35 and perform the basic settings 3 times consecutively. For UDS vehicles, perform basic settings for initial fueling.

12. Once the repairs are complete, test drive the vehicle.

13. Inspect for fuel seepage at the fuel injector return line connector. If seepage is found the condition MUST be corrected.



23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

Warranty



TIP:

Always verify Extended Emission Warranty (EEW) coverage in ELSA.



Note:

The Extended Emission Warranty must cover all parts and labor, as well as the cost or provision of a loaner vehicle for warranty service lasting longer than 3 hours for, among other things, repairs to the entire fuel system, including the fuel pumps, high pressure common rail, fuel injectors, and all sensors and actuators (DOJ 1st and 2nd Partial Consent Decrees, Appendix B, Section 3.9).

Active VW Customer Mobility Program (VWCMP) loaner vehicles are eligible to receive \$35 per day for loaner expense reimbursement under this warranty extension. For dealers enrolled in the VWCMP, a non-VWCMP loaner vehicle can be provided at a reimbursement rate of \$25 per day or a VW rental at \$35 if a VWCMP loaner is not available. These claims must be submitted in SAGA on a separate line using claim type 1SP. Refer to document VWS-14-01 for applicable labor operation.

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾

Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Golf, Jetta, Jetta SportWagen	2009-2012	2.0L TDI (CBEA, CJAA)	All	All	All
SAGA Coding					
Claim Type:	Use applicable Claim Type ¹⁾				
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)		
2374	0010	--	--		
Parts Manufacturer	Golf, Jetta, Jetta SportWagen			BPY or BPT ²⁾	
Labor Operation ³⁾ : Fuel System Clean and Replacement			23744299 = 750 TU		
Causal Part: High Pressure Fuel Pump			*** 130 775* OR ***130 851**		
Outside Material: Diesel Fuel			Part Number: DIESEL		



23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

Diagnostic Time ⁴⁾		
GFF Time expenditure	01500000 = As required	YES
Road Test	01210004 = 10 TU	YES
Technical Diagnosis	01320000 = As required	YES
Claim Comment: Input "As per Technical Bulletin 2041063" in comment section of Warranty Claim.		
<p>¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only.</p> <p>²⁾ Vendor code BPY or BPT must be recorded from the original High Pressure Fuel Pump.</p> <p>³⁾ Labor Time Units (TUs) are subject to change with ELSA updates.</p> <p>⁴⁾ Documentation required per Warranty Policies and Procedures Manual.</p>		

Required Parts and Tools

2009-2012 Jetta, Golf



Note:

Part numbers are for reference only; please consult ETKA by VIN for most current information.

Part No:	Part Description	Quantity
03L 130 851AX	High pressure pump	1
03L130321	Line	1
03L 130 301	Line	1
03L 130 301R	Line	1
03L 130 301B	Line	1
03L 130 301C	Line	1
03L 130 089	Rail	1
5N0 130 307J	Line	1
1K0 127 400F	Filter complete	1
03L 130 235S	Return Line	1
03L 130 277A	Injectors	4

**23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)**

Release date: 7/2/2019

03L 103 113	Injector Seal Plate	4
5N0 906 129B	Auxiliary Pump	1
059 130 216 C	Plate	4
WHT 000 884	Seal	4
03L 201 360G	Fuel Line	1
1K0 130 307BJ	Fuel Hose	1
1K0 130 307BG	Fuel Line	1
N 910 488 02	Bolt	4
N 107 158 01	Bolt	3
038 109 454A	Nut	1
N 911 803 01	Bolt	3
WHT 002 494	Bolt	1
N 107 145 01	Bolt	2
1K0 919 050 AB	In-Tank fuel pump (sending unit)	1
	All torque to yield bolts must be replaced	All

2009-2012 Jetta SportWagen**Note:****Part numbers are for reference only; please consult ETKA by VIN for most current information.**

Part No:	Part Description	Quantity
03L 130 851AX	High pressure pump	1
03L130321	Line	1
03L 130 301	Line	1
03L 130 301R	Line	1
03L 130 301B	Line	1

**23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)**

Release date: 7/2/2019

03L 130 301C	Line	1
03L 130 089	Rail	1
5N0 130 307J	Line	1
1K0 127 400F	Filter complete	1
03L 130 235S	Return Line	1
03L 130 277A	Injectors	4
03L 103 113	Injector Seal Plate	4
5N0 906 129B	Auxiliary Pump	1
059 130 216 C	Plate	4
WHT 000 884	Seal	4
03L 201 360G	Fuel Line	1
1K0 130 307BJ	Fuel Hose	1
1K0 130 307BG	Fuel Line	1
N 910 488 02	Bolt	4
N 107 158 01	Bolt	3
038 109 454A	Nut	1
N911 803 01	Bolt	3
WHT 002 494	Bolt	1
N 107 145 01	Bolt	2
1K0 919 050 AB	In-Tank fuel pump (sending unit)	1
	All torque to yield bolts must be replaced	All



23-17-06 - MIL ON, No Start, or Rough Running with DTCs P0087, P0088 or P0191 (TDI ONLY)

Release date: 7/2/2019

Tool Description	Tool No:
Midtronics Battery Tester/Charger	InCharge 940 (INC-940) or GRX3000VAS
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X with ODIS Service with: current online updates

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2019 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.