

**Noise Symptom - Creaking Noise can be Heard When Touching the Steering Wheel Cover:  
Reworking Front Steering Wheel Cover (SY 87/20)**

Model Line: **Taycan (Y1A)**

Model Year: **As of 2020**

Subject: **Front steering wheel cover**

Symptom: Creaking noise can be heard when touching the steering wheel cover.

Cause: Play between front and rear steering wheel covers.

Remedial Action: Apply felt to increase the pretension.

Model Line: **911 Carrera (992)**

Model Year: **As of 2020**

Equipment: **7-speed manual transmission (I-no. G1M)**

**7-speed manual transmission for all-wheel drive (I-no. G1L)**

Subject: **Front steering wheel cover**

Symptom: Creaking noise can be heard when touching the steering wheel cover.

Cause: Play between front and rear steering wheel covers.

Remedial Action: Apply felt to increase the pretension.

**Required tools and parts**

Tools: • Scissors

Parts Info:	Part No.	Designation	Qty.
	N 90799102	⇒ Countersunk screw	1 ea.
	00004320744	⇒ Felt strip, 30 mm x 5 meters	0.1


**Preparatory work**

Work Procedure: 1 Remove steering wheel, see ⇒ *Workshop Manual '481019 Removing and installing steering wheel'*

**Reworking front steering wheel cover**

Work Procedure: 1 Remove rear steering wheel cover ⇒ *Rear steering wheel cover -1-*.

- 1.1 Unscrew and remove screws ⇒ *Rear steering wheel cover -2-*.
- 1.2 Loosen clip connections ⇒ *Rear steering wheel cover -3-*.
- 1.3 **Only for vehicles with heated steering wheel:** Lift rear steering wheel cover up slightly, remove steering wheel heating switch ⇒ *Heated steering wheel switch -1-* in direction of arrow ⇒ *Heated steering wheel switch -A-* and detach the relevant wire harness.

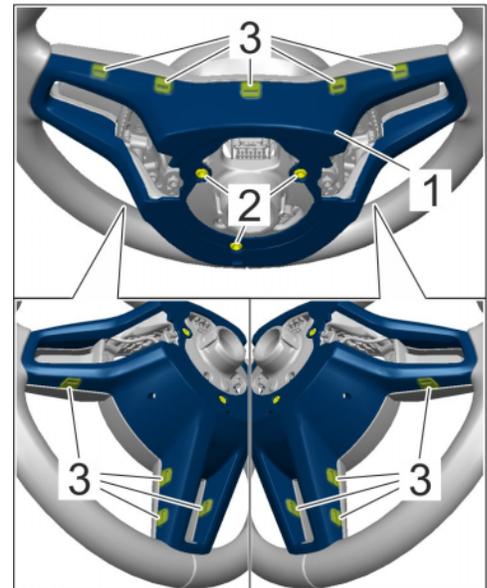


*Rear steering wheel cover*



*Heated steering wheel switch*

- 2 Reworking front steering wheel cover ⇒ *Front steering wheel cover -1-*.
  - 2.1 Cut the felt strip ⇒ *Front steering wheel cover -2-* to length.
  - 2.2 Affix the felt strip ⇒ *Front steering wheel cover -2-* to the underside of the clip connections ⇒ *Front steering wheel cover -3-* to achieve sufficient pretension.

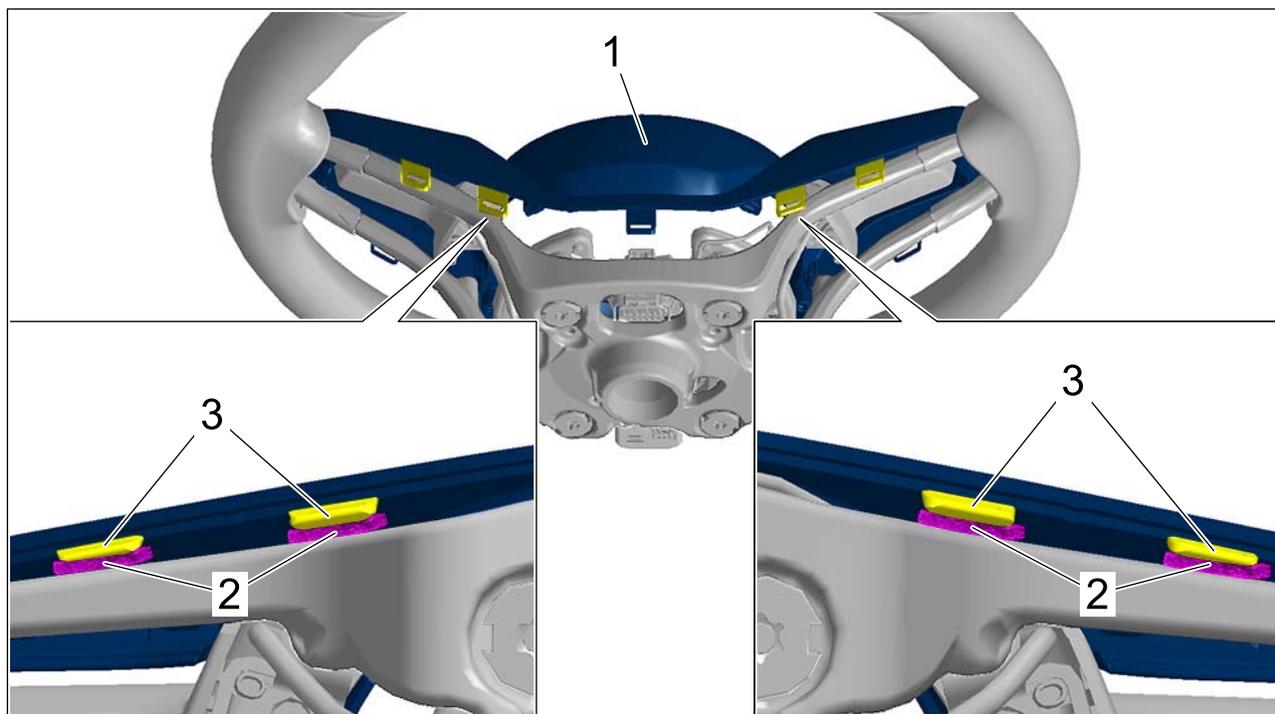


Front steering wheel cover

3 Install rear steering wheel cover ⇒ *Rear steering wheel cover -1-*.

3.1 **Only for vehicles with heated steering wheel:** Insert steering wheel heating switch and route the relevant wire harness.

3.2 Secure clip connections ⇒ *Rear steering wheel cover -3-*.

3.3 Insert screws ⇒ *Rear steering wheel cover -2-* and fasten the **Tightening torque 2.8 Nm (2 ftlb.)** .

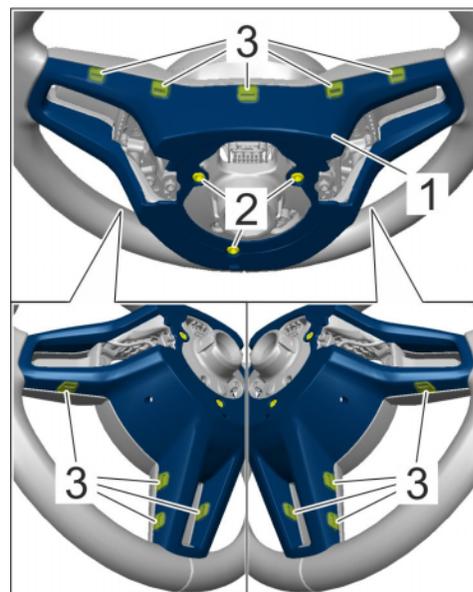

Rear steering wheel cover

**Concluding work**

Work Procedure: 1 Install steering wheel, see ⇒ *Workshop Manual '481019 Removing and installing steering wheel'*

**Invoicing**

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labor operation	I No.
48124900	Reworking steering wheel cover	

PQIS coding:

Location (FES5)	48120	Steering wheel cover
Damage type (SA4)	2017	creaks, squeaks

Parts Info:	Part No.	Designation	Qty.
	N 90799102	⇒ Countersunk screw	1 ea.
	00004320744	⇒ Felt strip, 30 mm x 5 meters	0.1

References: ⇒ *Workshop Manual '481019 Removing and installing steering wheel'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2020 Porsche Cars North America, Inc.