

**Symptom - Body Exterior - Reversing Camera/Reversing Camera Spray Nozzle Does Not Function: Checking Rear Wire Harness (SY 131/20)**

Model Line: **Taycan (Y1A)**

Model Year: **2020**

Country/Market: **USA (C02)**

Equipment: **Reversing camera system (I-no. KA2)  
Front camera system and reversing camera system (I-no. KA6)**

Subject: **Reversing camera/reversing camera spray nozzle**

Symptom:
 

- Reversing camera does not function
- Reversing camera spray nozzle does not function

Cause: The wire harness or hose line for the reversing camera spray nozzle may be touching the vehicle bodyshell and can become damaged over the service life of the vehicle.

Remedial Action: In the event of a customer complaint, check the wire harness and replace it if necessary. Also secure the hose line to the wire harness using a tie-wrap.

Date of Introduction: Modified parts used from:

<b>Date</b>	05/18/2020
<b>VIN</b>	WPOAC2Y16LSA71493

**Parts required**


PartsInfo:	Part No.	Designation	Qty.
	9J1971104D	⇒ Wire harness for bumper (I-no. KA2)	1 ea.
		<b>or</b>	
	9J1971104E	⇒ Wire harness for bumper (I-no. KA6)	1 ea.
		<b>Additional parts required</b>	
	9A700837900	⇒ Tie-wrap	1 ea.

**Preparatory work**

Work Procedure: 1 Remove rear apron, see ⇒ *Workshop Manual '635519 Removing and installing rear apron'*.

**Checking rear wire harness**

- Work Procedure: 1 Check rear wire harness and hose line for reversing camera spray nozzle ⇒ *Hose line for reversing camera spray nozzle -1-* for damage and replace them if necessary, see ⇒ *Workshop Manual '972519 Removing and installing rear wire harness'*.
- 2 Secure hose line for reversing camera spray nozzle ⇒ *Hose line for reversing camera spray nozzle -1-* to the rear wire harness with a tie-wrap ⇒ *Hose line for reversing camera spray nozzle -2-* as shown.

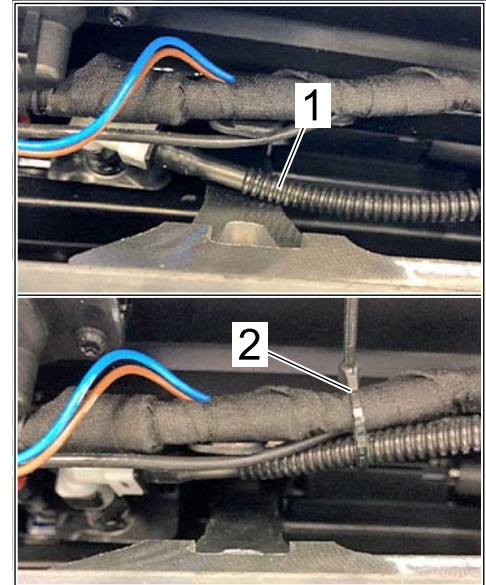

*Hose line for reversing camera spray nozzle*

**Concluding work**

Work Procedure: 1 Install rear apron, see ⇒ *Workshop Manual '635519 Removing and installing rear apron'*.

**Invoicing**

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labor operation	I No.
97251400	Securing rear wire harness	
97251900	Replacing rear wire harness	

PQIS coding:

Location (FES5)	91430	Reversing camera
Damage type (SA4)	1611	does not function

Parts Info:	<b>Part No.</b>	<b>Designation</b>	<b>Qty.</b>
	9J1971104D	Wire harness for bumper (I-no. KA2)	1 ea.
		<b>or</b>	
	9J1971104E	Wire harness for bumper (I-no. KA6)	1 ea.
		<b>Additional parts required</b>	
	9A700837900	Tie-wrap	1 ea.

References:   ⇒ *Workshop Manual '635519 Removing and installing rear apron '*  
                   ⇒ *Workshop Manual '972519 Removing and installing rear wire harness'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2020 Porsche Cars North America, Inc.