

GLOBAL SAFETY FIELD INVESTIGATIONS  
DCS5509  
URGENT - DISTRIBUTE IMMEDIATELY

Date: September 21, 2020

Subject: A202310450 - Service Update  
Engine Control Module Reprogramming for DTC P2B95 or P2B96 Set

Models: 2020 – 2021 Buick Encore GX  
2021 Chevrolet Trailblazer  
Equipped with 1.2L, 3-cylinder Gas Engine (RPO LIH)

To: All General Motors Dealers

General Motors is releasing Service Update A202310450 today. The total number of U.S. vehicles involved is approximately 22,350. Please see the attached bulletin for details.

**Global Warranty Management (GWM)**

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated September 22, 2020 or sooner. A list of involved vehicles in dealer new inventory is attached to this message. Please hold all warranty transactions until IVH has been updated.

END OF MESSAGE  
GLOBAL SAFETY FIELD INVESTIGATIONS

# Service Update

## A202310450 Engine Control Module Reprogramming for DTC P2B95 or P2B96 Set



**Release Date:** September 2020

**Revision:** 00

**Attention:** This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

Make	Model	Model Year		RPO	Description
		From	To		
Buick	Encore GX	2020	2021	LIH	1.2L, 3-cylinder gas engine
Chevrolet	Trailblazer	2021	2021		

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

<b>Condition</b>	Certain 2020 and 2021 model year Buick Encore GX and 2021 model year Chevrolet Trailblazer vehicles, equipped with 1.2L gasoline engine (RPO LIH), may have condition that a MIL illuminates on the dash and technicians may find one or more following DTC(s) sets: P2B95, P2B08, P2B09, P2B0A, P2B96, P2B00, P2B01, or P2B02.
<b>Correction</b>	Dealers are required to reprogram the engine control module.

### Parts

No parts are required for this repair.

### Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9105094*	Verified Module Software or Calibration Level: Module Is Programmed with Same Level Software or Calibration	0.2	ZFAT	N/A
9105095*	Engine Control Module Reprogramming with SPS	0.3		

\* To avoid warranty transaction rejections, carefully read and follow the instructions below:

The SPS Warranty Claim Code must be accurately entered in the "SPS Warranty Claim Code" field of the transaction.

When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "SPS Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS.

### Warranty Claim Code Information Retrieval

If the SPS Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS system as follows:

1. Open TIS on the computer used to program the vehicle.
2. Select and start SPS.
3. Select Settings.
4. Select the Warranty Claim Code tab.

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

### Service Procedure

**Caution:** Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

**Note:** Carefully read and follow the instructions below.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.

# Service Update

## A202310450 Engine Control Module Reprogramming for DTC P2B95 or P2B96 Set



- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to [www.gmdesolutions.com](http://www.gmdesolutions.com) for further information. If not available, connect a fully charged 12V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, etc.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.


The screenshot shows the Techline Connect software interface. At the top, there is a navigation bar with 'DASHBOARD', 'GDS2', 'SI', and 'SPS2' tabs. The 'SPS2' tab is active. Below the navigation bar, there is a header for 'Electronic Brake Control Module - Programming'. A table lists calibration items with columns for Controller, ID, and Current #. A dialog box is overlaid on the table, displaying the error message: 'M4521: You are attempting to reprogram with the same calibration. Select OK to continue, Cancel to Stop!'. The dialog box has 'OK' and 'Cancel' buttons. At the bottom of the interface, there are buttons for 'Print', 'Save to PDF', 'ECU Data', 'Back', 'Start Programming', and 'Cancel'. The VIN field is visible at the bottom right of the interface.

Controller	ID	Current #	Description
K17	1	84820771	
K17	2	84820790	
K17	3	84820797	84820797 Electronic Brake Diagnostic Calibration
K17	4	84820801	84820801 Function Enable Calibration
K17	5	84820808	84820808 Driver mode brake calibration
K17	6	84820819	84820819 Tire Pressure Calibration
K17	7	84820825	84820825 Caliper Assist Calibration

5644477

# Service Update

## A202310450 Engine Control Module Reprogramming for DTC P2B95 or P2B96 Set

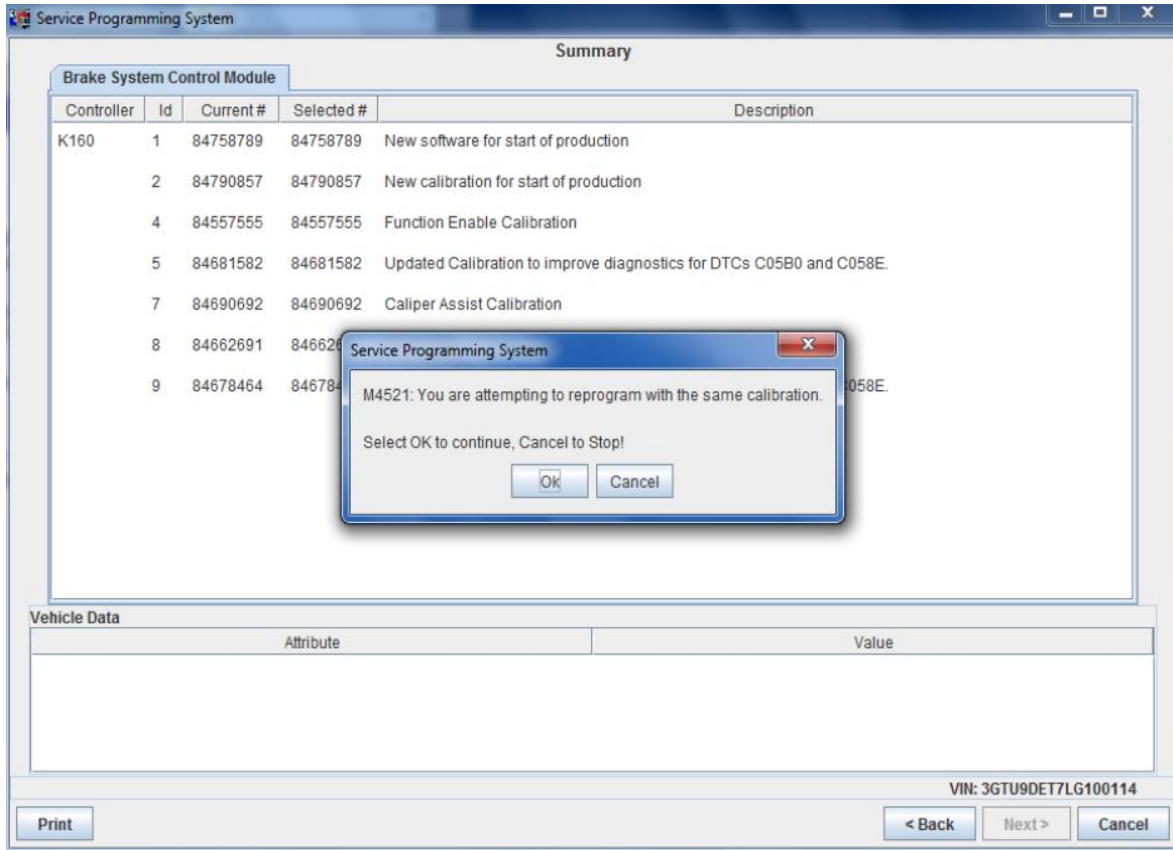


5431207

**Important:** Techline Connect and TIS2WEB screens shown above.

**Important:** If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.


1. Reprogram the Engine Control Module. Refer to *K20 Engine Control Module: Programming and Setup* in SI.

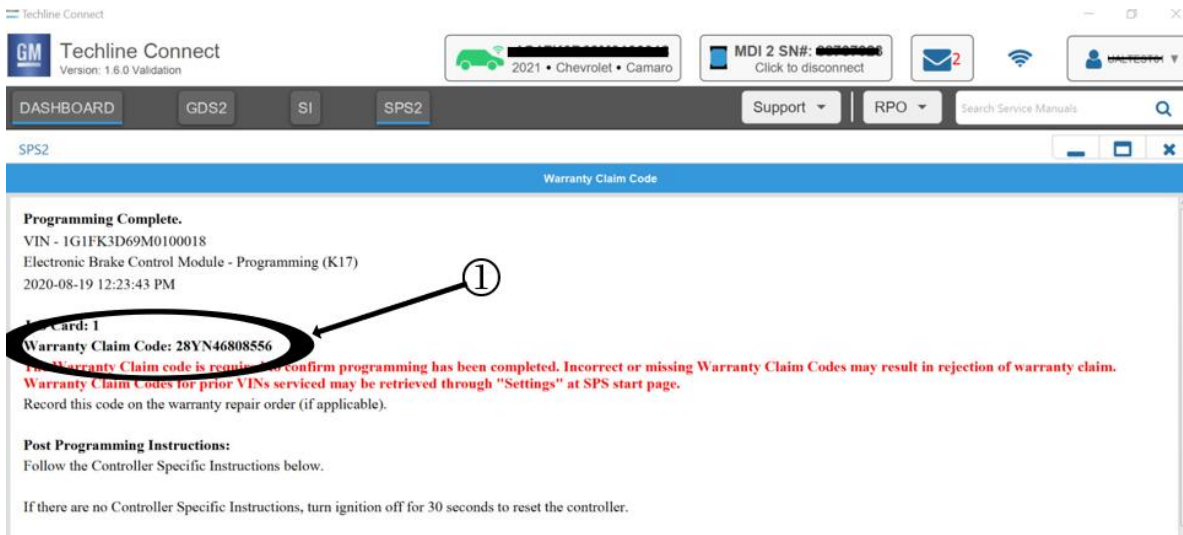

5644478

## Service Update

# A202310450 Engine Control Module Reprogramming for DTC P2B95 or P2B96 Set

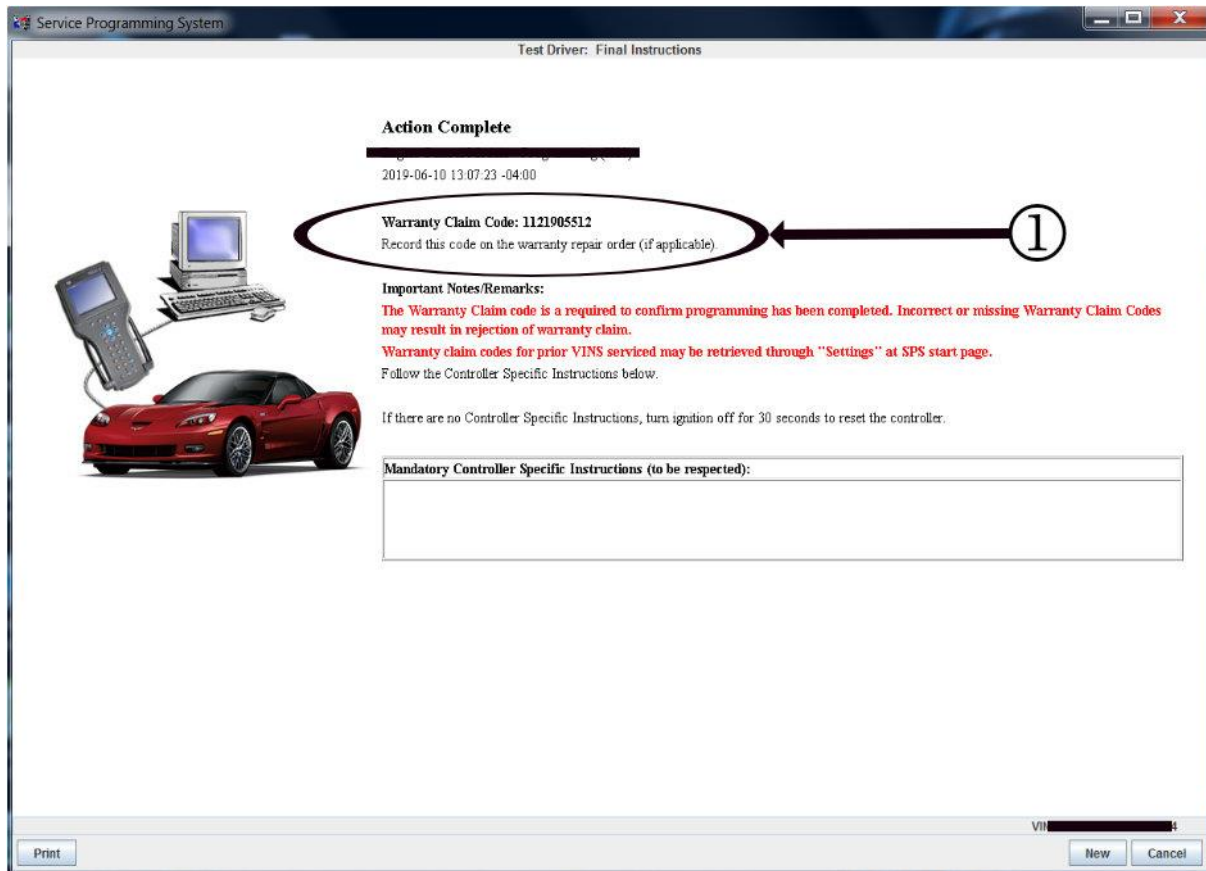

5431209

**Important:** To avoid warranty transaction rejections, you **MUST** record the warranty claim code provided on the Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the screen.

- Record SPS Warranty Claim Code on job card for warranty transaction submission.

### Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repared per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

## Service Update

A202310450 Engine Control Module Reprogramming for DTC  
P2B95 or P2B96 Set



### Dealer Reports

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support  
Voluntary Technician  
Certification**