

Technical product information

Topic	Rotating screen alignment
Market area	Bentley: worldwide (2WBE),Hongkong-Macau (5HK)
Brand	Bentley
Transaction No.	2051526/5
Level	EH
Status	Released for publishing
Release date	21-Oct-2020

New customer code

Object of complaint	Complaint type	Position
information, navigation, communication, entertainment -> instrument cluster, displays, display panels -> MMI display swivel mechanism -> tip-switch for display panel mechanism	component / consumables -> snags	
information, navigation, communication, entertainment -> instrument cluster, displays, display panels -> MMI display swivel mechanism	component / consumables -> loose	
body fixtures and fittings -> dash panel, centre console -> dash panel trim	visual appeal / surface -> colour shade deviation	upper

Vehicle data

New Continental GT - New Continental GTC and New Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S4*	2019	E		*	*	*
3S4*	2020	E		*	*	*
3S4*	2021	E		*	*	*
ZG2*	2020	E		*	*	*
ZG2*	2021	E		*	*	*

Documents

Document name
master.xml

Customer statement / workshop findings

The chrome brightware strip on the “veneer face” fascia panel of the Bentley Rotating Display (BRD) may appear to be misaligned with the chrome strips on the passenger and drivers side fascia panels.

In addition, the gapping and fit between the “veneer face” fascia panel of the “BRD” and the passenger and drivers side fascia panels may differ from one side to the other.

Technical background

The chrome brightware strip is fixed to the “veneer face” fascia panel with no separate adjustment and as such can appear to be misaligned. The “veneer face” fascia panel relies on fixed location pins that may be out of tolerance.

Rework the “veneer face” fascia panel to align the chrome brightware strip and/or the gapping between the “BRD” and the passenger and drivers side fascia panels.

Production change

Updated machining programme in Woodshop to bring all reference point system (RPS) locators to within the specified tolerances.

Measure

Prior to carrying out any rectification work, always ensure that the Bentley Rotating Display (BRD) has been reinitialised. Refer to Repair Group 91, “Rotating display - To initialise”. Repeat this process each and every time after carrying out any of the following work.

Bentley Rotating Display “BRD” adjustment overview

The veneer face fascia panel is fixed to the “BRD” by six locator pins and receiving holes. See Figure 1.

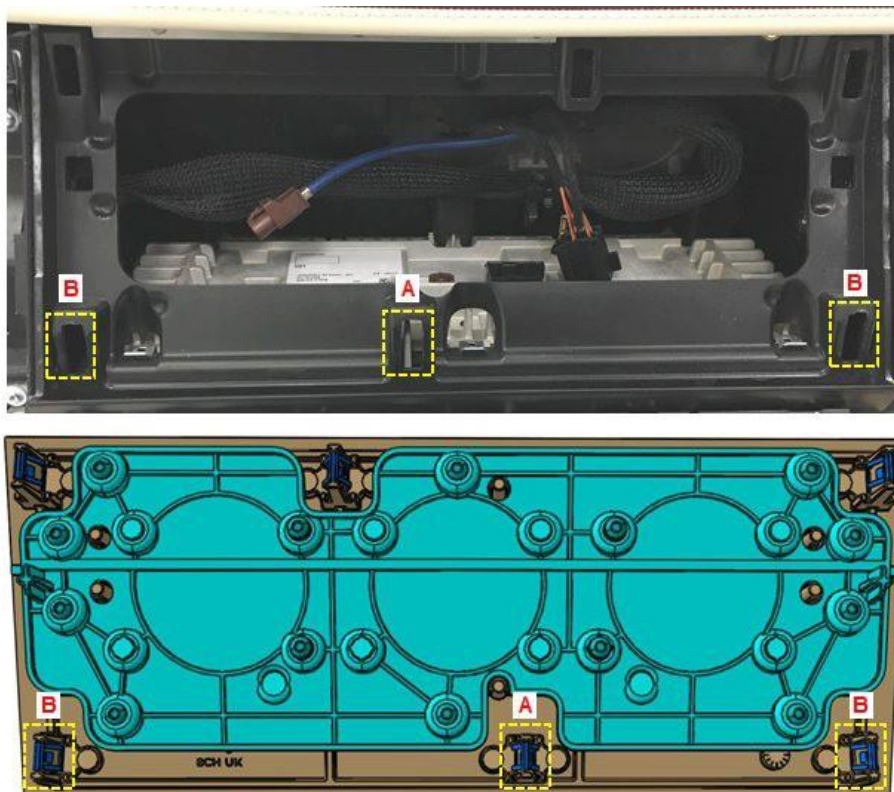


Figure 1

The following locator pins (A & B) control the position of the fascia panel as follows:

A = Side to side axis

B = Up and down axis

Section 1 - To adjust the “BRD” veneer face in the side to side axis

Measure the gaps (A & B) between the veneer face fascia panel and the passenger and drivers side fascia panels. See Figure 2.



Figure 2

The specified gapping is 1.5mm +/- 0.5mm tolerance. The gap between the "BRD" veneer face fascia panel and passenger and drivers side fascia panels **MUST** be parallel on both sides.

If the gaps are not within the specified values then adjust as follows.

Remove the driver and passenger side dashboard fascia panels. Refer to Repair Group 70, "Dashboard fascia panels- To remove and fit".

Remove the veneer face fascia panel from the "BRD". Refer to Repair Group 91, "Rotating display veneer panel- To remove and fit".

Place the veneer face fascia panel (1) face down on a soft, clean and protective work surface and mark accordingly the direction in which the panel needs to move (arrow). See Figure 3.

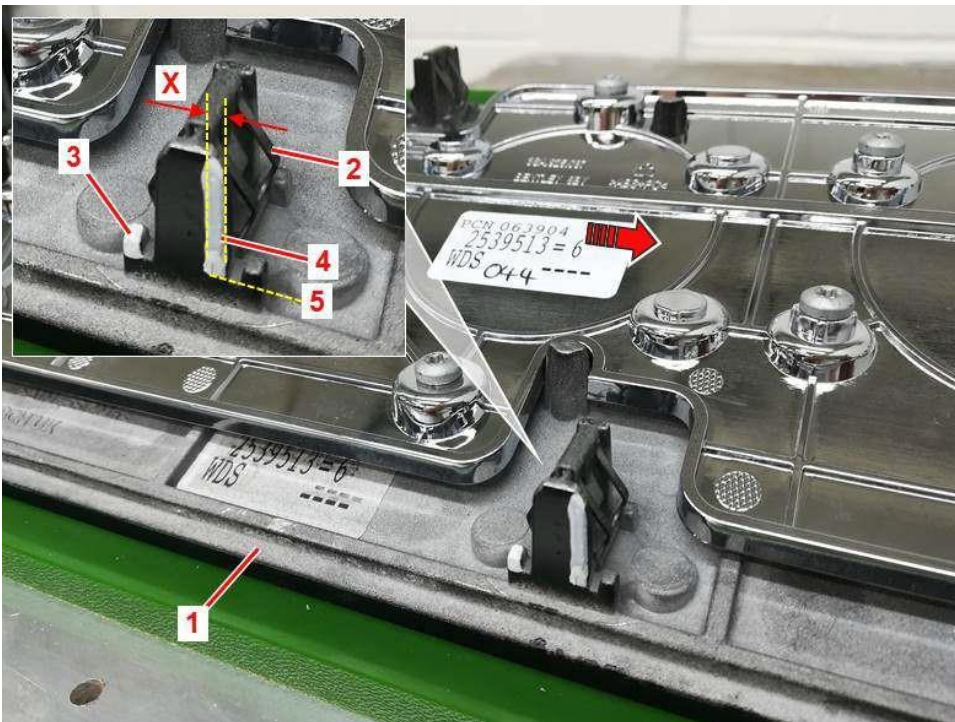


Figure 3

i Only the centre lowermost locator pin shown governs the side to side movement of the fascia panel. Only this locator pin will require modifying.

Remove the spring retaining clip (2) from the lowermost locator pin. If the fascia panel requires moving by 0.5mm then remove the same amount of material (X) from the appropriate side of the lower centre locator pin (4) as shown on the aluminium substrate casting. In addition, file the trailing RPS point (3) flat, level with the recess. See Figure 3.

Figure 4 shows what the central locator pin should reflect after filing. The RPS point (1) being filed flat level with the recess. The side of the locator pin (2) being filed to remove the correct amount of material, again down to the level of the recess.

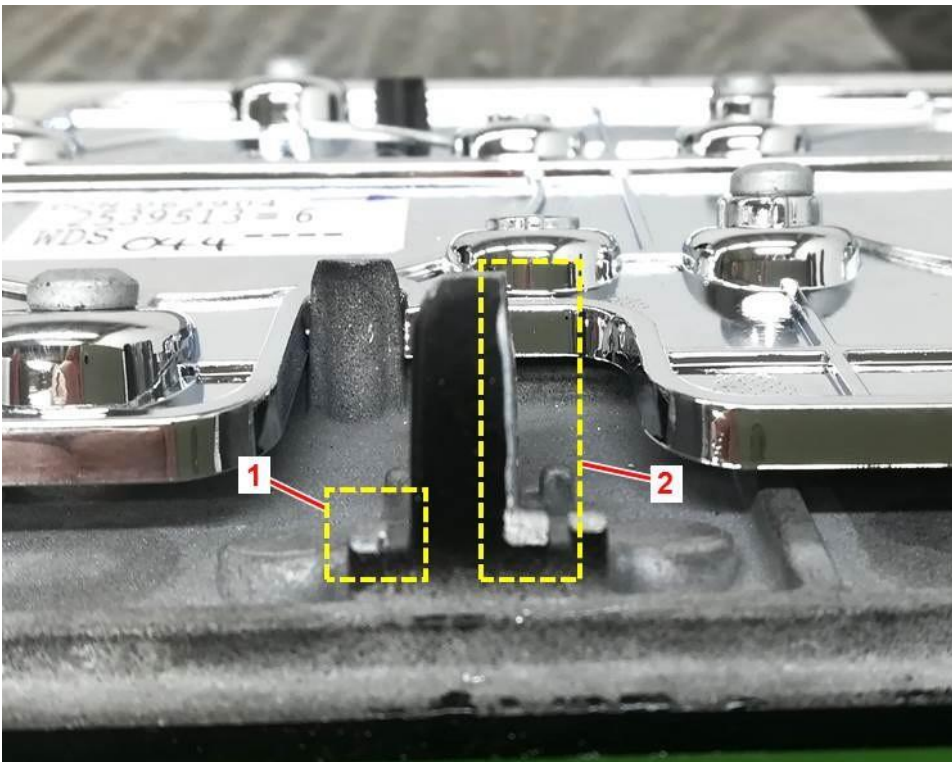


Figure 4

Refit the spring clip on the locator pin.

Adhere anti-creak tape (arrow 1) to the lower centre locator pin receiving hole on the “BRD”, on the opposite side to which the fascia panel needs to move. This will “push” the veneer face fascia panel in the required direction. See Figure 5.

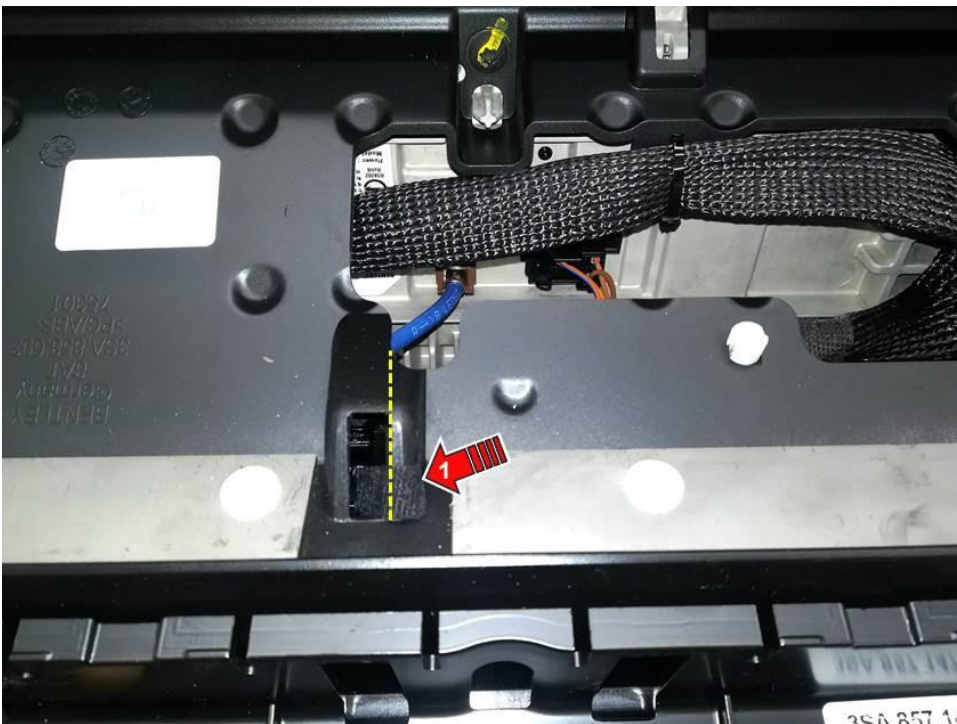


Figure 5



Several layers of anti-creak tape may be required in order to push the fascia panel to the required amount.

Refit the veneer face fascia panel to the “BRD”. Refer to Repair Group 91, “Rotating display veneer panel - To remove and fit”.

Temporarily refit the driver and passenger side dashboard fascia panels. Refer to Repair Group 70, “Dashboard fascia panels - To remove and fit”.

Switch on the ignition and reinitialise the “BRD”. Refer to Repair Group 91, “Rotating display - To initialise”.

Again measure the gaps (A & B) between the veneer face fascia panel and the passenger and drivers side fascia panels. See Figure 6.



Figure 6

The correct gapping is 1.5mm +/- 0.5mm tolerance. The gap between the veneer face fascia panel and passenger and drivers side fascia panels MUST be parallel on both sides.

If the gaps are not within the specified values then add/remove anti-creak tape to adjust accordingly.

If the gaps are within the specified tolerance, refit all trim components.

Section 2 - To adjust the "BRD" veneer face in the vertical axis

Visually check that the chrome brightware strip on the "veneer face" fascia panel is aligned with the chrome strips at points A & B on the passenger and drivers side fascia panels. See Figure 7.



Figure 7

The specified tolerance in the vertical plane (A & B) is 0.5mm.

If the chrome brightware strip on the "veneer face" fascia panel is out of line, carry out the following to adjust the panel.

Remove the dashboard fascia panels. Refer to Repair Group 70, "Dashboard fascia panels- To remove and fit".

Remove the veneer face fascia panel from the "BRD". Refer to Repair Group 91, "Rotating display veneer panel- To remove and fit".

Place the veneer face fascia panel face down on a soft, clean and protective work surface.

 Only carry out the following steps on the required side. If the veneer face fascia panel only requires aligning on one side, then carry out the following steps on that particular side only.

Carefully file the ribs (arrow) on TOP of the lowermost outer locator pin/s (1) of the fascia panel casting (2), to leave them flat and smooth. See Figure 8.

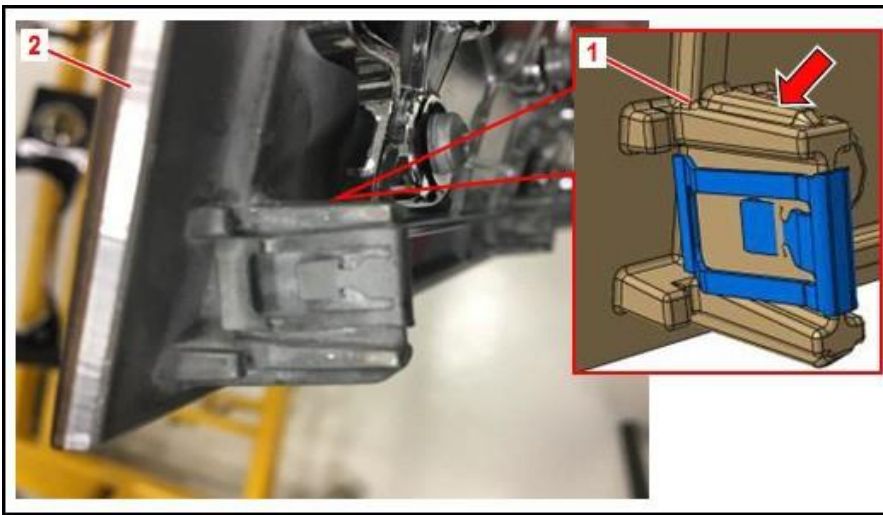


Figure 8

i Do NOT remove any more material than required. If in doubt remove a small amount at a time.

Apply anti-creak tape (arrow) to the opening section of the appropriate locating pin receiving hole as shown in Figure 9.



Figure 9

i Several layers of anti-creak tape may be required in order to push the fascia panel to the required amount. Apply the tape in the bottom to lift the fascia panel up, or apply the tape in the top to push the fascia panel down.

Refit the veneer face fascia panel to the "BRD". Refer to Repair Group 91, "Rotating display veneer panel - To remove and fit".

Temporarily refit the driver and passenger side dashboard fascia panels. Refer to Repair Group 70, "Dashboard fascia panels - To remove and fit".

Switch on the ignition and reinitialise the "BRD". Refer to Repair Group 91, "Rotating display - To initialise".

Visually check that the chrome brightware strip on the "veneer face" fascia panel is aligned with the chrome strips at points A & B on the passenger and drivers side fascia panels. See Figure 10.



Figure 10

The tolerance in the vertical plane (A & B) is 0.5mm.

If the chrome brightware strip on the “vener face” fascia panel is still out of line, and is not within the specified tolerance then add/remove anti-creak tape to adjust accordingly.

If the chrome strip is within the specified tolerance, refit all trim components.

Section 3 - To adjust passenger side and drivers side fascia panels in the inboard and outboard axis

Adjust (where necessary) the “BRD veneer face” fascia panel in both side to side and up and down axis as previously described.

 Caution.

Under no circumstances should any attempt be made to adjust the “BRD” module inboard or outboard by adjusting any of the four setting screws (arrows) shown in Figure 11.

The setting screws (arrows) are factory sealed and any attempt to make adjustments via these four screws may result in failure of the rotating display and/or information display touch screen.

Any evidence of tampering will void warranty claims.

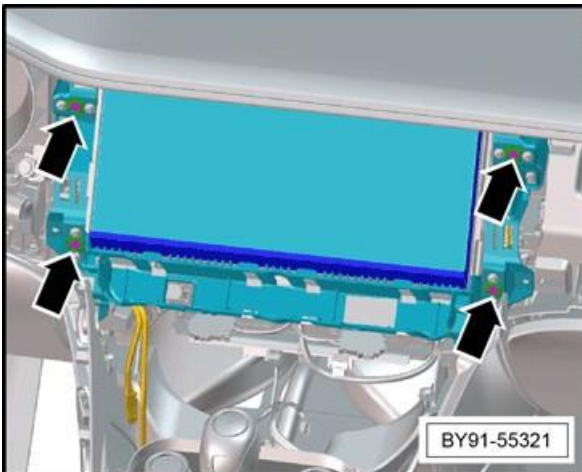


Figure 11

Measure the profile (D) between the “BRD” veneer face fascia panel and the passenger and drivers side fascia panels. See Figure 12

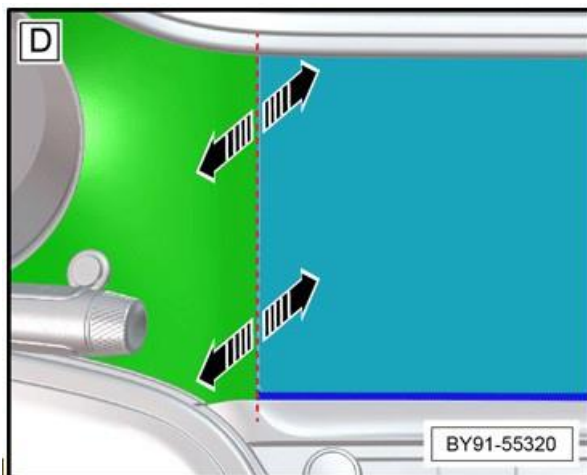


Figure 12

The specified setting dimension for the “BRD” fascia panel is -0.5mm (under flush) +/- 0.5mm tolerance and MUST be equal on both sides.

If either of the passenger and drivers side fascia panels are out of tolerance and require adjustment, make a note of which point requires adjustment and by how much on each panel.

Remove the appropriate passenger side or drivers side dashboard fascia panel. Refer to Repair Group 70, “Dashboard fascia panels - To remove and fit”.

Carry out the following on the appropriate panel to bring in line with the “BRD veneer face” fascia panel.

Passenger side fascia panel inboard adjustment

With the fascia panel face down on a soft, clean and protective work surface, remove the appropriate spring clip(s) (arrow) as required. See Figure 13.



Figure 13

i Note. The locator pin (1) is for adjustment the top of the fascia panel and locator pin (2) is for adjusting the bottom of the fascia panel. All other locator pins are not affected.

Carefully file the "RPS" points (arrows) by the required amount that the fascia panel needs to move in.

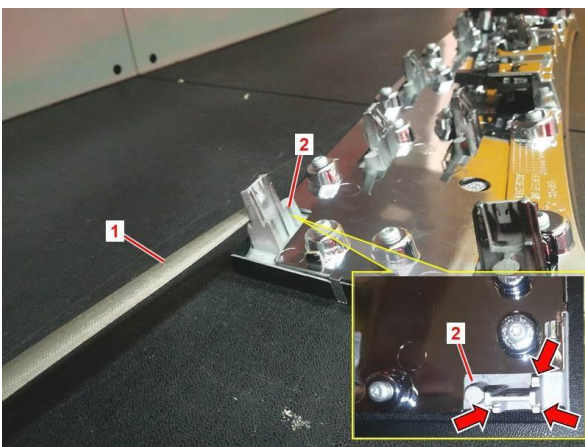


Figure 14

i Note. The upper locator pin (2) has three "RPS" points (arrows) whereas the lower locator pin only has two "RPS" points.

Refit the passenger side fascia panel and check that it fits to the specified tolerances.

Once the specified tolerances are met, refit all trim components.

Passenger side fascia panel outboard adjustment

With the fascia panel removed, apply anti-creak tape around the entire perimeter of the opening section of the appropriate receiving hole as shown in Figure 15.



Figure 15

i Note. Several layers of anti-creak tape may be required in order to push the fascia panel out to the required amount. Position (1) to push the bottom of the fascia panel out and position (2) to push the top of the fascia panel out.

Driver side fascia panel inboard adjustment

With the fascia panel face down on a soft, clean and protective work surface, remove the appropriate spring clip/s from the locator pin.

i Note. The locator pin (1) is for adjusting the bottom of the fascia panel and locator pin (2) is for adjusting the top of the fascia panel. All other locator pins are not affected. See Figure 16.

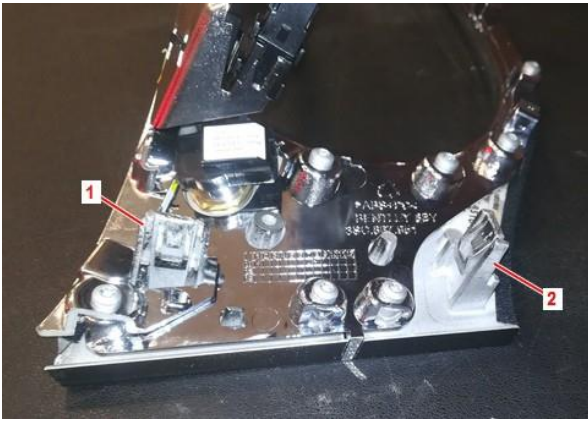


Figure 16

Carefully file the “RPS” points (arrows) by the required amount that the fascia panel needs to move in. See Figure 17

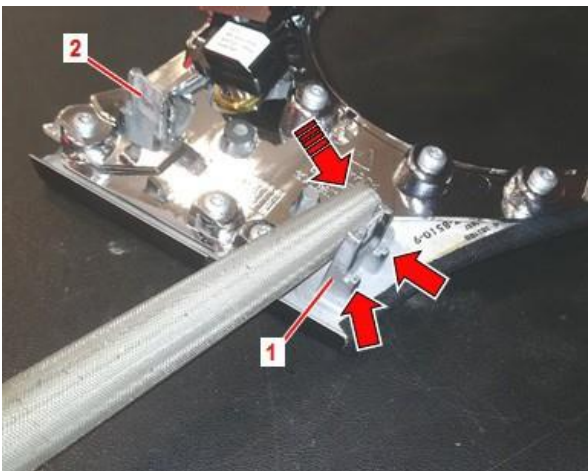


Figure 17

i Note. The upper locator pin (1) has three “RPS” points (arrows) whereas the lower locator pin (2) only has two “RPS” points.

Refit the driver side fascia panel and check that it fits to the specified tolerances.

Once the specified tolerances are met, refit all trim components.

Driver side fascia panel outboard adjustment

With the fascia panel removed, apply anti-creak tape around the entire perimeter of the opening section of the appropriate receiving hole as shown in Figure 18.

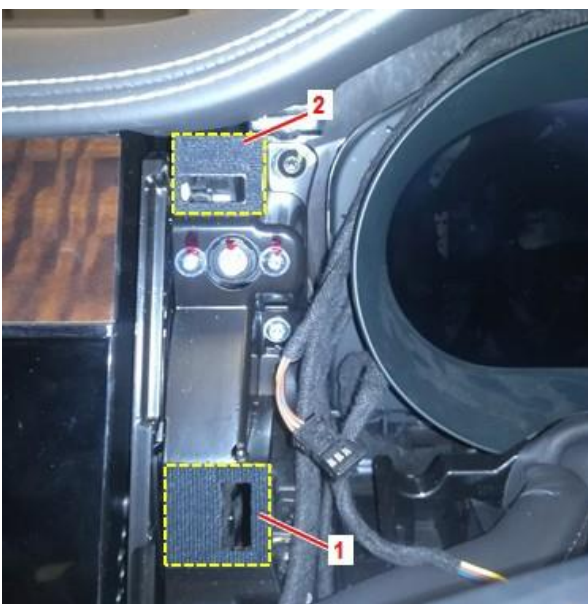



Figure 18

 *Note. Apply anti-creak tape at position (1) to push the bottom of the fascia panel out and position (2) to push the top of the fascia panel out. See Figure 18.*

Once the specified tolerances are met, refit all trim components.

Warranty accounting instructions

Time to conduct Section 1

Damage Information

Warranty type 910 or 110

Service ID number 9132

Damage type 01 00

Labour

Labour operation code 91 32 15 01 (Until 09.04.2020 please use index 99)

Time 60 Time units

Time to conduct Section 2

Labour

Labour operation code 91 32 15 02 (Until 09.04.2020 please use index 99)

Time 70 Time units

Time to conduct Section 3

Damage Information

Labour

Labour operation code 91 32 15 03 (Until 09.04.2020 please use index 99)

Time 80 Time units

Parts information

Anti-creak adhesive tape black. 10mm wide roll. Part No. 3W08008651CW