

Subject: Short Range Radar (SRR) with DTC U3000 49 Set

Brand:	Model:	Model Year:		VIN:		En- gine:	Transmis- sion:
		from	to	from	to		
Cadillac	Escalade Escalade ESV	2021	2021				
Chevro- let	Suburban Tahoe	2021	2021				
GMC	Yukon Yukon XL	2021	2021				

Involved Region or Country	United States, Canada, Mexico, Russia, Middle East, Chile (West), Colombia (West), Ecuador (West), Peru (West), Japan, Cadillac Korea (South Korea), Thailand (ASEAN)
Additional Options (RPOs)	Equipped with RPO UVZ
Condition	Some customers may comment on a DIC message stating Service Driver Assist on display. Technicians may find DTC U3000 49 (Control Module Internal Malfunction) set current or in recent history
Cause	The cause of the condition may be an issue with the SRR setting the DTC due to highly reflective environments. Some temporary faults that trigger DTC 3000.49 are detected while radar is actively radiating. There may also be an issue with the X270 headliner harness to instrument panel harness having loose terminals
Correction	Reprogram the SRR with the latest calibrations and verify concern is fixed. Note: If concern is still present, verify the terminals on the X270 harness are secure and proceed with repair.

Service Procedure


Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to www.gmdesolutions.com for further information. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Follow the on-screen prompts regarding ignition power mode, but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

Important: The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.


- For the TLC application, service technicians need to always ensure that the power mode (ignition) is “ON” before reading the VIN from the vehicle’s VIN master module and that they do not select a VIN that is already in the TLC application memory from a previous vehicle.
- If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.
- The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle’s VIN plate.
- The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle’s VIN plate.

Caution: Be sure the VIN selected in the drop down menu (1) is the same as the vehicle connected (2) before beginning programming.

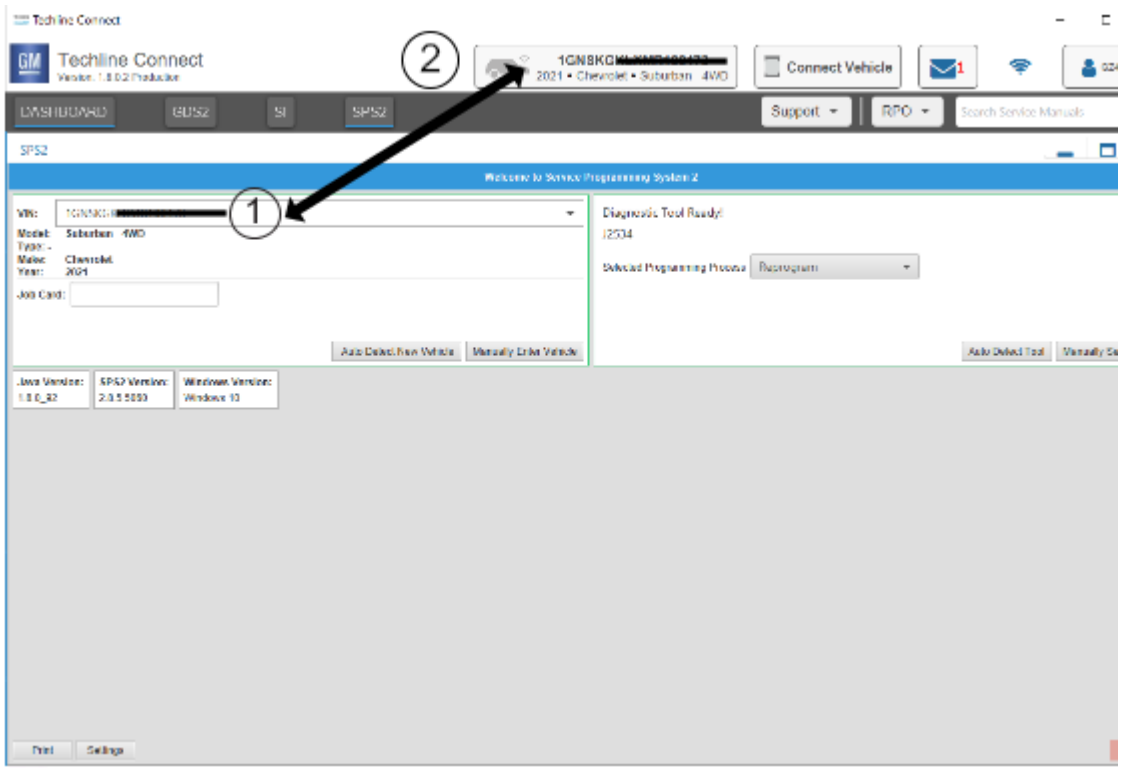

5743643

Important: If the vehicle VIN DOES NOT match, the message below will be shown

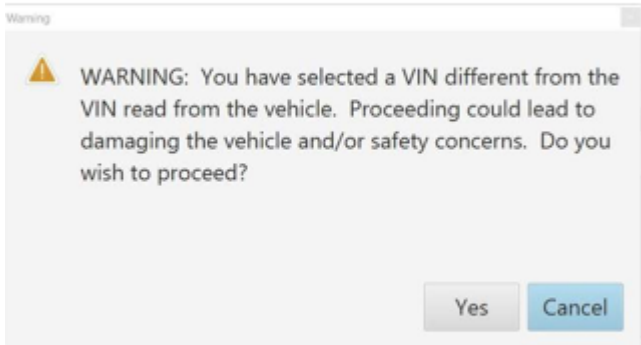

5877000

Techline Connect
Version: 1.0.0 Validation

Dashboard | GDS2 | SI | SPS2

Support | RPD | Search Service Manuals

SPS2


Controller	ID	Current #	Description
K17	1	64620271	
K17	2	64620290	
K17	3	64620297	64620297 64620297
K17	4	64620301	64620301 64620301
K17	5	64620303	64620303 64620303
K17	6	64620319	64620319 64620319
K17	7	64620325	64620325 64620325

M4921: You are attempting to reprogram with the same ID# as before.
Select OK to continue. Cancel to Stop!

OK Cancel

Print | Save to PDF | ECU Data | Back | Start Programming | Cancel

5644477

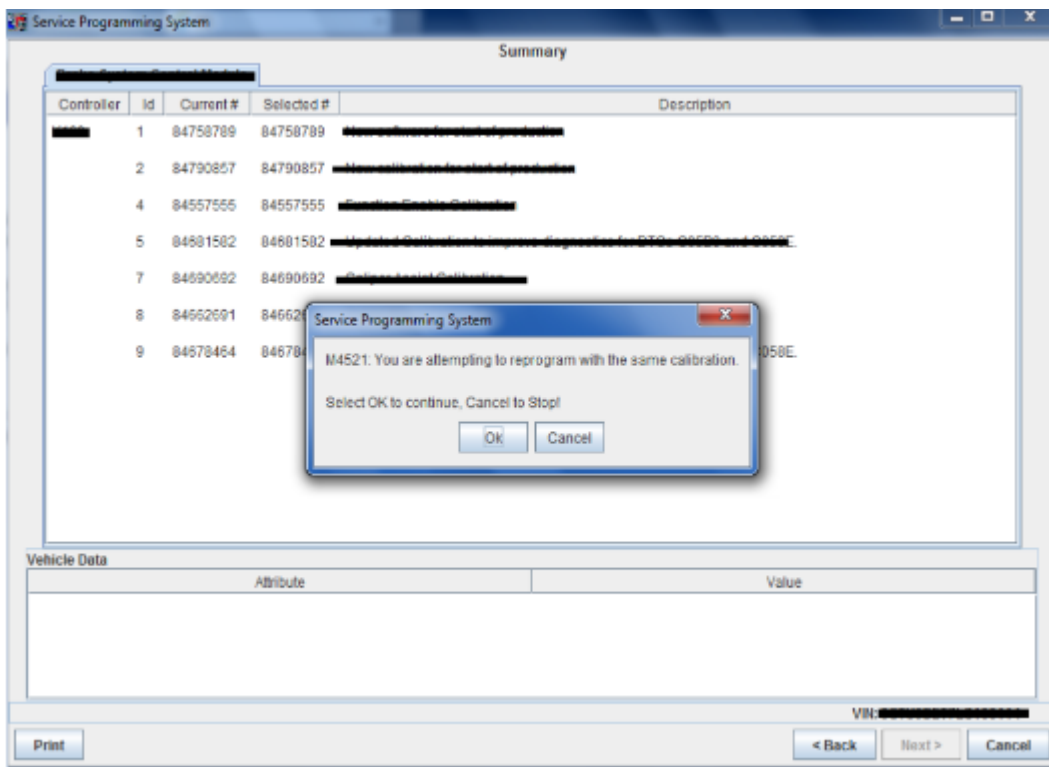

5431207

Important: Techline Connect and TIS2WEB screens shown above.

Important: If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

1. Reprogram the Short Range Radar. Refer to *B233LF Short Range Radar Sensor* in SI.

Offline Connect

GM Techline Connect
Version: 1.8.0 (4/1/2018)

MDI 2 SN#: [REDACTED]
Click to disconnect

Support RPO Search Service Manual

SPS2

Warranty Claim Code

Programming Complete.
VIN [REDACTED]
2020-08-19 12:23:45 PM


Card: 1
Warranty Claim Code: 28YN46808556

Important: Warranty Claim code is required to confirm programming has been completed. Incorrect or missing Warranty Claim Codes may result in rejection of warranty claim. Warranty Claim Codes for prior VINs serviced may be retrieved through "Settings" at SPS start page.
Record this code on the warranty repair order (if applicable).

Post Programming Instructions:
Follow the Controller Specific Instructions below.

If there are no Controller Specific Instructions, turn ignition off for 30 seconds to reset the controller.

5644478

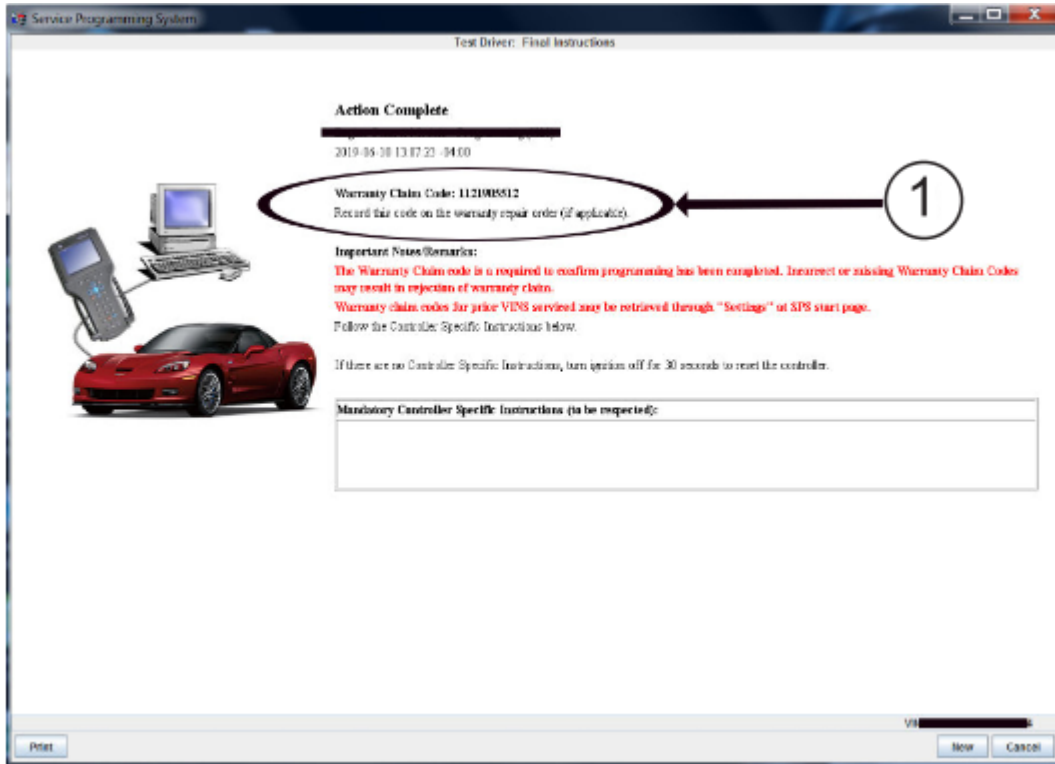

5431209

Note: The screenshots above are an example of module programming and may not be indicative of the specific module that is being programmed. Module selection and VIN information have been blacked out.

Important: To avoid warranty transaction rejections, you **MUST** record the warranty claim code provided on the SPS Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the SPS screen

- Record SPS Warranty Claim Code on job card for warranty transaction submission.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*2888278	Reprogram Short Range Radar	0.3 hr
Add	Check terminals on X270 connector	0.5 hr

*This is a unique Labor Operation for Bulletin use only.

Important: **To avoid warranty transaction rejections, carefully read and follow the instructions below:

- The Warranty Claim Code must be accurately entered in the "SPS Warranty Claim Code" field of the transaction.
- When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "SPS Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS/SPS2.

Warranty Claim Code Information Retrieval

If the SPS Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS system as follows:

1. Open TLC/TIS on the computer used to program the vehicle.
2. Select and start SPS/SPS2.
3. Select Settings.
4. Select the Warranty Claim Code tab.

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Ver- sion	1
Modi- fied	Released November 01, 2021