

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



| | |
|--|---------------------------------|
| Subject: SCBS WARNING LIGHT WITH DTC U045A:68 AND/OR PARKING SENSOR INDICATOR FLASHING WITH DTC B1B36, B1B38, B1B40 AND/OR B1B42 | Bulletin No.: 15-002/22 |
| | Last Issued : 01/27/2022 |

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2017-2021 CX-5 with front parking (ultrasonic) sensor

DESCRIPTION

Some vehicles may exhibit either or both of the following symptoms.

1. The SCBS warning light is illuminated with DTC U045A:68 [FORWARD SENSING CAMERA (FSC)].

| | |
|----------|--|
| U045A:68 | Error signal received from parking assist unit |
|----------|--|


2. The parking sensor indicator is flashing with one or more of the following DTCs of PARKING ASSIST SYSTEM.

| | |
|----------|--|
| B1B36:14 | Front corner ultrasonic sensor (RH) circuit malfunction |
| B1B36:2A | Front corner ultrasonic sensor (RH) characteristic malfunction |
| B1B38:14 | Front ultrasonic sensor (RH) circuit malfunction |
| B1B38:2A | Front ultrasonic sensor (RH) characteristic malfunction |
| B1B40:14 | Front corner ultrasonic sensor (LH) circuit malfunction |
| B1B40:2A | Front corner ultrasonic sensor (LH) characteristic malfunction |
| B1B42:14 | Front ultrasonic sensor (LH) circuit malfunction |
| B1B42:2A | Front ultrasonic sensor (LH) characteristic malfunction |

Due to insufficient waterproof performance of the front harness short cords (1), water may enter in and accumulate in the C-11 (LH) or C-12 (RH) connectors (2) causing a short circuit between wires and an improper signal being sent from the parking (ultrasonic) sensor to the parking sensor unit.

Sample picture shows C-11 connector with water entry and terminal corrosion.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

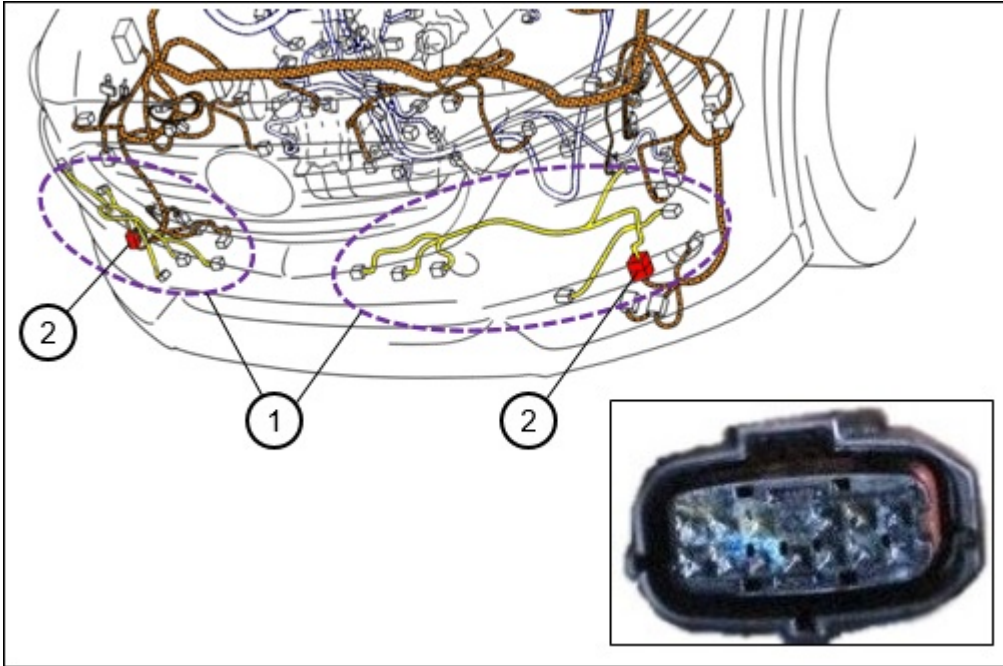

To eliminate this concern, the production process of the front harness short cord has been improved to increase waterproof performance.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Remove the front bumper according to the instructions on MGSS.
 - 2017-2020 CX-5 (FRONT BUMPER REMOVAL/INSTALLATION)
 - 2021 CX-5 (FRONT BUMPER REMOVAL/INSTALLATION).
3. Disconnect the C-11 (LH) or C-12 (RH) connector and check for water entry.
 - If there is any water entry in C-11 or C-12 connector, go to next step.
 - If there is no trace of water entry, this Service Information is not applicable. Diagnose for other causes according to the instructions on MGSS.
4. Replace the front harness short cord (1) of the affected side with a modified one.
5. Blow air to remove any water away from the vehicle harness side C-11 or C-12 connector (2) terminals.
6. Check the terminals of the vehicle harness side C-11 or C-12 connector (2) for corrosion.
 - If there is no corrosion, go to next step.
 - If there is corrosion, cut the wiring harness (3) and replace the connector (2) with a new one.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.


NOTE: For wire cutting, connecting, soldering and protection procedures refer to the following sections on MGSS.
2021 CX-5

- REPAIR CONNECTOR REPLACEMENT/WIRING HARNESS CONNECTION

2017-2020 CX-5

- WIRING HARNESS CONNECTION PROCEDURE
- REPAIR-USE CONNECTOR REPLACEMENT PROCEDURE

NOTE: The left side is shown as a sample.

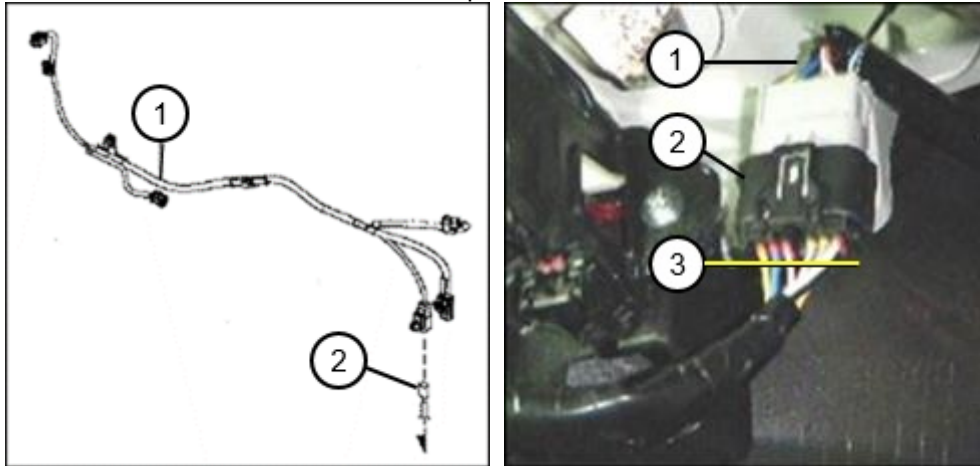

7. Install the bumper according to the instructions on MGSS.

- 2017-2020 CX-5 (FRONT BUMPER REMOVAL/INSTALLATION)
- 2021 CX-5 (FRONT BUMPER REMOVAL/INSTALLATION).

8. [Vehicles with 360°VIEW MONITOR SYSTEM] Perform "Camera aiming adjustment" according to the instructions on MGSS (360°VIEW MONITOR SYSTEM AIMING) since the front bumper (front camera) has been removed.

9. Verify the repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Use VIN to lookup correct part number in EPC.

| Parts Number | Description | Qty. | Notes |
|--------------|---------------------|------|---|
| K262-67-290A | Cord, Short | 1 | 2017-2020 CX-5 (with 8" display and 360 view monitor), (without 360 view monitor) |
| KJK9-67-290 | Cord, Short | 1 | 2021 CX-5 (with 10.25" center display and 360 view monitor) |
| KB9G-67-290 | Cord, Short | 1 | (without 360 view monitor) |
| KSD5-67-290 | Cord, Short | 1 | 2017-2020 CX-5 (with 8" display and 360 view monitor) |
| KSD6-67-290 | Cord, Short | 1 | 2021 CX-5 (with 10.25" center display and 360 view monitor) |
| KSE2-67-290 | Cord, Short | 1 | (without 360 view monitor) |
| N2Z8-67-SH3 | Cord, Short-Connect | 1 | |
| G1Y0-67-TU1 | Tube | 1 | See NOTE below |

NOTE: Quantity of the tube is as below:

| Spec. | Repair | Qty. |
|--|-----------------|--------|
| with 360 view monitor | Right side only | 1 |
| | Left side only | 2 |
| | Both sides | 2 or 3 |
| without 360 view monitor or with 10.25" center display | One side | 1 |
| | Both sides | 2 |

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

| | |
|---------------------------------|---|
| Warranty Type | A |
| Symptom Code | 6X |
| Damage Code | 9R |
| Part Number Main Cause | ****-67-290* |
| Quantity | 1 |
| Operation Number / Labor Hours: | <p>- Without 360 view monitor XXP35ARX /0.5 Hrs. (One side) XXP35BRX /0.6 Hrs. (Both sides)</p> <p>- The camera aiming has been completed by performing "Screen Display Verification" only. XXP35CRX /0.7 Hrs. (One side or both sides)</p> <p>- The camera aiming has been completed by performing both "Screen Display Verification" and "Badge Aiming" XXP35ERX /0.7 Hrs. (One side) XXP35FRX /0.8 Hrs. (Both sides)</p> <p>Includes: Bumper Assembly R&R and Front Short Cord (one side or both sides) R&R</p> <p>If the C-11 and/or C-12 connector has been replaced by cutting the wires for terminal corrosion, add the actual labor time with the following operation number. XXP35XRT / Actual Time</p> |

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.