

Failure of the Display and Control Panel Including Control Unit for Electronically Controlled Air-Conditioning System (BKE): Check Fuse (208/21)

Model Line: **Macan (95B)**

Model Year: **As of 2022**


Concerns: **Display and operator control panel and control unit for electronically controlled air-conditioning system (BKE)**

Information: Customers complain about failure of the display and control panel for the electric air-conditioning system (BKE).

Action required: This may be caused by a defective fuse for the electric air-conditioning system (BKE). An incorrectly installed 10A fuse for the electric air-conditioning system (BKE) was detected during the analysis. In the event of a complaint, check the 10A fuse, which is located in row D, slot no. 8 in the fuse box in the luggage compartment, and replace it with a 15A fuse.

Replacing fuse

- Work procedure:
- 1 Open the fuse box in the luggage compartment.
 - 2 Replace 10A fuse in row D, slot no. 8 with a 15A fuse.
 - 3 Close fuse box in luggage compartment.
 - 4 Switch on ignition and check whether the fault type has been corrected. If not, continue troubleshooting.
 - 5 Read out the fault memory of the PCM and delete it if necessary.

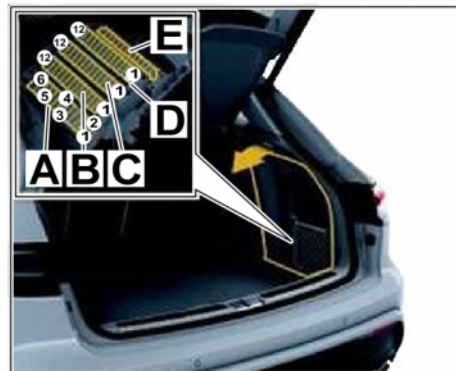

Fuse box luggage compartment

Invoicing

For documentation and invoicing in the event of a guarantee, state the work items required depending on the scope of work and the specified PCSS encryption in the guarantee claim:

APOS	Labor operation	I No.
97925502	Replace fuses	

PCSS encryption:

Location (FES5)	87100	Air conditioning switch
Damage type (SA4)	1611	does not function

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.