

LTB01090NAS2



TECHNICAL BULLETIN

07 FEB 2022

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

This bulletin supersedes TSB LTB01090NAS1/2017 dated 12 OCT 2017, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in blue

SECTION:

211-05

SUBJECT/CONCERN:

Indicator / Wiper Stalks Inoperative or Intermittent Function

AFFECTED VEHICLE RANGE:

MODEL:

MODEL YEAR:

VIN:

ASSEMBLY PLANT:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Discovery Sport (LC)	2015-2018	500006-737211	Halewood
Range Rover Evoque (LV)	2012-2018	000447-283978	Halewood
Discovery (LR)	2017-2018	000001-050759	Solihull
Range Rover Velar (LY)	2018	700070-749014	Solihull
Range Rover Sport (LW)	2014-2018	001154-697086	Solihull
Range Rover (LG)	2013-2018	000010-382987	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The lighting control switch and/or the wiper control switch may not operate or operates intermittently.

CAUSE:

This may be caused by a poor electrical connection at the lighting control switch and/or the wiper control switch.

ACTION:

Follow the instructions below.

PARTS:

NOTE:

One (1) tube of Nyogel electrical lubricant sufficient for 10 vehicles.

PART NUMBER	DESCRIPTION	QUANTITY
LR054614	Nyogel electrical lubricant	1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:**NOTE:**

*When submitting your Warranty claim within the Warranty portal, use the Condition Code list shown to select the Condition Code which best describes the vehicle defect.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Lighting and wiper control switches - Apply Nyogel - Discovery Sport (L550), Discovery (L462), Range Rover Evoque (L538)	86.65.89.38	0.3	*	LR024629
Lighting and wiper control switches - Apply Nyogel - Range Rover (L494), Range Rover (L405)	86.65.89.38	0.2	*	LR024629

NOTE:

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:

1.

NOTE:

The lighting control switch/wiper control switch may also be referred to as steering column multifunction switch.


Remove the lighting control switch (see TOPIx Workshop Manual section 211-05: Steering Column Multifunction Switch).

- Reconnect and disconnect the lighting control switch twice to clean the electrical contact points.

2.

NOTES:

- Do not apply Nyogel to the lighting control switch connector.
- Make sure there is an even coating of Nyogel on the electrical contacts surface.
- Remove any excess Nyogel.

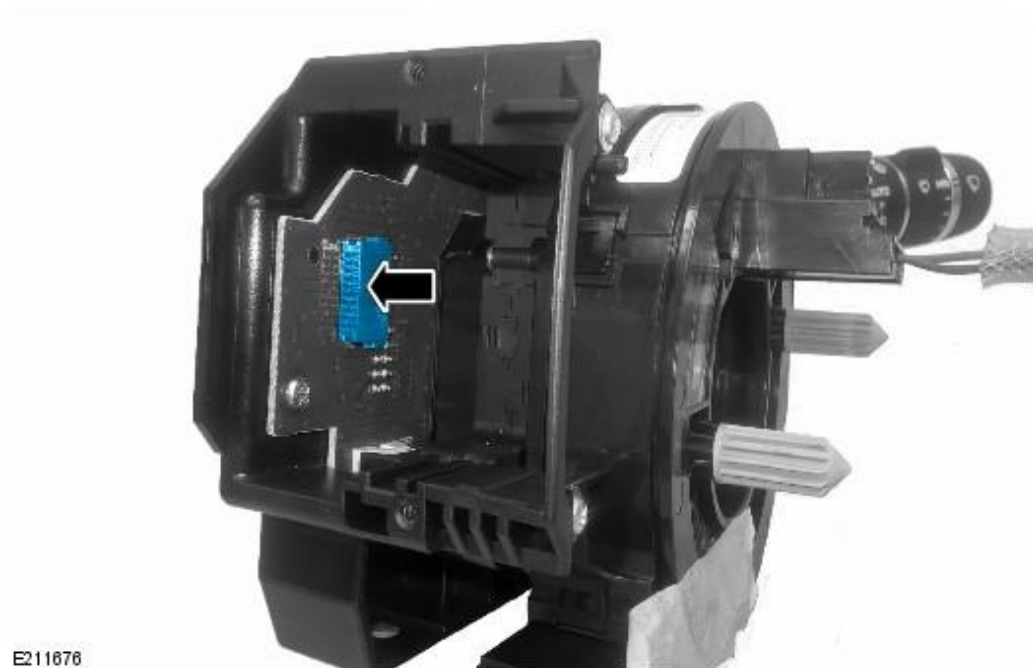

With the lighting control switch removed, apply the Nyogel to the electrical contacts surface.

3. Repeat steps 1-2 for the wiper control switch.

4. To install, reverse the removal procedure.

