

Technical product information

Topic	DTC P1B8100 stored within 006B – Aerodynamic control unit - No test plan in ODIS to assist with diagnosis
Market area	Russische Föderation (5RU),Australia E04 Bentley rest Asia and Australia (6E04),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Arab Emirates E06 Bentley Middle East and Africa (6E06),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)
Brand	Bentley
Transaction No.	2068151/1
Level	EH
Status	Approval
Release date	

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
006B - Aerodynamic control module	P1B8100: tbd.		Intermittent
006B - Aerodynamic control module	P1B8100: tbd.		static

New customer code

Object of complaint	Complaint type	Position
body fixtures and fittings -> spoilers, air intake grilles, brackets	functionality	
vehicle service -> vehicle diagnosis	control units, services	

Vehicle data

New Continental GT

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*
3S3*	2023	E		*	*	*

Documents

Document name
master.xml

DTC P1B8100 stored within 006B – Aerodynamic control unit - No test plan in ODIS to assist with diagnosis

Customer statement / workshop findings

DTC P1B8100 stored within 006B - Aerodynamic control unit - No test plan in ODIS to assist with diagnosis

Technical background

Diagnostic Trouble Code (DTC) logged in the Aerodynamics Control Unit (Address 6B) - The DTC is 'P1B8100: tbd' has no test plan associated to aid technician with fault

Production change

File error within ODIS and is currently under investigation

Measure

1) Referring to the applicable wiring diagram - Conduct a wiring integrity check between the Adjustable rear spoiler control unit (J223) and the spoiler motor (VX73)

- Should no wiring issues be evident - Referring to Rep.Gr 66 replace the deployable rear spoiler assembly

Warranty accounting instructions

Time to replace the deployable rear spoiler assembly (lifting platform)

Warranty Type 110 or 910

Damage Service Number 66 58

Damage Code 0040

Labour operation code 66 58 19 00

Time 70 Time units


Time to conduct the wiring integrity checks

Labour operation code 97 09 01 00

Time Must not exceed 30 Time units

Parts information

Refer to the ETKA parts catalogue for the deployable rear spoiler assembly (lifting platform as Figure 1) part number

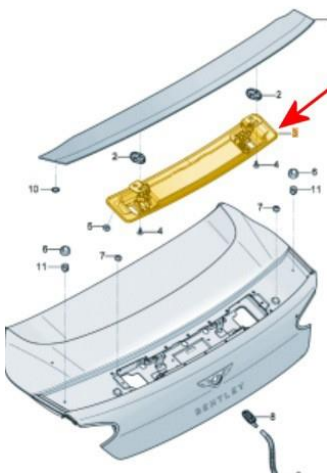

POS	PART NUMBER	DESCRIPTION
3	360 827 851 C	lifting platform ① - 08.08.2019
3B	360 827 851 D	lifting platform ① - 08.08.2019+ - 10.03.2020
3C	360 827 851 E	lifting platform ① - 14.03.2020+ -
4	9 911 485 81	Hexagon socket oval head 8 (torx)
5	9 962 867 85	Hex. nut, self-locking with washer
6	360 827 488 8	stop buffer, adjustable
7	360 827 488	stop buffer adhesive
8	360 827 478 2	Support

Figure 1