



SIB 36 03 22

2022-09-14

SERVICE ACTION: REPLACING THE WHEEL ELECTRONICS OF THE  
TIRE PRESSURE MONITOR (TP

## MODEL

E-Series	Model Description	Production Date
G07	X7 Sports Activity Vehicle	August 15-16, 2022

## AFFECTED VEHICLES

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.


For centers that qualify, this repair is eligible to be performed via Mobile Assistance.

## SITUATION

Loss of tire pressure with corresponding Check Control Message.

## CAUSE

The tire valves were installed without a union nut. A slow leak can develop.

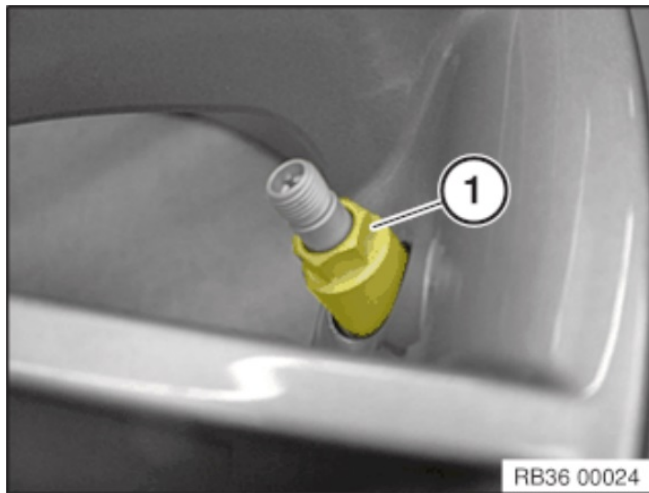

Union nut (1) shown.

## CORRECTION

Replace the wheel electronics modules together with the tire valves of the TPM on all 4 wheels.

## PROCEDURE

Replace all wheel electronics modules (4) with valves of the TPM as per repair instructions REP36 11 535.

## PARTS INFORMATION

Only use and invoice the part number below.

Part Number	Description	Quantity
36 10 6 877 937	Wheel electronics module, TPM 433 MHZ	4

## CLAIM INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the applicable work package information below and the part number listed above at a quantity of 4.

<b>Defect Code:</b>	<b>0036230200</b>	<b>G07 Replace TPM wheel electronics module</b>
---------------------	-------------------	---

Copyright ©2022 BMW of North America, Inc.

**Completion before the first vehicle delivery to a customer or the vehicle is already in the workshop**

Work Pkg	Labor Operation	Description (Plus work)	Labor Allowance
# 1	00 73 556	Replacing all wheel electronics for the Tire Pressure Monitor	30 FRU

Or:

**The vehicle arrives at your center and this Service Action shows open (No other Main work will be performed or claimed during this workshop visit)**

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 2	00 73 020	Replacing all wheel electronics for the Tire Pressure Monitor	31 FRU

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

**Claim Repair Comments**

Only reference the SIB number and the work package (Pkg) number performed in the RO technician notes and the claim comments (For example: B36 03 22 WP 1), unless otherwise required by State law.

And, if applicable:

**Alternative Mobility Solution (AMS) for Vehicle Owners (RO and Claim Comments Required)**

This Service Action repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Defect Code noted above as follows:

Sublet Code 2 - Itemize the AMS sublet amount on the repair order and in the claim comment section.

Please refer to [SI B01 29 16](#) for additional information.

**FEEDBACK REGARDING THIS BULLETIN**

Technical Feedback	To submit feedback for the technical topics of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department