


Technical Service Bulletin

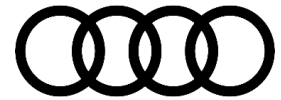

01 Repair Authorization MIL on, DTC P044200 Stored in the ECM
01 23 37 2069166/1 January 17, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, and SQ5	2022 – 2023	All	2.0L Engine

Condition

Customer states:

MIL is on.

Workshop findings:

The following DTC may be stored in the ECM, J623 (address word 0001):

- **DTC: P044200:** EVAP Emission Control System (Small Leak) Leak Detected (Passive/Active)

Technical Background

Various parts have been replaced under warranty for the condition noted above, but no issues were identified with these parts. In an effort to gain information on the DTC codes for the vehicles listed above, we are asking that you contact the Audi Technical Assistance Center (TAC) before replacing any parts. This will assist us in diagnosing any potential issues with the condition noted above.


Production Solution

No changes to production have been made, as no issue has been identified.

Service

Audi of America is requesting your cooperation in supplying us with technical information regarding this condition.

- Verify the condition.
- Perform EVAP testing per the ELSA Repair Manual: *Engine>>Using the Evaporative Emissions tester>> 20 Fuel Supply?? Fuel System EVAP Leak Test>>EVAP System Leak Test, Vehicles with Fuel Tank Leak Detection Control Module (NVLD)>>EVAP system testing.*
- If the vehicle is within the New Vehicle Limited Warranty, contact a TAC consultant before proceeding.
- Please attach the DTC and diagnostic log to the TAC Web Ticket.

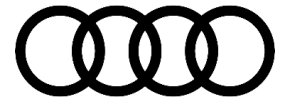

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All parts and service references provided in this TSB (**2069166**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.