

Technical Service Bulletin



93 e-tron: motor control unit - drive system fault - P060C00
93 23 95 2068931/1 February 7, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron Sportback quattro	2020 – 2022	All	Not Applicable
e-tron quattro	2021 – 2022		
e-tron S quattro	2022		

Condition

Customer states:

- Fault message “Drive System Malfunction” appears in the driver information center.

Workshop findings:

- The following DTC may be stored engine control module (ECM), J623 (address word 0001):

DTC P060C00 “Internal Control Module Main Processor Performance” With one of the following Symptom codes: **38462, 39721, 32061, 32326, 40870, 29391.**

Technical Background

Software issue in engine control unit (diagnostic address 0001).

Production Solution

Improved software in production.

Service


SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the Engine Electronics Control Unit (J623) using the SVM action code as listed in the table below, if necessary.



To prevent the high-voltage battery from charging during the software update, the high-voltage charging cable on vehicles with high-voltage components must be unplugged ***BEFORE*** the SVM code is entered. Charging the high-voltage battery during a software update can cause damage to the high-voltage components.

Technical Service Bulletin

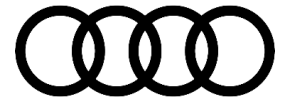

The diagnostic interface must be hardwired to the scan tool.

Model	Old Software Part Number	Old Software Version (or lower)	New Software Part Number	New Software Version (or higher)	SVM Code Input
e-tron and e-tron Sportback	4KE907558	0002	4KE907558	0003	01A307
	4KE907558C	0001	4KE907558C	0003	


Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 			
Service Number:	9370			
Damage Code:	0039			
Labor Operations:	Software update		0151 0000	50 TU
Diagnostic Time:	GFF: (Checking and clearing faults)		0150 0000	Time stated on diagnostic protocol (Max 30 TU)
	Road test prior to service procedure		No allowance	0 TU
	Road test after service procedure		No allowance	0 TU
Claim Comment:	As per TSB 2068931/1			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

Technical Service Bulletin

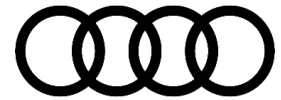

All part and service references provided in this TSB (**2068931**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.