



## Preliminary Information


### PIC6495A Volt battery Section Replacement – missing retainers

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	ELR	2014 - 2016	All	All	All	All
Chevrolet	Volt	2011 - 2015	All	All	All	All
Chevrolet	Volt	2016 - 2019	All	All	All	All

Involved Region or Country	North America
Condition	Dealers replacing a HV battery section for any reason may encounter a replacement section that is missing one or more “tabs” for retaining the wiring harness.
Cause	Due to variances in manufacturing some sections were built missing some retaining tabs, there is no reliability concern from this condition.


#### Correction:

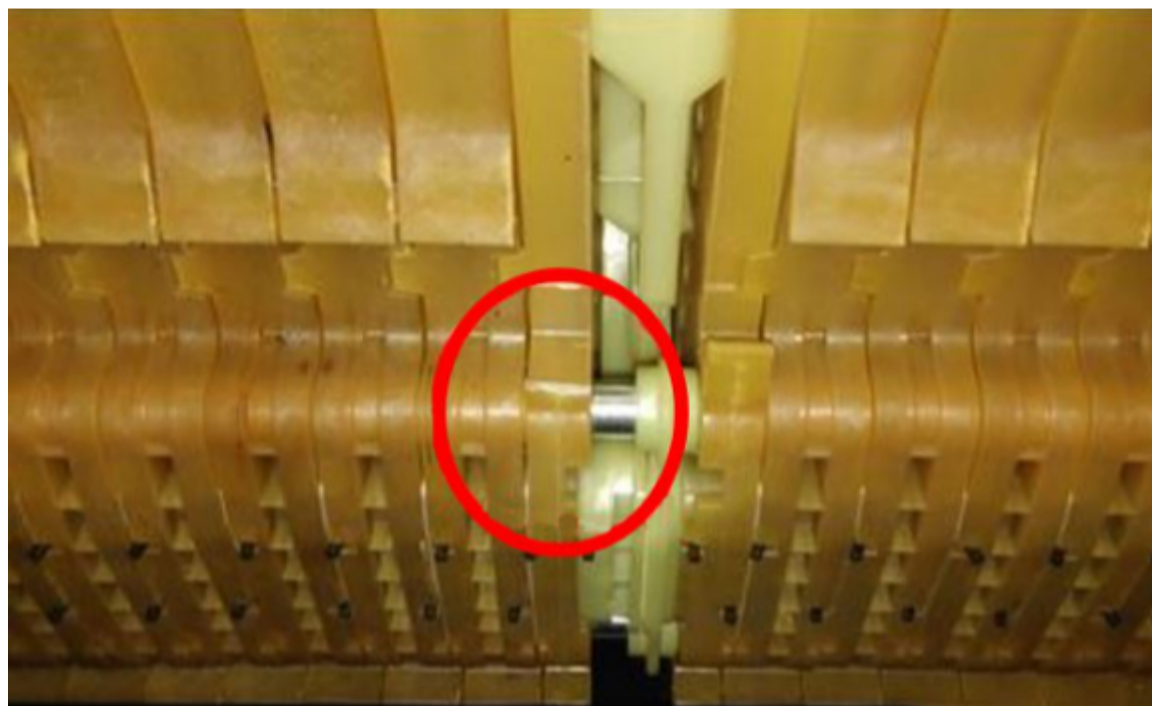


Missing Tab: Shown in the red circle

The missing tabs do not impact performance or reliability of the part, the wiring harness routing should be performed using the steps below.

1. Verify if any tabs are missing
2. If partial tab material is still present and could chafe the harness, then using pliers or similar tool remove any excess material from the tab area.
3. Using locally sourced adhesive backed Velcro, cut approx. 1 inch strip to be used to attach the harness to the section.

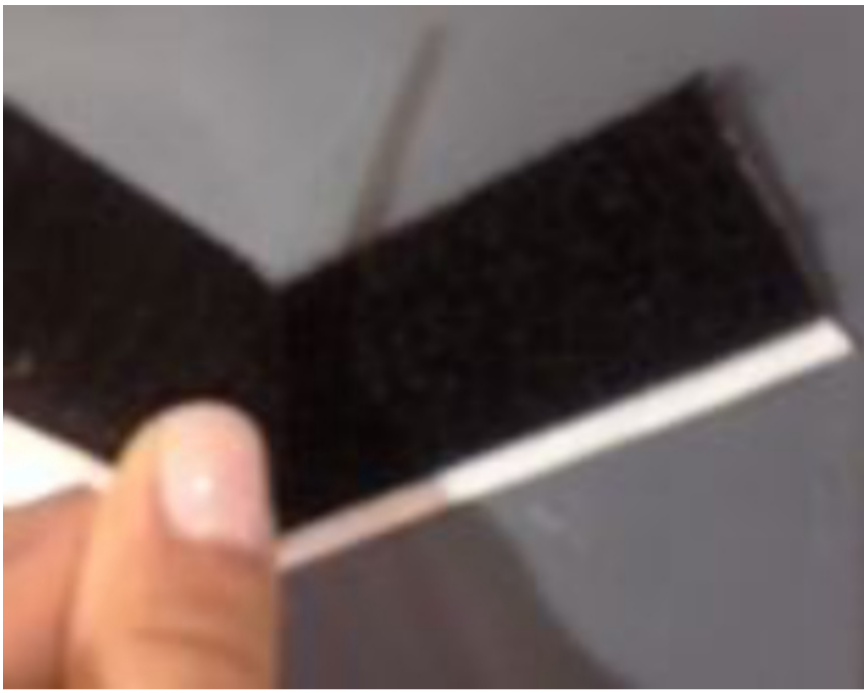

4. Attach one side of the Velcro in the area shown below:

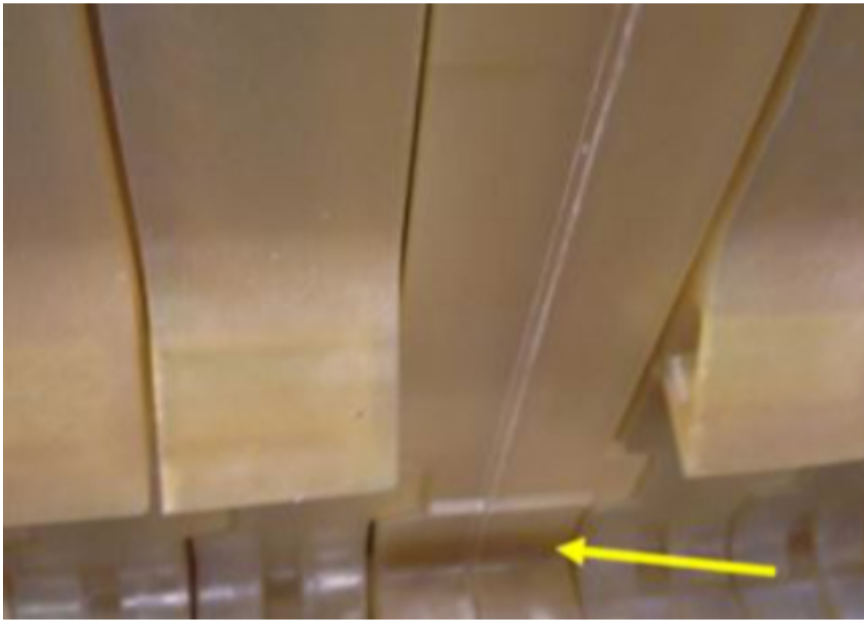

- 5. Attach the other side of the Velcro tape to the wiring harness in the corresponding location.
- 6. Press the two sides of the Velcro together, attaching the harness in the correct location on the section.

Parts Information

Description	Part Number	Quantity
<b>Velcro</b>	Sourced Locally	1

Version History

Version	2
Modified	02/21/2023 - Created on. 04/05/2023 - Update to Include more Models



GENERAL MOTORS