

GLOBAL SAFETY FIELD INVESTIGATIONS
DCS6605
URGENT - DISTRIBUTE IMMEDIATELY

Date: June 19, 2023

Subject: REVISION: N222371151-09 - Customer Satisfaction Program
Heated Steering Wheel Retrofit – Steering Wheel Replacement Only
Population Update

Models: 2022 Buick Enclave
2022 Cadillac CT4
2022 Cadillac CT5
2022 Cadillac XT5
2022 Cadillac XT6
2022 Chevrolet Blazer
2022 Chevrolet Silverado 1500 LTD
2022 Chevrolet Silverado 2500HD/3500HD
2022 Chevrolet Suburban
2022 Chevrolet Tahoe
2022 Chevrolet Traverse
2022 GMC Acadia
2022 GMC Sierra 1500 Limited
2022 GMC Sierra 2500HD/3500HD
2022 GMC Yukon
2022 GMC Yukon XL

To: All General Motors Dealers

This bulletin has been revised to add certain 2022 model year Chevrolet Traverse and Buick Enclave vehicles to the population. In addition, the remaining final 2022 model year GMC Acadia vehicles have been moved to an Open status in IVH. Additional part numbers have been added, and the warranty information section has been updated to include labor time for these newly added models. Please discard all previous copies of N222371151.

Part availability is still limited at this time. However, a portion of the impacted VINs have been moved to an Open status. The Open VINs are prioritized by cold weather region. It is imperative that IVH is verified prior to performing repairs. We estimate the remaining VINs to be eligible throughout 2023.

As parts become available for additional makes and models involved in this retrofit, we will communicate the revised bulletin in an upcoming message.

PART ORDERING INFORMATION

Due to limited initial parts availability, dealers should not order parts included in this field action for use as shelf stock. Parts should only be ordered when

the dealer has confirmed and validated the customer has a scheduled appointment with the service department.

Dealers will need to place orders CSO (Customer Service Order) and upgrade to a SPAC, all CSO without a SPAC will be cancelled daily. All orders will require a unique VIN for each order. If a VIN is not provided with the order, or has already been used, those orders will be cancelled. This change in process is due to limited parts availability and to assure we have ample stock for customers requiring the retrofit.

The remaining retrofit Customer Satisfaction Programs, beyond the Heated Steering Wheel Retrofit, will occur in phases over the next several months once parts become available. You will receive notification when they begin.

Customer Letter Mailing

The customer letter mailing will begin mid July 2023.

Global Warranty Management (GWM)

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated June 19, 2023. A list of vehicles in dealer inventory for this added population is attached to this message.

END OF MESSAGE

GLOBAL SAFETY FIELD INVESTIGATIONS

Customer Satisfaction Program

N222371151 – Heated Steering Wheel Retrofit – Steering Wheel Replacement Only



Release Date: June 2023

Revision: 09

Revision Description: This bulletin has been revised to add certain 2022 model year Chevrolet Traverse and Buick Enclave vehicles to the population. In addition, the remaining final 2022 model year GMC Acadia vehicles have been moved to an Open status in IVH. Additional part numbers have been added, and the warranty information section has been updated to include labor time for these newly added models. Please discard all previous copies of N222371151.

Attention: This program is in effect until July 31, 2026.

Make	Model	Model Year		RPO	Description
		From	To		
Buick	Enclave	2022	2022		
Cadillac	CT4	2022	2022		
Cadillac	CT5	2022	2022		
Cadillac	XT5	2022	2022		
Cadillac	XT6	2022	2022		
Chevrolet	Blazer	2022	2022		
Chevrolet	Silverado 1500 LTD	2022	2022		
Chevrolet	Silverado 2500HD/3500HD	2022	2022		
Chevrolet	Suburban	2022	2022		
Chevrolet	Tahoe	2022	2022		
Chevrolet	Traverse	2022	2022		
GMC	Acadia	2022	2022		
GMC	Sierra 1500 Limited	2022	2022		
GMC	Sierra 2500HD/3500HD	2022	2022		
GMC	Yukon	2022	2022		
GMC	Yukon XL	2022	2022		

Involved vehicles are marked "Open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Due to the industry-wide semiconductor shortage, the heat feature on the steering wheel is not functional on certain 2022 model year vehicles listed above, built beginning November 17, 2021. The affected vehicle owners should have been made aware of the condition at sale, and notified that once parts are available, they would be eligible for a no additional cost retrofit to enable the feature.
Correction	Dealers are to replace the steering wheel assembly.

Parts – MUST BE ORDERED BY SPAC, PLEASE SEE NOTES BELOW

Quantity	Part Name	Part Number Displayed in EPC	Part Number To Be Ordered
1	Steering Wheel	85128539	85128539*
1	Steering Wheel	85143361	85143361
1	Steering Wheel	84997097	85533770
1	Steering Wheel	84997109	85533782**
1	Steering Wheel	84945917	87821703
1	Steering Wheel	84945918	87821704
1	Steering Wheel	85551801	87821705
1	Steering Wheel	85533772	85533772
1	Steering Wheel	85533780	85533780
1	Steering Wheel	84994089	84994089
1	Steering Wheel	84994090	84994090
1	Steering Wheel	84994093	84994093
1	Steering Wheel	87821697	87821697
1	Steering Wheel	85551795	87821699
1	Steering Wheel	84945914	87821700
1	Steering Wheel	84678264	84859081
1	Steering Wheel	84859083	84859083

Customer Satisfaction Program

N222371151 – Heated Steering Wheel Retrofit – Steering Wheel Replacement Only



1	Steering Wheel	84859084	84859084
1	Steering Wheel	84859093	84859093
1	Steering Wheel	84859097	85108334
1	Steering Wheel	84859104	85108339
1	Steering Wheel	84922936	85590951
1	Steering Wheel	84922937	84922937
1	Steering Wheel	84946327	84946327
1	Steering Wheel	84946329	84946329
1	Steering Wheel	84946331	84946331
1	Steering Wheel	85544815	84946333
1	Steering Wheel	84946335	84946335
1	Steering Wheel	84946337	84946337
1	Steering Wheel	84946339	84946339
1	Steering Wheel	84946341	84946341
1	Steering Wheel	84946343	84946343
1	Steering Wheel	84946344	84946344
1	Steering Wheel	84946346	84946346
1	Steering Wheel	85004120	85004120
1	Steering Wheel	86792567 or 86825617	85580671

* This part number is for the Cadillac XT6, only one VIN is involved: 1GYKPCRS0NZ119836.

** If the steering wheel part number does not populate by VIN in the EPC:

- 1) Remove the VIN filtering
- 2) Look for body styles DE69 or DF69
- 3) Part number 84997109 should populate in the list
- 4) Part number 85533782 is the correct part number to order

The EPC will be updated in the near future.

Note: Use the VIN and the GM Electronic Parts Catalog (EPC) to determine which Steering Wheel to order.

Do NOT place orders until the customer contacts the dealership to schedule an appointment.

Parts required to complete this recall are to be obtained from General Motors Customer Care and Aftersales (GMCCA). Please refer to your “involved vehicles listing” before ordering parts. Parts for this Retrofit will be on Order Writing control initially and all DRO’s (Daily Replenishment Orders) may cancel. Dealers should place orders CSO (Customer Special Order) and upgrade to SPAC with a VIN. **All orders will be reviewed prior to being filled. All CSO may be cancelled daily. Only SPAC orders with a valid VIN associated with the vehicle listing will be released while on the order writing control. Due to order writing control orders will not ship as OVN. Please take this into consideration in shipping if not coming from your Admin PDC.**

Reminder: Parts will be removed from SPRINT, they are non-returnable and may be removed from Retail Inventory Management (RIM). Dealers should review the affected parts to confirm RIM managed status. **Parts may have quantity limiters in effect.**

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9106623	Replace Steering Wheel		ZFAT	N/A
	XT5	0.4		
	XT6	0.5		
	CT4	0.6		
	CT5	0.5		
	Blazer	0.4		
	Suburban	0.4		
	Tahoe	0.4		
	Acadia	0.4		
	Yukon	0.4		
	Yukon XL	0.4		
	Sierra 1500 Limited	0.5		

Customer Satisfaction Program

N222371151 – Heated Steering Wheel Retrofit – Steering Wheel Replacement Only



	Sierra 2500HD/3500HD	0.4		
	Silverado 1500 LTD	0.5		
	Silverado 2500HD/3500HD	0.4		
	Traverse	0.4		
	Enclave	0.4		
9106771	Cost of the T50 impact Torx bit (only 1 claim per dealer allowed)	N/A	ZFAT	*

Important: The tool reimbursement labor code, 9106771, must be submitted prior to the submittal of the replacement labor code 9106623 or the claim will reject. This tool is required for both N222371150 and N222371151. Only one claim per dealer is allowed for both bulletins. The tool can be reused to perform either bulletin.


* Dealers will be allowed to purchase one ½ inch drive T50 impact Torx bit locally. Submit the actual cost of the T50 impact Torx bit, not to exceed \$20.00 USD (\$27.06 CAD).

Service Procedure

Tools, Equipment and Materials

- ½ inch drive T50 impact Torx bit*

*Dealers will be allowed to purchase one ½ inch drive T50 impact Torx bit locally.

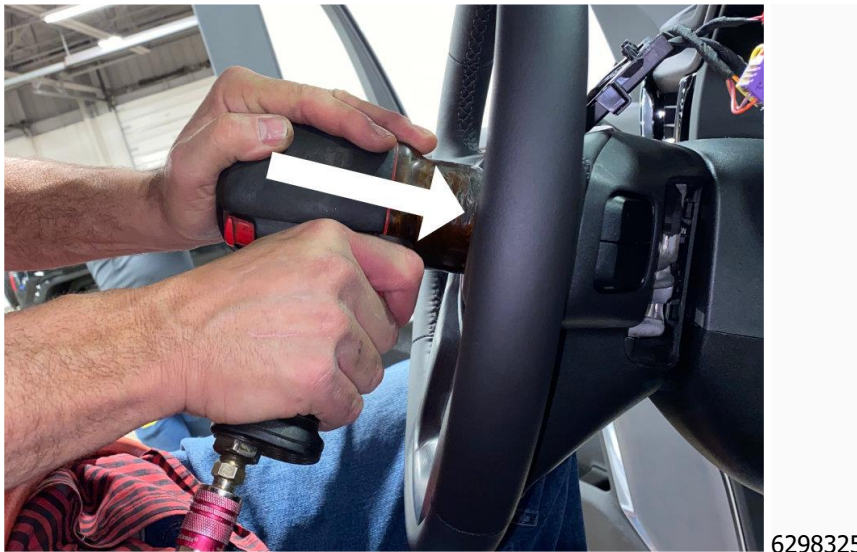

Caution: During steering wheel bolt removal, observe the following precautions:

- Do NOT use heat on the steering wheel bolt, steering wheel, or steering column. Using heat could cause damage to the steering related components.
- Do NOT hammer or apply excessive downward force on the steering wheel bolt, steering wheel, or steering column. Hammering or applying excessive downward force could cause damage to the steering related components.
- Damaged columns due to hammering or excessive downward force can cause a rubbing of the trim pieces potentially leading to a customer comeback.

Note:

- Steering wheel bolts installed during manufacturing require high torque efforts to remove.
- The ONLY acceptable bit for removing and installing the steering wheel bolt is a T50 Torx bit. Do NOT use any other size bit or a worn bit.
- If a power tool is used to remove the steering wheel bolt, the tool must have a minimum torque rating greater than **75 NM (55 lb ft)** and both the power tool and the T50 Torx bit MUST be positioned perpendicular to the bolt recess.
- Apply appropriate downward force to maintain engagement of bit to bolt recess during bolt removal.

1. Remove and replace the Steering Wheel. Refer to *Steering Wheel Replacement* in SI.

Dealer Responsibility

Customer Satisfaction Program

N222371151 – Heated Steering Wheel Retrofit – Steering Wheel Replacement Only



All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this program must be held and inspected/repaired per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Dealers are to service all vehicles subject to this program at no charge to customers, regardless of mileage, age of vehicle, or ownership, through July 31, 2026. Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the involved vehicle listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. A copy of the customer letter is provided in this bulletin for your use in contacting customers. Program follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this program enters your vehicle inventory or is in your facility for service through July 31, 2026, you must take the steps necessary to be sure the program correction has been made before selling or releasing the vehicle.

Dealer Reports – For USA & Export

For dealers with involved vehicles, a listing has been prepared and will be available through GM GlobalConnect Maxis Field Action Reports or sent directly to export dealers. The Inventory tab of the dealer reports will contain VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will contain customer names and addresses from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than follow-up necessary to complete this field action may be a violation of law in several states.

Courtesy Transportation – For USA & Canada

Courtesy transportation is available for customers whose vehicles are involved in a product program and still within the warranty coverage period. See General Motors Service Policies and Procedures Manual for courtesy transportation program details.

Customer Notification

USA & Canada – General Motors will notify customers of this program on their vehicle (see copy of customer letter included with this bulletin).

Export – Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached sample letter.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary Technician
Certification**

Customer Satisfaction Program

N222371151 – Heated Steering Wheel Retrofit – Steering Wheel Replacement Only



This notice applies to your vehicle, **VIN:** _____

Dear General Motors Customer:

Our records indicate that, at the time you purchased or leased your GM vehicle, the vehicle was not equipped with the heat feature on the steering wheel assembly due to an industry-wide parts shortage.

We are pleased to inform you that you are now able to schedule an appointment with your GM dealer so they can replace your steering wheel assembly.

What We Will Do: Your GM dealer will replace the steering wheel assembly. This service will be performed for you at **no charge until July 31, 2026**. After that, any applicable warranty will apply.

What You Should Do: We recommend that you contact your GM dealer as soon as possible to schedule an appointment for this retrofit. By scheduling an appointment, your dealer can order the necessary parts to be available on your scheduled appointment date.

If you have any questions or concerns that your dealer is unable to resolve, please contact the appropriate Customer Assistance Center at the number listed below.

For the hearing or speech impaired, please contact our Customer Assistance Center using the Telecommunication Relay Service by dialing 711 then providing the appropriate Customer Assistance Center number for your vehicle.

Division	Number	Text Telephones (TTY)
Buick	1-800-521-7300	711 / 1-800-833-2438
Cadillac	1-800-333-4223	711 / 1-800-833-2438
Chevrolet	1-800-222-1020	711 / 1-800-833-2438
GMC	1-800-462-8782	711 / 1-800-833-2438
Puerto Rico – English	1-866-467-9700	
Puerto Rico – Español	1-866-467-9700	
Virgin Islands	1-866-467-9700	

We truly appreciate you taking the time to retrofit your vehicle as we know your time is valuable. We want you to know that we will do our best, throughout your ownership experience, to ensure that your GM vehicle provides you with many miles of enjoyable driving.

Neelie O'Connor
Global Executive Director
Customer Experience Operations

N222371151