

**Subject:** Engineering Information - (EI Lite) - (Pictures Only) Water Leaking from Sunroof Area

**Attention:** Proceed with this EI Lite ONLY if the customer has commented about this concern AND the PIE number is listed in the Global Warranty Management / Investigate History link (GWM/IVH). If the customer has not commented about this condition or the EI does not show in GWM/IVH, disregard the PIE and proceed with diagnostics found in published service information. THIS IS NOT A RECALL refer to Service Bulletin 04-00-89-053 for more details on the use of Engineering Information bulletins. Proceed with this EI Lite ONLY if the customer has commented about this concern AND the PIE number is listed in the Global Warranty Management / Investigate History link (GWM/IVH). If the customer has not commented about this condition or the EI does not show in GWM/IVH, disregard this PIE and proceed with diagnostics found in published service information. This EI Lite is asking ONLY to submit the description of the issue and pictures/video using the Field Product Reporting (FPR) App (reference bulletin 02-00-89-002). THIS IS NOT A RECALL — refer to the latest version of Service Bulletin 04-00-89-053 for more details on the use of Engineering Information bulletins.

Brand:	Model:	Model Year:		VIN Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2023	2023	—	—	—	—
Chevrolet	Traverse						


<b>Involved Region or Country</b>	<b>U.S. Dealers ONLY</b>
<b>Additional Options (RPOs)</b>	Equipped with ROOF-SUN, GLASS, SLIDING, ELEC, TRANSPARENT GLASS FIXED (RPO C3U)
<b>Condition</b>	<p><b>Important:</b> If the customer did not bring their vehicle in for this concern, <b>DO NOT</b> proceed with this EI Lite. Some customers may comment on water leaking from the sunroof area.</p> <p><b>Note: Note:</b> Instructions to load the FPR App to your phone and other detailed instructions can be found in the latest version of Bulletin 02-00-89-002 (U.S. Dealers) .</p>
<b>Cause</b>	GM Engineering is attempting to determine the root cause of the above condition. Engineering has a need to gather information on vehicles PRIOR to repair that may exhibit this condition. As a result, this information will be used to "root cause" the customer's concern and develop/validate a field fix.

## Correction

**Important:** Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Engineering is requesting for pictures PRIOR to repairs that are causing leaks from the sunroof and only when repaired without any part replacements. These repairs may include fixing a pinched or kinked sunroof drain hose, re-seating a poorly connected sunroof drain hose connection, or improperly installed/routed drain hoses for the sunroof on any 2023 Enclave/Traverse. Please use the Field Product Reporting (FPR) App, take pictures of the issue (per details below), fill out required fields (including adding PIE number **PIE0756** in the Condition Field) and submit.

**Note:** Note: **GM has updated the Field Product Reporting App, and it is now part of the “Certified Service Mobile Toolbox” (CSMT) Instructions to load the App to your phone and other detailed instructions can be found in the latest version of Bulletin 02-00-89-002 (U.S. Dealers).**

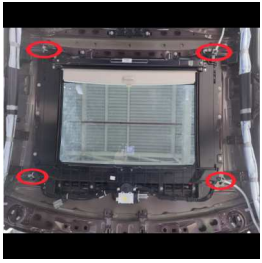

1. Take a picture of the entire area of the vehicle showing the location of the issue/part on the vehicle.
2. Take clear close-up pictures of the issue area.

**Note:** Use colored tape or other type of stick-on marker can be used to indicate area of concern.

## Warranty Information

If a Field Product Report is submitted, use: (EI LITE)

Labor Operation	Description	Labor Time
6086058*	Engineering Information - (EI Lite) - (Pictures Only) Water Leaking from Sunroof Area	0.3 Hrs.

\*This is a unique Labor Operation for bulletin use only.

<b>Version</b>	1
<b>Modified</b>	Released July 27, 2023