

**Panamera Climate Control Settings are not Retained with Memory Settings**

**Vehicles Affected**

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Panamera	As of 2017 up to 2023	971	N/A	N/A

**Revision History**

Revision	Release Date	Changes
0	October 20, 2023	Original document

**Condition**

Customer complains the climate control / air-conditioning system settings are not retained through the driver memory or comfort memory system in the car.

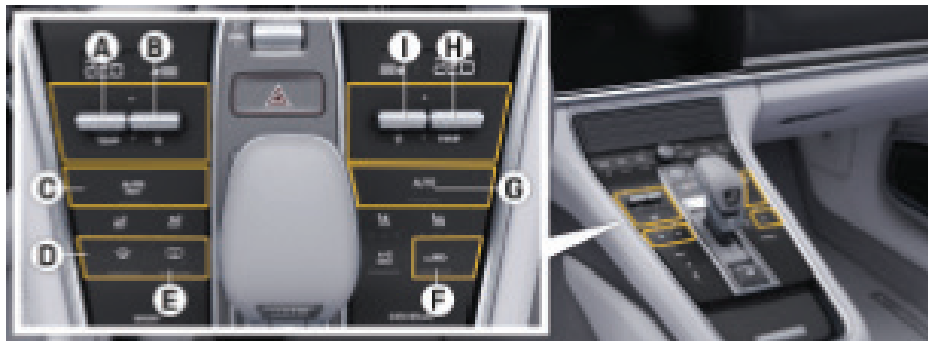


Figure 1

**Technical Background**

Air conditioning and climate control settings are no longer part of driver and comfort memory settings as of A/C control unit software version 1751 and higher. As of SW 1751, the system only provides retention of Last Mode settings.

### Service Information

This is an intentional change in operating concept, and customers may observe this change following a software update or control unit replacement. It is not permitted to recode or retrofit this function.

### Warranty

No warrantable repair work is described herein.

### Search Items

Panamera, G2, 971, a/c, climate control, air conditioning, memory, comfort memory, driver memory

---

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

---