



GROUP ELE	MODEL 2017MY Sorento (UMa) Optima (JFa)
NUMBER 131 (Rev 1, 7/21/2017)	DATE April 2017


TECHNICAL SERVICE BULLETIN

SUBJECT: SERVICE ACTION: VOLTAGE REGULATOR PERFORMANCE ENHANCEMENT (SA278)

* NOTICE

This bulletin has been revised to include additional information. New/ revised sections of this bulletin are indicated by a black box in the main area.

This bulletin provides the procedure to increase the torque on the voltage regulator screws on some 2017MY Sorento (UMa), produced from December 3, 2016 to January 24, 2017, and 2017MY Optima (JFa) vehicles, produced from November 3, 2016 to January 26, 2017, which may experience low battery voltage for a no-start condition. Follow the procedure outlined in this bulletin to increase the (N2) screws torque on the voltage regulator. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

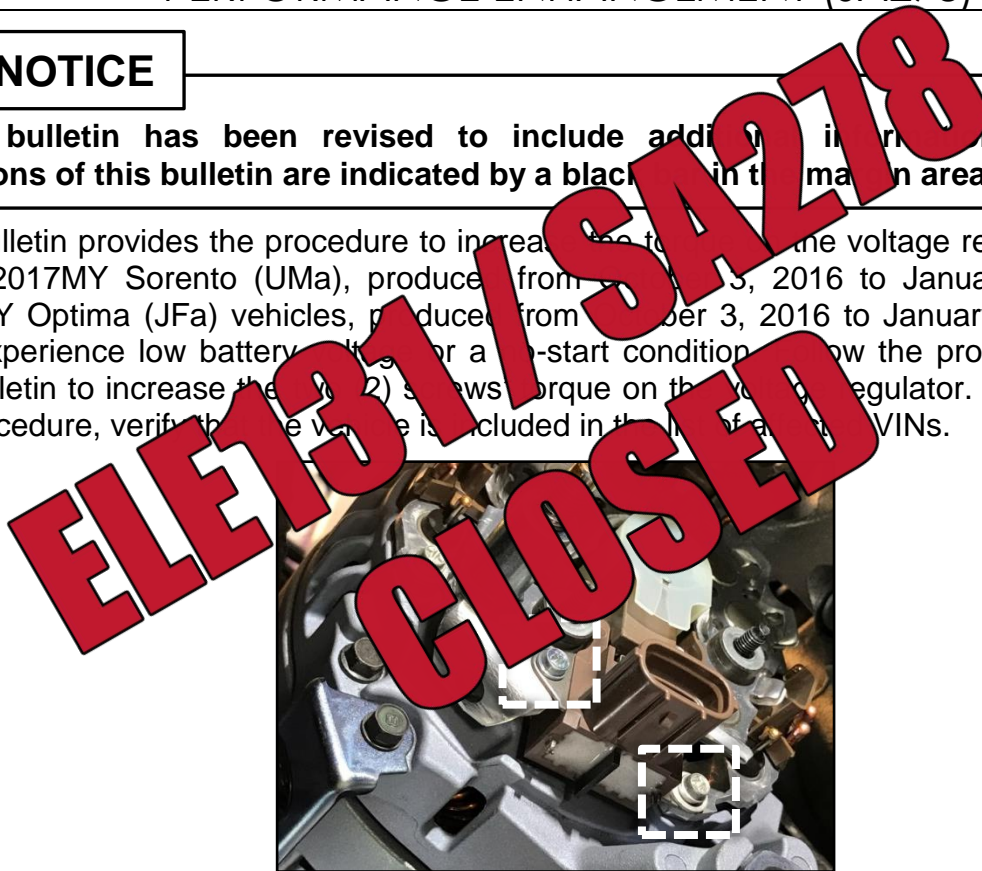

Voltage Regulator Screws

* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is **SA278**.

File Under: <Electrical>

- Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair