

**992 – Instrument Cluster Navigation Arrow Off-Center**

**Vehicles Affected**

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
911	As of 2020	992	N/A	N/A

**Revision History**

Revision	Release Date	Changes
0	August 2, 2024	Original document

**Condition**

Customer complains of the navigation arrow in the instrument cluster not being centered.

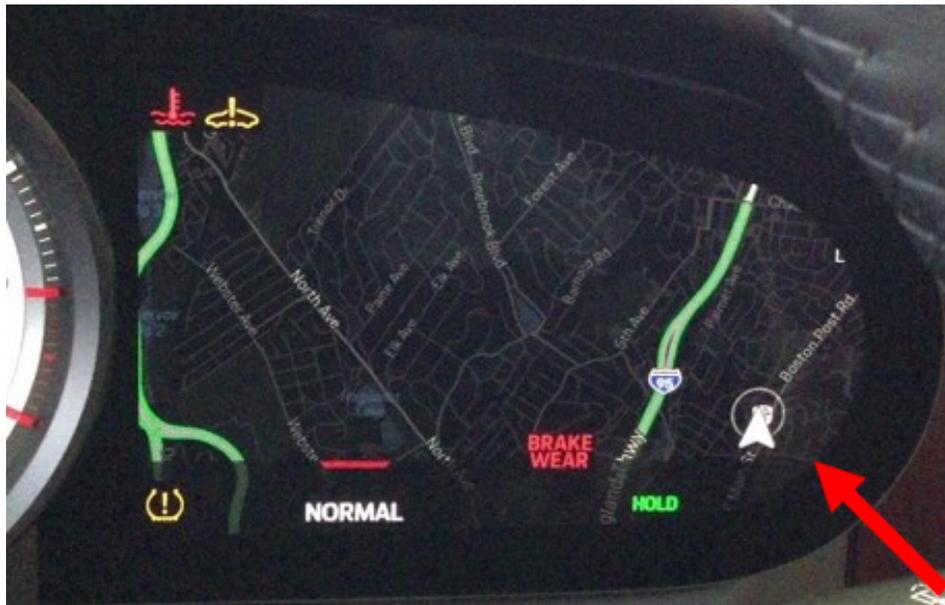


Figure 1 - Navigation Arrow Off-Center

### Technical Background

Due to the lower resolution of the instrument cluster display for the 992, the navigation display becomes unproportional. This leads to the image becoming oversized and the navigation arrow off centered.

### Service Information

Create a PCSS job for the concern. Follow the listed conditions below for the PCSS job:

- Cause location: 90250 Instrument cluster
- Cause symptom: 4041 Incorrect display

This topic is currently under investigation. No parts are to be replaced at this time.

This ATI will be updated when a software solution is released.

### Warranty

No warranty Labor Operations are currently available.

### Search Items

992, 911, Instrument cluster, navigation, arrow, center

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.