

December 18, 2024

Version 2

Warranty Extension: 2022–24 MDX Popping/Crackling from the Speakers; Display Blank

Supersedes 24-047, dated July 30, 2024, to the revise the information highlighted in **yellow**.

AFFECTED VEHICLES

Year	Model	Trim Level	VIN Range
2022–24	MDX	ALL	ALL

REVISION SUMMARY

Under PARTS INFORMATION and FAKRA Splice Repair Service Cable Assembly, information was added.

BACKGROUND

A coaxial cable terminal was not manufactured to proper specifications. An improperly manufactured terminal may lead to poor communication in the media-oriented system transport (MOST) bus network which can potentially affect the audio sound quality.

Acura is extending the warranty coverage on the FAKRA service cables to **8 years or 100,000 miles** from the original date of purchase, whichever comes first.

CLIENT NOTIFICATION

Owners of affected vehicles must be sent a notification of this campaign; do an iN VIN status inquiry to verify eligibility.

CORRECTIVE ACTION

Install the FAKRA splice repair service cables and splice boxes.

PARTS INFORMATION

IMPORTANT: The splice boxes (P/N 39817-THR-305) used in this Safety Recall have lock tabs that may be susceptible to breakage during installation if too cold.

- DO NOT** store splice boxes in cold temperatures, around **14°F (-10°C)** or colder.

Part Name	Part Number	Quantity
Splice boxes	39817-THR-305	10 Splice boxes (20 Halves)
FAKRA splice repair service cable (Green)	39165-THR-AB0	5
FAKRA splice repair service cable (Red)	39165-THR-AA0	4
FAKRA splice repair service cable (Blue)	39165-THR-AC0	1

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

TOOL INFORMATION

Part Name	Part Number	Quantity
Straight FAKRA Puller	07AAC-THRA200	1

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0101T4	Access the gauge control module, infotainment control unit, stereo amplifier, in-line connector, and tuner unit, then replace the affected FAKRA splice repair service cables, and splice boxes.	2.0 hr	6M300	CJ200	B24047A	39540-TYA-AA2

Skill Level: Repair Technician

FAKRA CONNECTOR HOUSING DISASSEMBLY/FAKRA SPLICE REPAIR SERVICE CABLE ASSEMBLY PROCEDURE


1. Follow the steps below to better understand the cable and splice box installation instructions.
2. The connectors will either be the original FAKRA housing or the WPC FAKRA service housing.

NOTE:


- There may be multiple components that require the affected FAKRA connectors to be removed.
- Use the straight FAKRA puller to remove the connector from a component.

Original FAKRA Housing Removal Procedure

1. Use a small screwdriver, remove the secondary lock, then release the tab as shown.

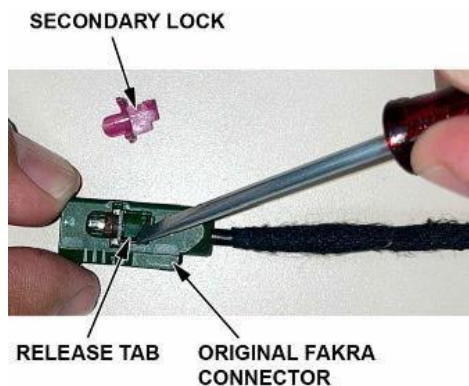


2. Pull to remove the housing from the vehicle harness. Then, discard the housing and lock.

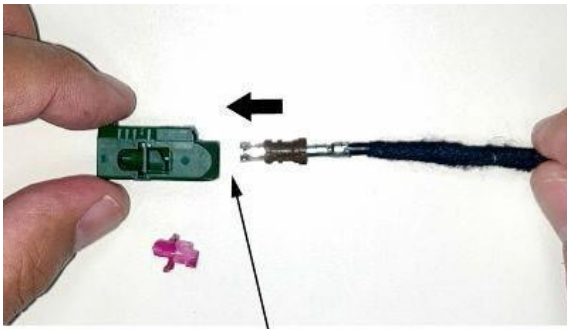


Pull apart.

WPC FAKRA Service Housing Removal Procedure

1. Release the two locking tabs on the WPC FAKRA service housing and remove the housing from the terminal.

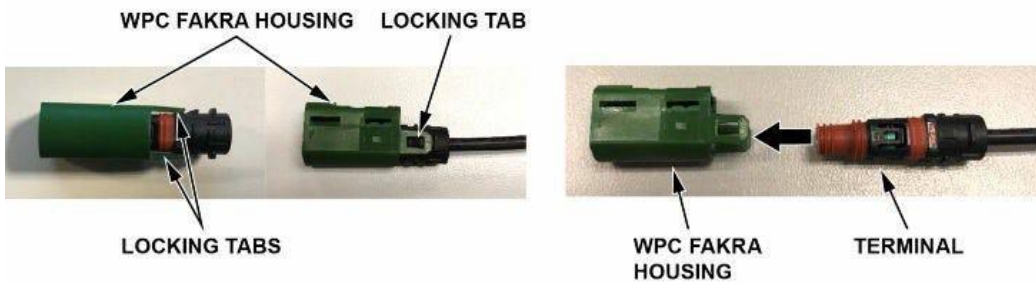

2. Release the lock tab and remove the terminal from the vehicle harness.

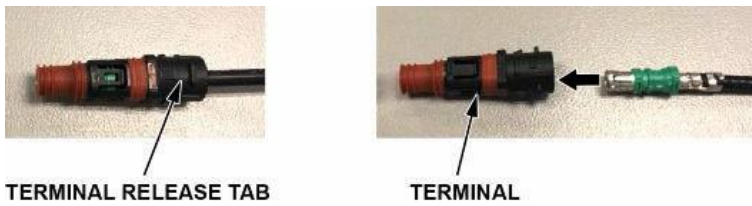

FAKRA Splice Repair Service Cable Assembly


IMPORTANT: The splice boxes (P/N 39817-THR-305) used in this Safety Recall have lock tabs that may be susceptible to breakage during installation if too cold.

- **DO NOT** store splice boxes in cold temperatures, around **14°F (-10°C)** or colder.
- **DO NOT** attempt to repair or use a damaged splice box. If any of the splice box lock tabs break during installation, replace with a new splice box.


1. Install the appropriate FAKRA splice repair service cables and splice boxes as shown in the steps that follow:

NOTE:


- **The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.**
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed incorrectly, the repair will fail; **MOST** ring failure conditions will still occur.

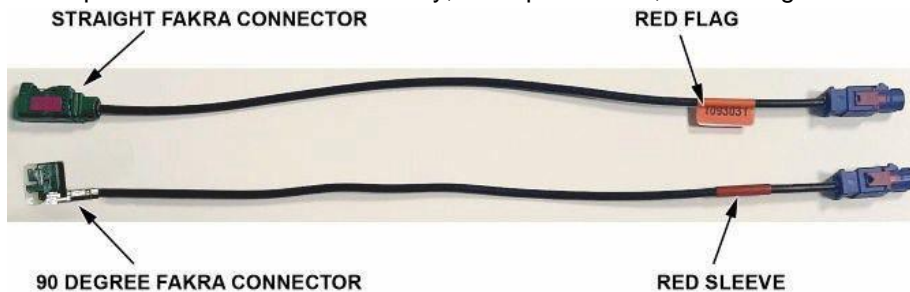

2. Use a small screwdriver to remove the secondary lock, then release the tab.

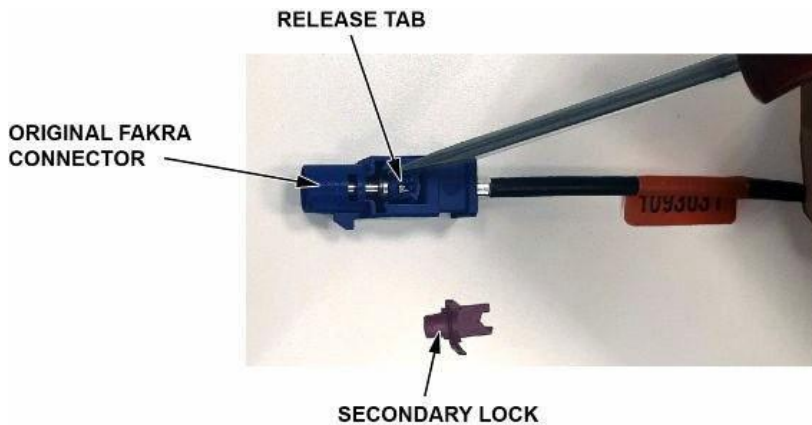

3. Pull to remove the housing from the cable and then discard the housing and secondary lock tab from the FAKRA splice repair service cable.

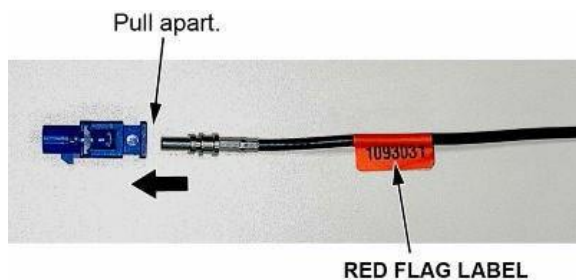


- Connect the appropriate color FAKRA splice repair service cable to the vehicle harness.

NOTE:

- Make sure the FAKRA service cable is inserted straight into the vehicle harness terminal to avoid damage at the cable connection point.
- Always disassemble the connectors one at a time to avoid swapping the green and red wires.



- Attach the splice box halves to the cable connection.

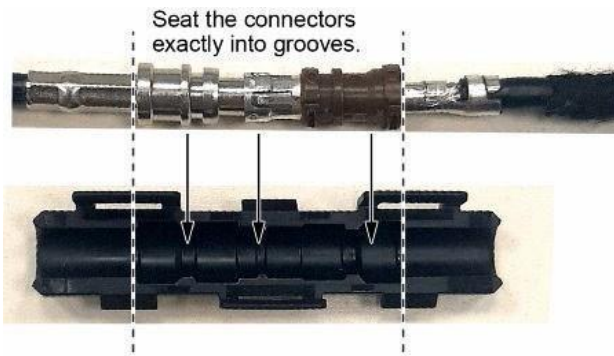

- When mating the two splice box halves, **make sure** that all **6 lock tabs** are fully engaged. You may hear a click when installing the two halves.

NOTE:

- The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed **incorrectly**, the repair **will fail**; MOST ring failure conditions will still occur.

CORRECT ✓



All 6 clips connected.

INCORRECT ✗



Exposed slice visible.

- Make sure the arrow on the splice box points towards the red flag label.

CORRECT ✓



RED FLAG LABEL Arrow facing toward tag. Fully seated in splice box.

INCORRECT ✗



RED FLAG LABEL

NOTE: Do not spin the splice box or the cables as this can damage the connection point.

- Once the FAKRA splice repair service cables and splice boxes have been attached to the cable connection, tape the splice boxes and FAKRA service cables to the appropriate component harness.

Keep smooth curves with a radius bend greater than 25 mm.



Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

CORRECT ✓



Keep smooth curves with a radius bend greater than 25 mm.



INCORRECT ✗



NOTE: Make sure the FAKRA splice repair service cables are not bent at the connector(s), as shown below.

CORRECT ✓




INCORRECT ✗




REPAIR PROCEDURE

1. Remove the following dash components to gain access to the gauge control module and the infotainment control unit:

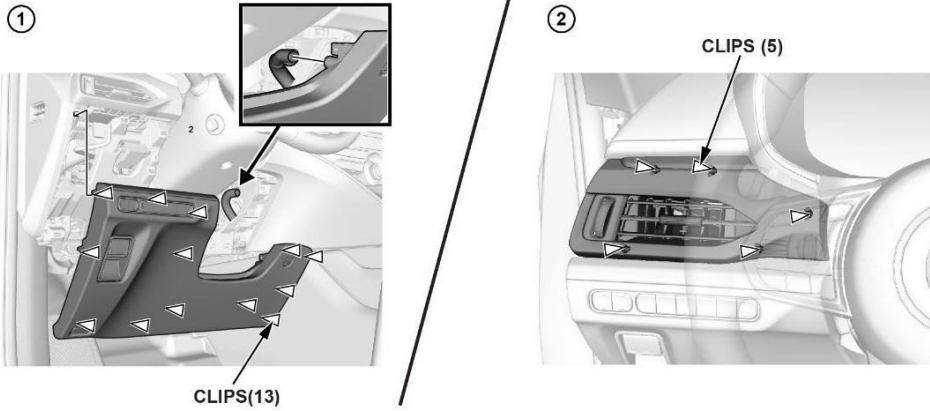


NOTE: Panel includes climate control unit (not shown in image).

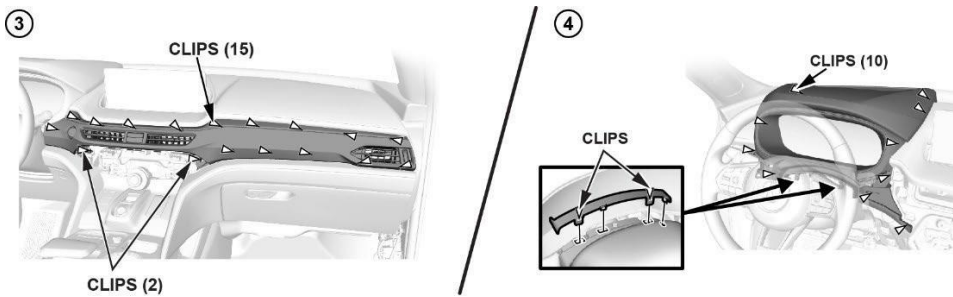


NOTE:

1. After installation, do the self-diagnostic function with the i-HDS or the climate control unit.
2. Remove the four screws from the gauge control module.

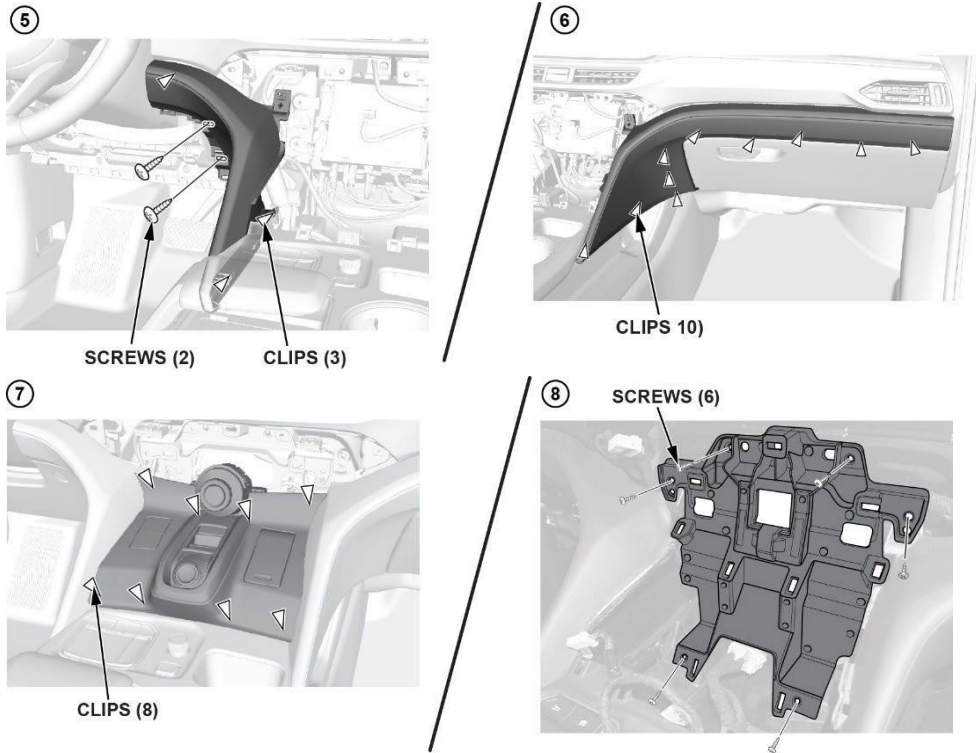


2. Remove the following components to gain access to the in-line connectors:


WITHOUT SPEAKER

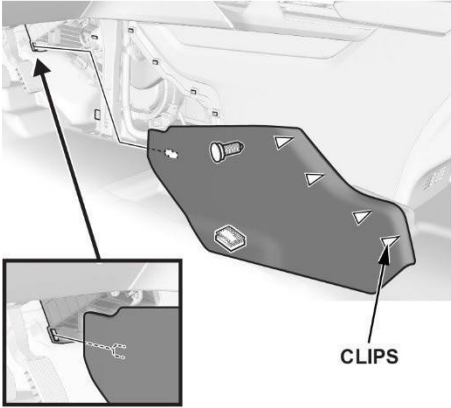


WITH SPEAKER

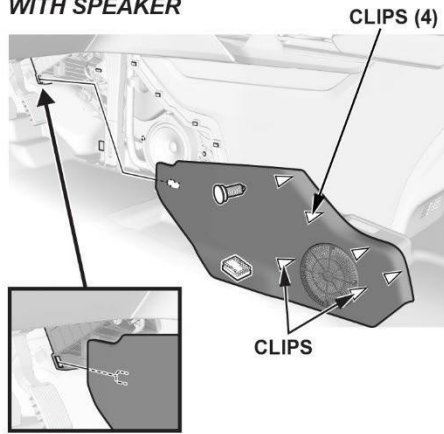


WITHOUT SPEAKER

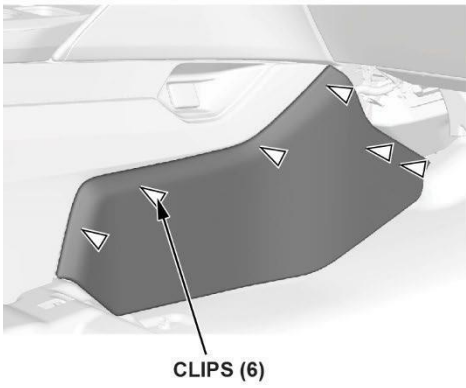


WITH SPEAKER

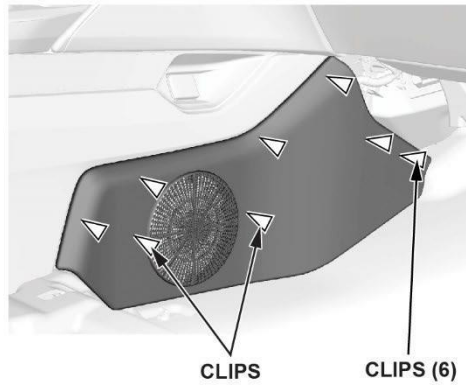


①

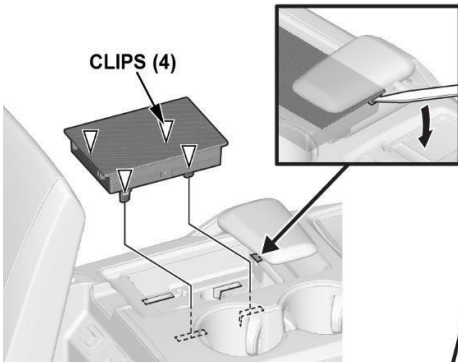

②

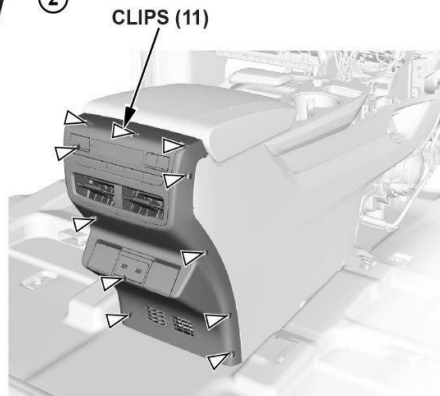


NOTE: After installation, do the self-diagnostic function with the i-HDS or the climate control unit.

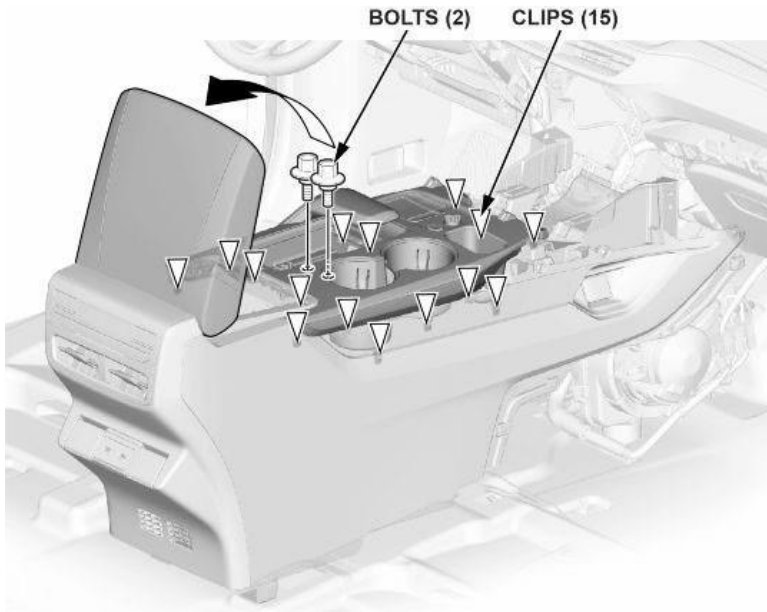


NOTE: Before removing the center console make sure the following is disconnected:


1. Passenger side 12-volt power supply
2. Console storage compartment 12-volt power supply, USB port, and the storage compartment light
3. Storage compartment harness fasteners that ran up the dash located on the driver's side of the console

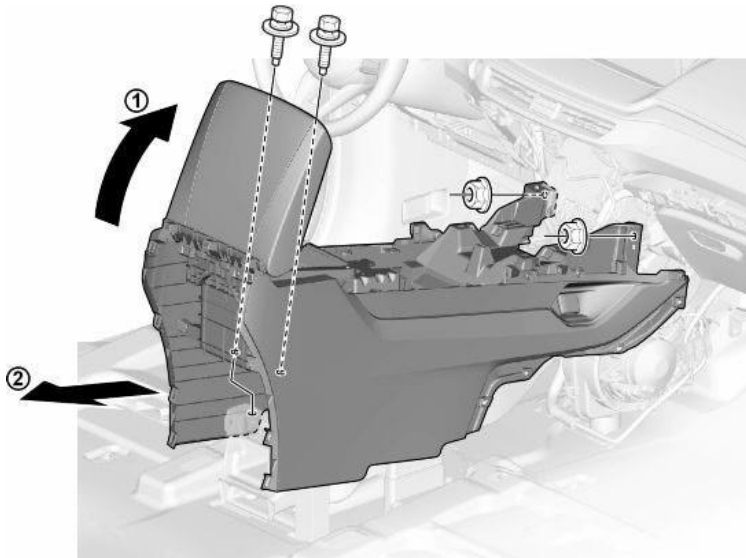

3. Remove the rear A/C ducts to gain access to the green and blue in-line connectors.

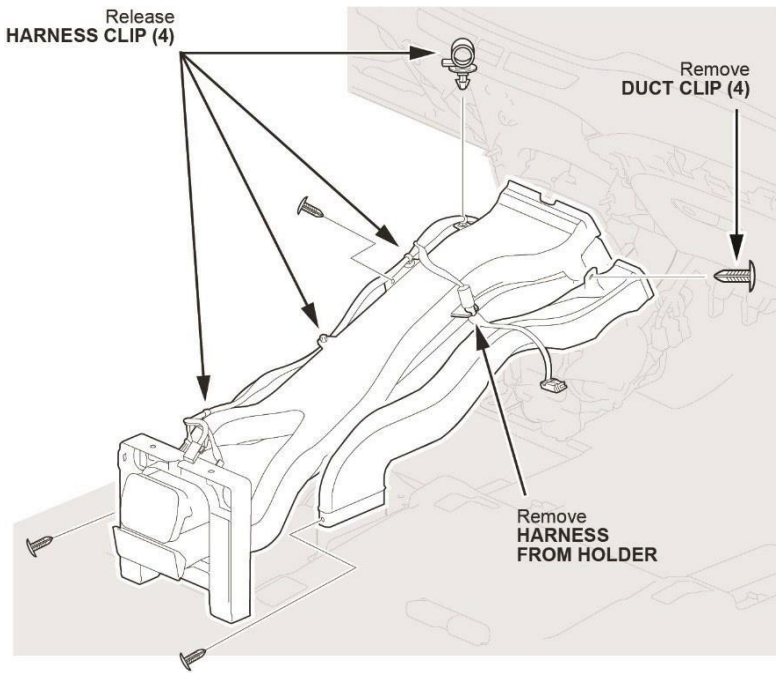


4. Remove the rear cargo area floor panels, and right-side liner to gain access to the tuner unit and amplifier.

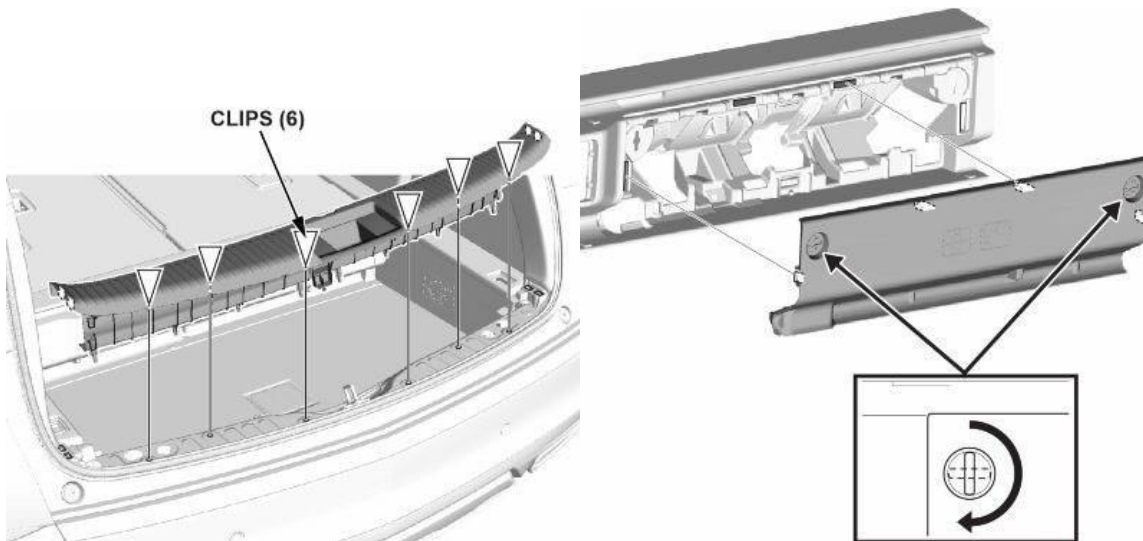


NOTE: Only remove the right-side cargo hooks.

①

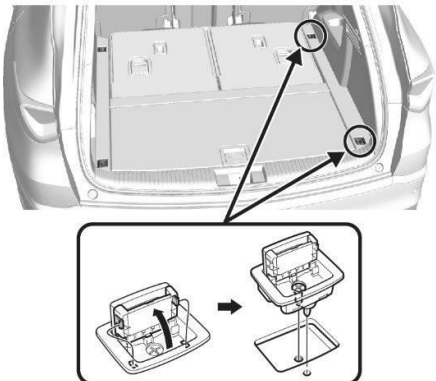


②

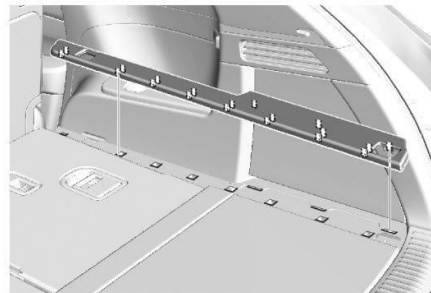


5. Remove the rear fuse box garnish and metal cross support.

①

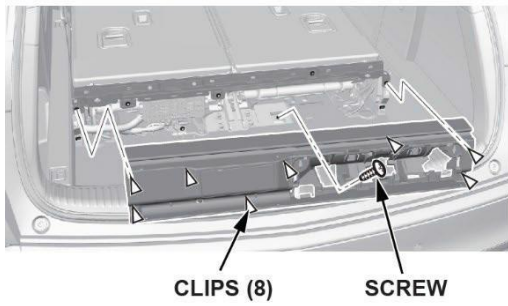


②

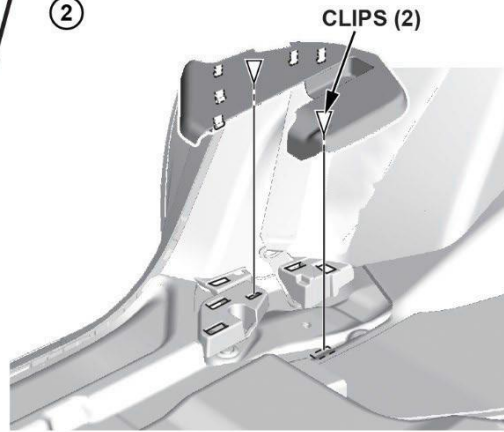


6. Do the following steps to remove seat cushion:

1. Remove the bolt.
2. While pushing down on the third-row seat cushion, pull the seat hook handles to release the hooks.
3. Pull the third-row cushion forward to remove.

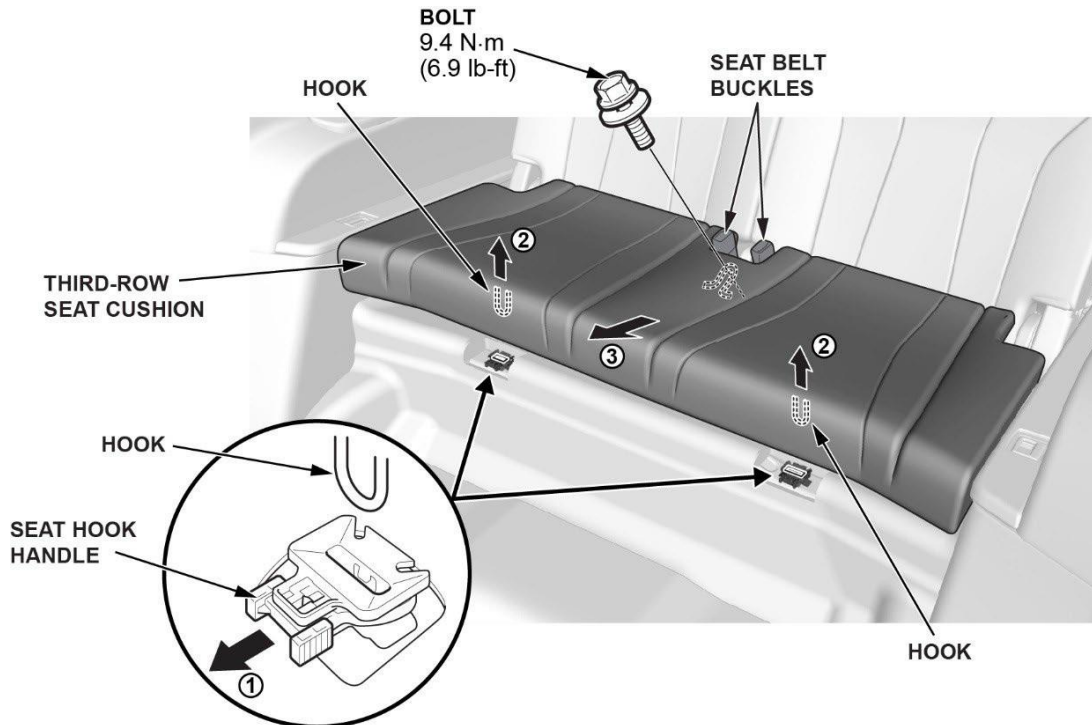

7. Pull back the third-row seat cushion to pull off the seat belt buckles from the slits in the third-row seat cushion, then pull it forward (#3 in above image).

8. Remove the right-side, third-row seat back.

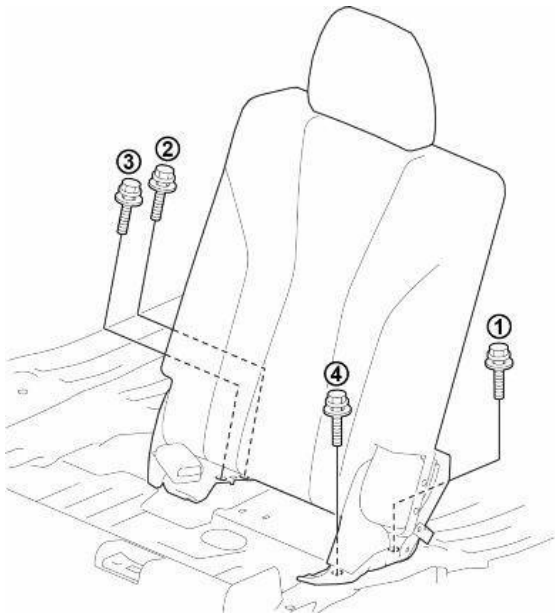


TIGHTENING PROCEDURE

Step	Operation	Object	Specification
1	Hand Tighten	All bolts	①→②→③→④
2	Tighten	All bolts	①→②→③→④

9. Remove the right side lower rear panel.



10. Remove the rear support bracket at the bottom left corner of the tailgate opening.

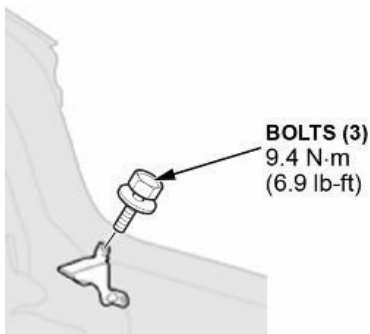

11. Follow the steps below to install the FAKRA splice repair service cables and splice boxes at each component location.

NOTE:

See the **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section above for the cable and splice box installation instructions.

GAUGE CONTROL MODULE REPAIR PROCEDURE

1. Locate and turn the gauge control module to access the rear connectors.



2. Disconnect the red and green FAKRA connectors and any other related connectors from the gauge control module.



FAKRA CONNECTORS

NOTE: Disassemble the connectors one at a time to avoid swapping the green and red wires.

3. Install the matching color FAKRA splice repair service cables and splice boxes.

NOTE:

- See the above section **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section for detailed instructions.
- **The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.**
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed **incorrectly**, the repair **will fail**; MOST Ring failure conditions will still occur.

4. Tape both FAKRA splice repair cables and splice boxes to the gauge control module harness.

Keep smooth curves with a radius bend greater than 25 mm.




Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

5. Reconnect the FAKRA connectors and any other related connectors to the gauge control module.

INFOTAINMENT CONTROL UNIT REPAIR PROCEDURE

1. Disconnect the red and green FAKRA connectors and any other related connectors at the infotainment control unit.

NOTE: Disassemble the connectors one at a time to avoid swapping the green and red wires.

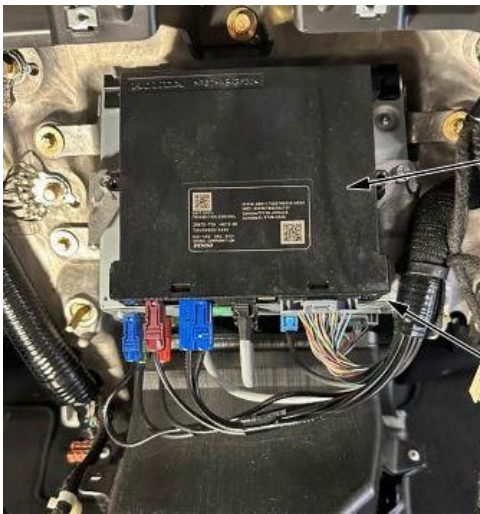

TELEMATICS
CONTROL UNIT

INFOTAINMENT
CONTROL UNIT


2. Install the matching color FAKRA splice repair service cables and splice boxes.

NOTE:

- See the above section **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section for detailed instructions.
- **The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.**
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed **incorrectly**, the repair **will fail**; MOST Ring failure conditions will still occur.

3. Tape both FAKRA splice repair cables and splice boxes to the infotainment control unit harness.

Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

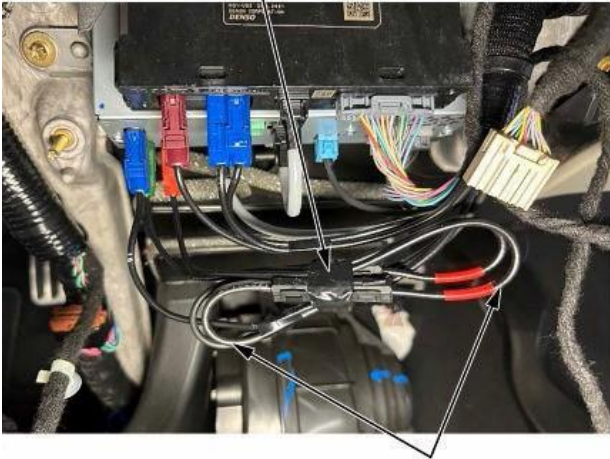

Keep smooth curves with a radius bend greater than 25 mm.

4. Reconnect the FAKRA connectors and any other related connectors to the infotainment control unit.

CENTER CONSOLE IN-LINE CONNECTORS REPAIR PROCEDURE

1. Disconnect the blue and green FAKRA connectors at the center console.



IN-LINE CONNECTORS

2. Install the matching blue and green FAKRA splice repair service cables and splice boxes.

NOTE:

- See the above section **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section for detailed instructions.
- The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed **incorrectly**, the repair **will fail**; MOST Ring failure conditions will still occur.

3. Tape the blue and green FAKRA splice cables and splice boxes to the in-line harness.



Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

Keep smooth curves with a radius bend greater than 25 mm.

4. Reconnect the blue and green in-line FAKRA connectors.

TUNER UNIT REPAIR PROCEDURE

1. Disconnect the red and green FAKRA connectors at the tuner unit.

NOTE: Disassemble the connectors one at a time to avoid swapping the green and red wires.



TUNER UNIT

2. Install the matching color FAKRA splice repair service cable and splice boxes.

NOTE:

- See the above section **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section for detailed instructions.
- The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.
- The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
- If any of the lock tabs break during installation, the splice box half(s) must be replaced.
- If the splice box is installed **incorrectly**, the repair **will fail**; MOST Ring failure conditions will still occur.

3. Tape both FAKRA splice repair cable and splice boxes to the in-line harness.

Keep smooth curves with a radius bend greater than 25 mm.



Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

4. Reconnect the FAKRA connectors and any other related connectors to the tuner unit.

STEREO AMPLIFIER REPAIR PROCEDURE

1. Disconnect the red and green FAKRA connectors at the stereo amplifier.

NOTE:

Disassemble the connectors one at a time to avoid swapping the green and red wires.



STEREO AMPLIFIER

2. Install the matching color FAKRA splice repair service cable and splice boxes.

NOTE:

- See the above section **FAKRA Connector Housing Disassembly/FAKRA Splice Repair Service Cable Assembly Procedure** section for detailed instructions.
 - The splice box arrow must always point in the direction of the red flag label or red sleeve on the FAKRA splice repair service cable.
 - The splice box is a **ONE-TIME** use part. Never reuse the splice box after it has been installed.
 - If any of the lock tabs break during installation, the splice box half(s) must be replaced.
 - If the splice box is installed **incorrectly**, the repair **will fail**; MOST Ring failure conditions will still occur.
3. Tape both FAKRA splice repair cables and splice boxes to the stereo amplifier harness.

Keep smooth curves with a radius bend greater than 25 mm.



Attach the FAKRA service cables and splice boxes to the appropriate component harness with tape to prevent any rattles.

4. Reconnect the FAKRA connectors and any other related connectors to the tuner unit.

REPAIR VERIFICATION PROCEDURE

1. Install all of the removed parts in the reverse order of removal.

NOTE:

- When reinstalling components, make sure the harness is routed correctly. A misrouted harness can put pressure on the wires and connectors causing connection issues.
 - Do not pull on the units or MOST cables while the FAKRA connectors are connected to help prevent communication issues.
 - The front and rear climate control unit's self-diagnostic function must be done with the i-HDS, or the climate control will not function correctly.
2. Start the vehicle and verify that the gauge control module and infotainment control module are operating normally. Then, push the power button to OFF mode. Open and close the driver's door, then restart the vehicle. Reverify the gauge control module and the infotainment control module are operating normally. If all systems operate normally, the repair is complete.
 3. If components do not operate as intended, reinspect FAKRA splice repair service cables, splice box connections, and routing. Make sure the splice box arrow is pointing to the red flag label or red sleeve on the FAKRA splice box service cable.

NOTE: If all FAKRA splice repair service cables, splice box connections, and routing are correct, follow normal troubleshooting procedures per a System Information search on iN.