



Emissions Service Action

Code: 26OB

Subject	Exhaust Pressure Sensor				
Document History	Date		Summary		
	05/20/2025		Original publication		
Affected Vehicles	Country	Beginning Model Year	Ending Model Year	Vehicle	Vehicle Count
	USA	2025	2025	JETTA	19
	USA	2025	2025	TAOS	9
	CAN	2025	2025	JETTA	63
	CAN	2025	2025	TAOS	242
	<p><i>Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.</i></p> <ul style="list-style-type: none"> ✓ <i>Campaign status must show "open."</i> ✓ <i>If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.</i> 				
About this service action:	In affected vehicles it is possible that a faulty exhaust pressure sensor may impact tailpipe emissions. To address this issue, the exhaust pressure sensor will be replaced on affected vehicles.				
Code Visibility	On or about May 20, 2025, the campaign code will be applied to affected vehicles.				
Owner Notification	Owner notification will take place in May 2025. Owner letter examples are included in this bulletin for your reference.				
Additional Information	<p>Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.</p> <p>Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before delivery to consumers</u></p> <p>Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. <i>Labels can be ordered at no cost via the Compliance Label Ordering portal at www.vwhub.com.</i></p>				

Parts Information

Criteria	Quantity	Part Number	P.O.C. Part Description	Ordering Method
01	1	05E-906-277-A	PRESSENS	Reference POC comments individually by part number, or in the POC Campaign List

Initial Allocation: NO	There will be no parts allocation.
---	------------------------------------

NOTE

Your dealer's Estimated Remaining Repairs by campaign can be found in Parts on Command. Click on "View Campaign List" and review the Estimated Remaining Repairs column.

NOTE

Campaign parts should always be ordered as per the parts information in this circular. The ordering system will supersede the part, if applicable.

Claim Entry Instructions

The labor times listed here may differ from the labor operations and labor times listed in ELSA.

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the ELSA screen print showing action open on the day of repair to the repair order.

If a customer declines campaign work, refer to the "Customer Declines Campaign/Update Repair" section in the Campaign/Update Policy and Procedures Manual.

Service Number	26OB (letter O, not number zero)		
Damage Code	0099		
Parts Vendor Code	WVO		
Claim Type	Sold vehicle: 7 10 Unsold vehicle: 7 90		
Causal Indicator	Mark PRESSENS* as causal part		
Vehicle Wash/Loaner	Do not claim wash/loaner under this action. Loaner/rental coverage cannot be claimed under this action. However, loaner/rental may be covered under the current loaner/mobility program. Please refer to the Volkswagen Warranty Policy and Procedures Manual for loaner claims information and reimbursement details.		
Criteria I.D.	01		
	LABOR		
	Labor Op	Time Units	Description
	2675 55 45	SEE ELSA	Pressure sensor replace
	<i>Add only if MIL was illuminated and fault P0471 was stored</i>		
	2706 89 50	SEE ELSA	Battery Charge
	0150 00 60	Time stated on diagnostic protocol	GFF/Guided functions (clear fault memory)
	PARTS		
	Quantity	Part Number	Description
	1.00	05E906277A	PRESSENS*

Customer Letter Example (USA)

<MONTH YEAR>

<CUSTOMER NAME>

<CUSTOMER ADDRESS>

<CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <MODEL YEAR> <BRAND> <CARLINE>, <VIN>

Subject: Emissions Service Action 26OB – Exhaust Pressure Sensor

Dear Volkswagen Owner,

In cooperation with the United States Environmental Protection Agency and the California Air Resources Board, we are informing you of our decision to conduct an emissions service action on certain 2025 model year Volkswagen vehicles. Our records show that you are the owner of a vehicle affected by this action.

About this service action:

In affected vehicles it is possible that a faulty exhaust pressure sensor may impact tailpipe emissions. To address this your authorized Volkswagen dealer will replace, the exhaust pressure sensor at no cost to you. This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule.

IMPORTANT! Please note that if any control module(s) in your vehicle has been “chipped,” “tuned,” or otherwise modified from factory specifications with aftermarket components and/or software, work needed to repair, replace, or return the control module(s) to factory specifications is NOT covered under this action.

What should you do?

In order to limit any possible inconvenience, please contact your authorized Volkswagen dealer as soon as possible to schedule this work. To set up an appointment online, please visit www.vw.com/find-a-dealer.

Additional Information

- If you are the lessor and registered owner of the vehicle identified in this action, please forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt.
- If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, if you have changed your address or no longer own the vehicle identified in this letter, or if you should have any questions about this communication, please reach out to us using your preferred method of communication at www.vw.com/contact or by calling us at 800-893-5298.
- To check your vehicle’s eligibility for repair under this or any other recall/service campaign, please visit www.vw.com/owners/recalls and enter your Vehicle Identification Number (VIN) into the Recall/Service Campaign Lookup tool.

We apologize for any inconvenience this matter may cause; however, we are taking this action to help ensure your vehicle continues to meet and exceed your expectations.

Sincerely,

Volkswagen Customer Protection

Customer Letter Example (CANADA)

<MONTH YEAR>

<CUSTOMER NAME>

<CUSTOMER ADDRESS>

<CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <MODEL YEAR> <BRAND> <CARLINE>, <VIN>

Subject: Emissions Service Action 26OB – Exhaust Pressure Sensor

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the *Canadian Environmental Protection Act, 1999*. Volkswagen has determined that a defect, which relates to a prescribed emission standard, exists in certain 2025 model year Volkswagen vehicles. Our records show that you are the owner of a vehicle affected by this action.

About this service action:

In affected vehicles it is possible that a faulty exhaust pressure sensor may impact tailpipe emissions. To address this your authorized Volkswagen dealer will replace, the exhaust pressure sensor at no cost to you. This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the work, as well as to accommodate their daily workshop schedule.

On or about **May 20, 2025**, the necessary repair instructions and parts (if applicable) will be available to your authorized Volkswagen dealer.

IMPORTANT! Please note that if any control module(s) in your vehicle has been “chipped,” “tuned,” or otherwise modified from factory specifications with aftermarket components and/or software, work needed to repair, replace, or return the control module(s) to factory specifications is NOT covered under this action.

What should you do?

In order to limit any possible inconvenience, please contact your authorized Volkswagen dealer as soon as possible to schedule this work.

Additional Information

- If you are the lessor and registered owner of the vehicle identified in this action, please forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt.
- If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, if you have changed your address or no longer own the vehicle identified in this letter, or if you should have any questions about this communication, please contact Customer Relations, Monday through Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our “Contact Us” page at www.vw.ca.

We apologize for any inconvenience this matter may cause; however, we are taking this action to help ensure your vehicle continues to meet and exceed your expectations.

Sincerely,

Volkswagen Customer Protection

Repair Overview




- Replace G450 Exhaust Pressure Sensor.

! NOTE

- These repair instructions may differ from the labor operations and labor times listed in ELSA.
- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.
- When working during extreme temperatures, it is recommended that the vehicle be allowed to acclimate inside the shop to avoid temperature-related component damage/breakage.

Required Tools



	Socket – 24mm -T40284- (or equivalent)		
---	--	--	--

Repair Instruction


Section A - Check for Previous Repair

TIP

If Campaign Completion label is present, no further work is required.

Applicable criteria ID(s)	Campaign/Action Status
01 	Open 

EXAMPLE

Campaign/Action	Start	Designation
	2015-11-10	W-SERV_ACT -
	2018-12-13	RECALL -
	2017-05-16	A-RECALL -

EXAMPLE

- Enter the VIN in Elsa and proceed to the “Campaign/Action” screen.

TIP

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

CRITICAL REPAIR STEP




All campaigns/actions with a repair available must be performed in order of the Start date <arrow 3>. The oldest should be performed first (unless otherwise noted in the repair instructions).

Proceed to Section B

Section B – Repair Procedure

NOTE

The condition addressed by this campaign may cause the MIL to illuminate and fault code P0471 – “exhaust pressure sensor implausible signal” to be stored.

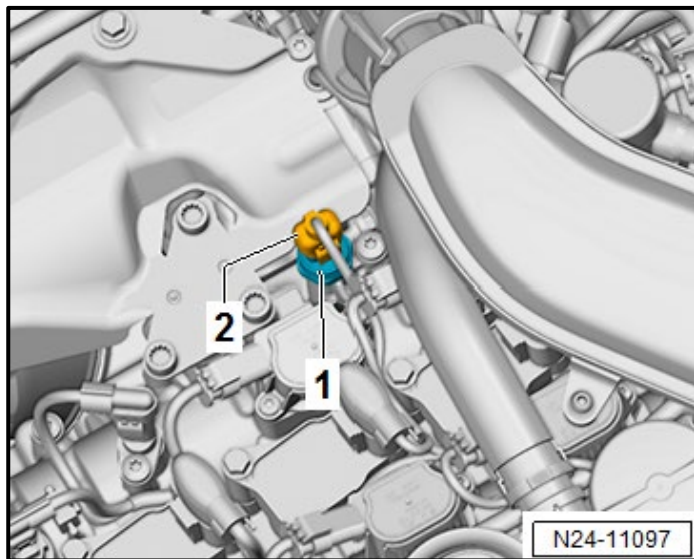

Replace G450 exhaust pressure sensor:

- Replace the G450 exhaust pressure sensor <1> per the ELSA repair manual:
 - *Repair manual > Engine > 4-Cylinder Direct Injection 1.5L 4V, EA 211 evo2 Engine, Turbocharger > 24 Multiport Fuel Injection > Sensors > Exhaust Pressure Sensor 1 G450, Removing and Installing.*

Part Number	Part Description
05E-906-277-A	Pressure sensor

- Perform the following only if the vehicle arrived with the MIL illuminated and fault P0471 is found to be stored:
 - Scan the vehicle using GFF.
 - Clear the fault memory.
 - Send the diagnostic protocol online when exiting ODIS.

Proceed to Section C

Section C – Campaign Completion Label

Install Campaign Completion Label

- Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.



TIP

Ensure Campaign Completion Label does not cover any existing label(s).

Proceed to Section D

Section D - Parts Return/Disposal

Properly store (retain), destroy or dispose of removed parts in accordance with all state/province and local requirements, unless otherwise indicated and/or requested through the Warranty Parts Portal (WPP) for U.S. and the Part Destruction and Core Disposition Report for Canada.