

Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	2021-2025	All	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2066639/5	7/14/25	94-22-01	Updated to clarify photos and documentation submitted to the WISE system.
2066639/4	11/27/24	94-22-01	Update to model and model year applicability.
2066639/3	7/15/24	94-22-01	Update to model year applicability.
2066639/2	12/12/22	94-22-01	Update to model year applicability.
2066639/1	3/29/22	94-22-01	Original publication.

The lenses of the taillights are steamed up/damp from the inside with minor or major water droplet concentration.

Technical Background

Lights with LED technology do not warm the lens as much when switched on as conventional bulb technology does. Therefore, less waste heat is created to dry out the lenses.

High air humidity and temperature differences between taillights and surrounding area can lead to condensation, mainly in winter or in wet weather.

The steaming-up of the taillights can be compared with a steamed-up windshield.


This condition can occur particularly after driving through a car wash or temperature changes overnight.

With the simultaneous of cooling the lens due to cold fresh air, the smallest amount of humidity immediately condenses on the inside of the taillight lens. On taillight lenses with a clear glass optics this phenomenon is more noticeable than on red transparent taillight lenses.




The physical condensation of the taillights is an optical phenomenon which does not affect the function of the taillights. The replacement of the taillight cluster with physical damage related to condensation is not permitted as this is not a technical fault and is not covered by warranty.

1. Example of taillight with slight condensation, no drips or water droplets.

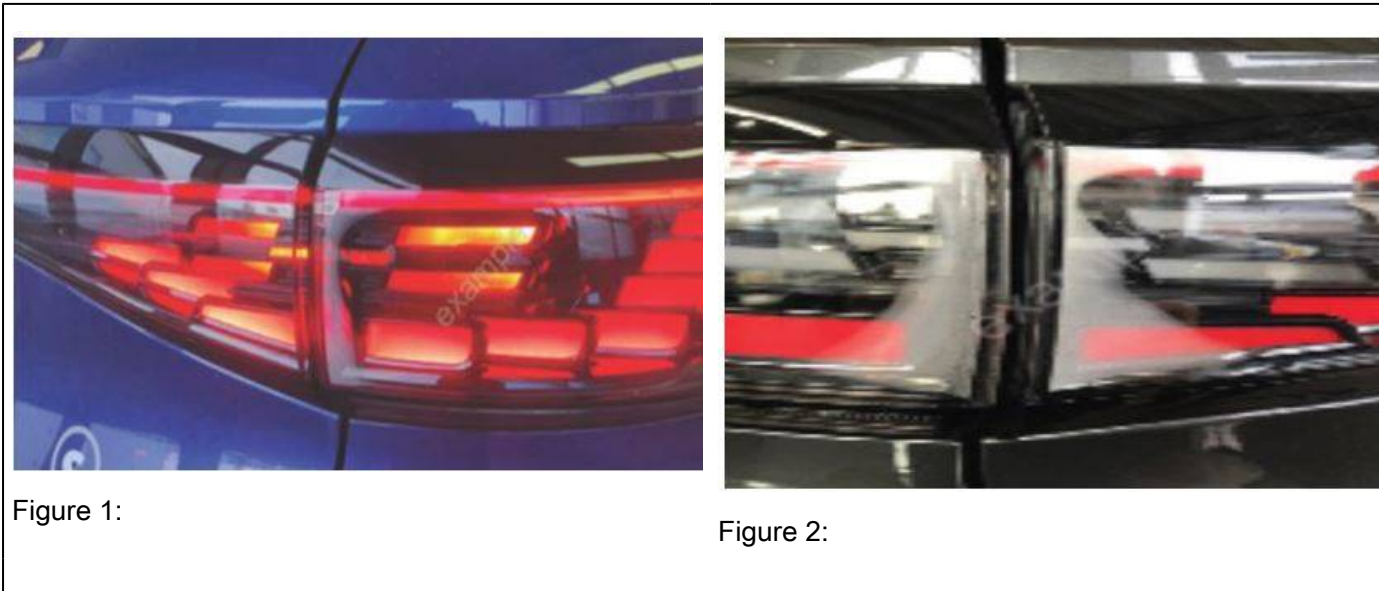

2. Examples of taillight condensation, with droplets or water dripping.

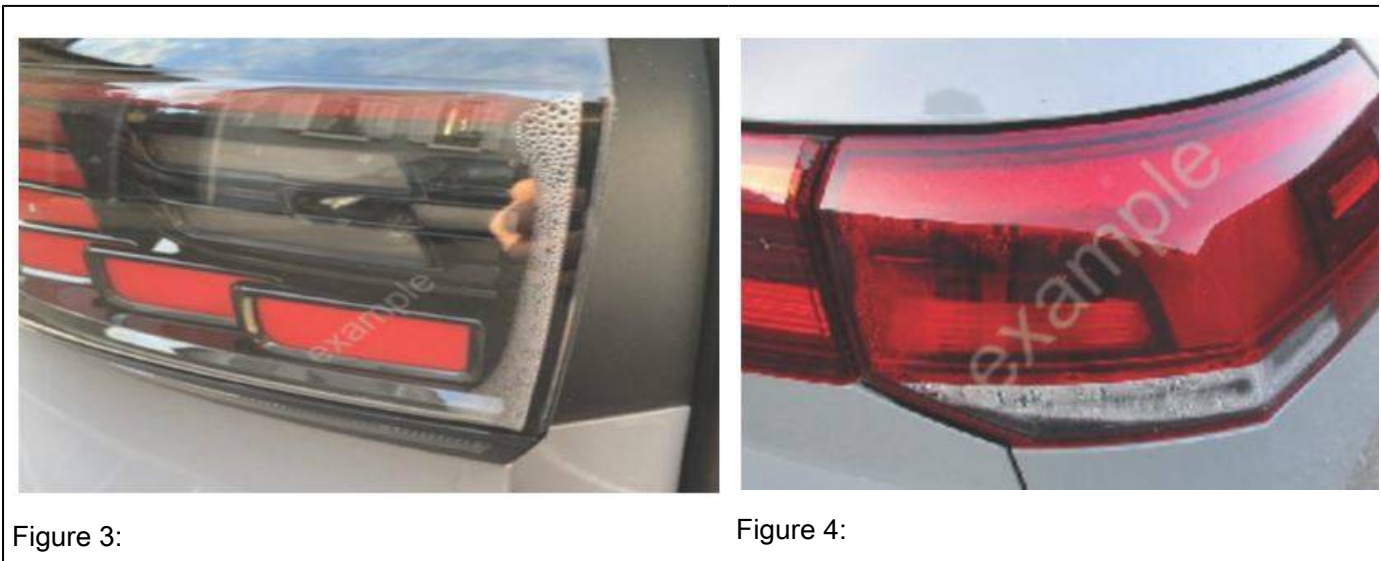

The following points have to be checked to prevent an unnecessary replacement of taillights.

1. Taillights: the condensation should systematically dry out after a change of the climate conditions.

However, the duration of the drying out process is dependent upon the outside temperature, the general air humidity, and a possible change in the temperature.

This condition is normal, no replacement necessary.

2. In case of an obvious water ingress check the taillight cluster for optical faults (seal fit, taillight housing cracks).



Upon replacing taillights all documentation and pictures showing the water ingress and/or optical faults must be uploaded to WISE for warranty reimbursement. See warranty section for more information on uploading information in WISE.

Production Solution

NA.

Service

NA.

Warranty

Information only.



All documentation is needed for reimbursement and must be uploaded to WISE. For information on uploading documents and pictures in WISE, go to WISE, Resource Center, Dealer Processes & Guide, select .pdf file: Wise Operations Section-Doc-IT Technical Bulletin Uploading Process Job Aid.

Required Parts and Tools

No Special Parts required.

No Special Tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2025 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.