

WRU8 - Replacing Tailpipe Trim (Workshop Campaign)

Model Year: **2025**

Model Line: **911 (992)**


Concerns: **Tailpipe trim**

Cause: **During in-house quality analyses, it was determined that tailpipe trim that does not meet the required specifications had been installed on the affected vehicles.**
 In conjunction with high thermal loads, such as during longer high-speed driving, the air intake frame of the rear apron may become thermally deformed over its service life.
 Customers might consider this as a visual detriment.

Action: Replace the tailpipe trim.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation Position:

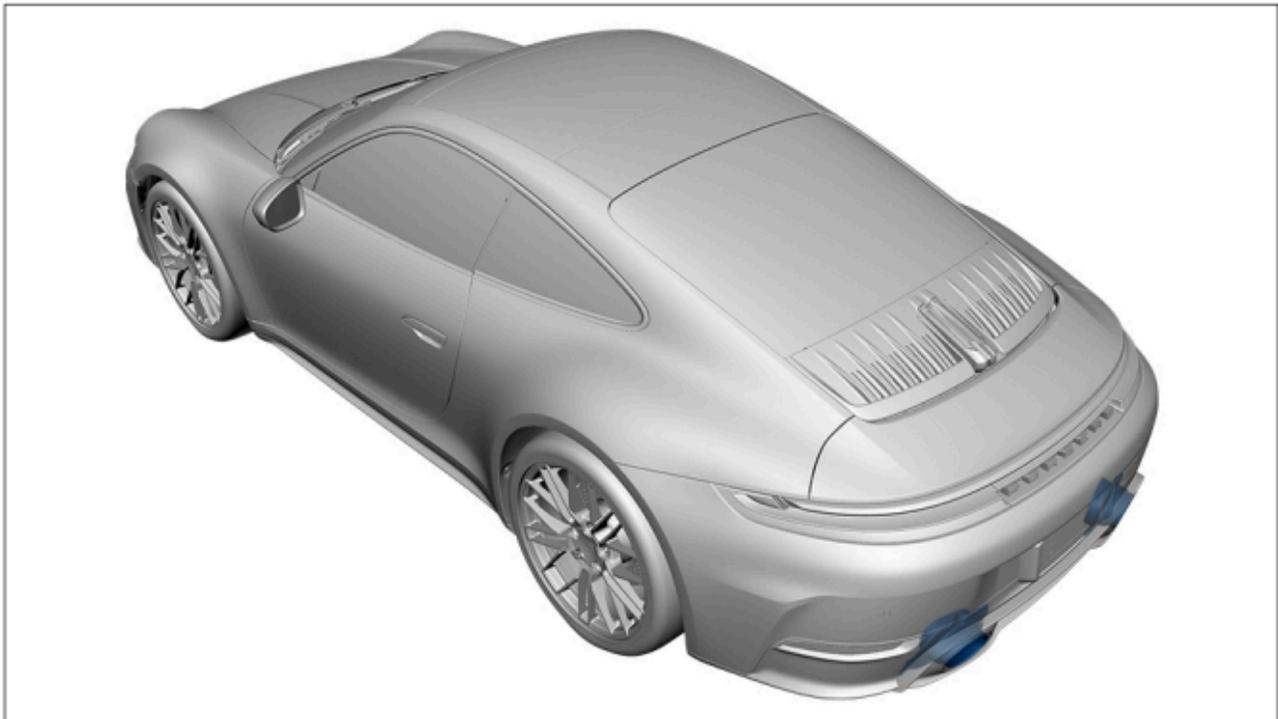

Installation position of tailpipe trim

Required parts

The **part numbers** of the **required parts** for the respective vehicle can be viewed in the **assigned scope**. For an overview of the campaign scopes, see: ⇒ *Technical Information 'Warranty processing'*.

Required tools

Tools:

- **P90999 - PIWIS Tester 4**
- Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 90-A battery charger**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charge vehicle electrical system battery'*
- Torque screwdriver, 1.5-3.0 Nm (1-2 ftlb.), e.g., **VAS 6494 - torque screwdriver, 1.5-3.0 Nm (1-2 ftlb.)**
- Torque wrench, 6-50 Nm (4.5-37 ftlb.), e.g. **V.A.G 1331A - torque wrench, 6-50 Nm (4.5-37 ftlb.)**



Information

Additional required tools for the adjustment/calibration of the assistance systems required for carrying out this campaign are to be determined independently in accordance with the valid Workshop Manual in PCSS.

Replacing tailpipe trim

Work Procedure: 1 Replace previous tailpipe covers with **tailpipe trim with optimized component status**.

For work procedure, see: ⇒ *Workshop Manual '263519 Removing and installing tailpipe trim'*

2 Enter the campaign in the Warranty and Maintenance Logbook.

Warranty processing



Information

The specified labor times were determined specifically for carrying out this campaign and include all necessary preliminary and subsequent rework. The labor time may differ from the labor time published in the Labor Operation List in the PCSS.

Scope 1:

Replacing tailpipe trim

- Vehicles with exclusive Sport titanium tailpipe trim (**M-no. OP5**)

Labor time:		
Replacing tailpipe trim		Labor time: 276 TU
Includes:	Raising and lowering vehicle Removing and installing rear bumper Removing and installing tailpipe trim Setting/calibrating assistance systems	
Required parts:		
992251237AG	Exhaust tailpipe for sports exhaust system – left	1 piece
992251238AG	Exhaust tailpipe for sports exhaust system – right	1 piece
⇒ Damage number WRU8 066 000 2		

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.