

Technical Information

Service

2025

FNU

ASA2

ASA2 - Replace Front Seat Cushion (Passenger Side) (Recall Campaign)

Model Line: Taycan (Y1A/Y1B/Y1C)

Model Year: As of 2022 up to 2023

Country/Market: • USA (CO2)

Canada (C36)Puerto Rico (COA)

Concerns: Front seat (passenger side)

Cause: Due to a faulty crimping connection of the seat cushion heating, the seat occupancy detection for

the passenger side can activate a failsafe mode that deactivates the airbag on the passenger seat. If the activated airbag warning signal or the warning message "passenger airbag OFF" is ignored by the passenger and the passenger does not move to another seat position or leaves the vehicle, the protection of the front airbag system is not fully available to the passenger in the event of an accident. This increases

the risk of injury to the passenger on the passenger seat.

Action: Replaced the seat cushion with the integrated seat occupancy detection (passenger side).

Affected Vehicles:

Only vehicles assigned to the campaign (see also PCSS Vehicle Information).



Information

To find out which campaign scope is assigned to the respective vehicle for **replacing the seat cushion with seat occupancy detection**, see PIWIS Vehicle Information.

The part numbers of the parts required for the respective vehicle are specified in the assigned scope for "Replacing front seat cushion (passenger side)".

For an overview of the campaign scopes, see: ⇒ Technical Information 'Warranty processing'


ENU **2025**

001 110

ASA2

Technical Information

Installation Position:

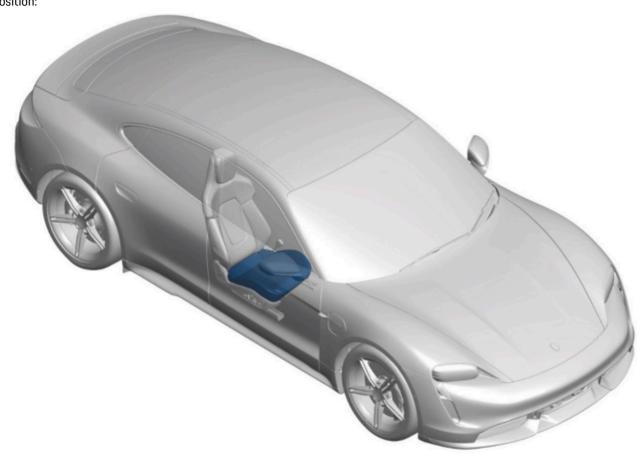

Installation position of seat cushion with integrated seat occupancy detection

Required tools

Tools:

- Battery charger with a current rating of at least 90 A, e.g., battery charger 90 A
- P90999 Porsche Tester 4
- Cushion clip pliers
- Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g. torque wrench, 2-10 Nm (1.5-7.5 ftlb)
- Torque wrench, 6-50 Nm (4.5-37 ftlb), e.g. torque wrench, 6-50 Nm (4.5-37 ftlb)

Replace front seat cushion (passenger side)

Work Procedure: 1 Remove front seat. ⇒ Workshop Manual '720119A6 Remove and install front seat'

- 2 Remove control panel trim. ⇒ Workshop Manual '721619A1 Remove and install control panel trim'
- 3 Remove front seat trim panel. ⇒ Workshop Manual '721619A3 Remove and install front seat trim panel'

Service

2025 ENU ASA2

- Remove front seat cushion. ⇒ Workshop Manual '741055A2 Replace front seat cushion'
- 5 Install **new** seat cushion with integrated seat occupancy detection. ⇒ Workshop Manual '741055A2 Replace front seat cushion'
- 6 Install front seat trim panel. ⇒ Workshop Manual '721619A3 Remove and install front seat trim panel'
- 7 Install control panel trim. ⇒ Workshop Manual '721619A1 Remove and install control panel trim'
- 8 Install front seat. ⇒ Workshop Manual '720119A6 Remove and install front seat'
- 9 Re-calibrate occupant detection control unit.
 For instructions, see: ⇒ Workshop Manual '696855 Replacing seat occupancy detection control unit'
- 10 On vehicles with seat memory passenger side, carry out a standardisation of the seat motors. For instructions, see: ⇒ Workshop Manual '729355A2 Replacing control unit for memory seat adjustment'
- 11 Enter the campaign in the warranty and maintenance logbook.

Warranty processing



Information

The specified labor time was determined specifically for carrying out this campaign and includes all necessary preliminary and subsequent rework. The labor time can differ from the labor time published in the Labor Operation List in the PCSS.

Scope 1: Not relevant for implementation.

Scope 2: Replace front seat cushion (passenger side)

- only relevant for vehicles with the following equipment combination: "Comfort seats front (8-way, electric)" (M-no. Q1G) and "without seat ventilation/massage seats" (M-no. 4D0)

Labor time:

Replace front seat cushion (passenger side)

Includes: Install and remove front seat

Remove and install control panel trim Remove and install front seat trim panel

Replace front seat cushion

Connect and disconnect Porsche Tester Re-calibrate occupant detection control unit Labor time: 151 TU

ASA2

Technical Information

Labor time: 151 TU

Required parts:

V04015800DG Repair kit for seat occupancy detection 1 piece

9A700748300 External hexalobular screw 4 pieces

⇒ Damage number ASA2 099 000 2

Scope 3: Replace front seat cushion (passenger side)

- only relevant for vehicles with the following equipment combination: "Comfort seats front (14-way, electric) with memory package" (M-no. Q2J) and "without seat ventilation/massage seats" (M-no. 4D0)

Labor time:

Replace front seat cushion (passenger side)

Includes: Install and remove front seat

> Remove and install control panel trim Remove and install front seat trim panel

Replace front seat cushion

Connect and disconnect Porsche Tester Re-calibrate occupant detection control unit Carry out standardisation of the seat motors

Required parts:

V04015800DH Repair kit for seat occupancy detection 1 piece

9A700748300 External hexalobular screw 4 pieces

⇒ Damage number ASA2 099 000 2

Service

2025 ENU ASA2

Labor time: 151 TU

Scope 4: Replace front seat cushion (passenger side)

- only relevant for vehicles with the following equipment combination: "Adaptive sports seats Plus front (18-way, electric) with memory package" (M-no. Q1J) and "without seat ventilation/massage seats" (M-no. 4D0)

Labor time:

Replace front seat cushion (passenger side)

Includes: Install and remove front seat

Remove and install control panel trim Remove and install front seat trim panel

Replace front seat cushion

Connect and disconnect Porsche Tester Re-calibrate occupant detection control unit Carry out standardisation of the seat motors

Required parts:

VO4015800DL Repair kit for seat occupancy detection 1 piece

9A700748300 External hexalobular screw 4 pieces

⇒ Damage number ASA2 099 000 2

Scope 5: Replace front seat cushion (passenger side)

- only relevant for vehicles with the following equipment combination: "Adaptive sports seats Plus front (18-way, electric) with memory package" (M-no. Q1J) and "Front seat ventilation" (M-no. 4D3)

Labor time:

Replace front seat cushion (passenger side) Includes: Install and remove front seat

Remove and install control panel trim Remove and install front seat trim panel

Replace front seat cushion

Connect and disconnect Porsche Tester Re-calibrate occupant detection control unit Carry out standardisation of the seat motors Labor time: 151 TU

ASA2 ENU **2025**

Technical Information

Labor time: 151 TU

Required parts:

VO4015800DM Repair kit for seat occupancy detection 1 piece

9A700748300 External hexalobular screw 4 pieces

⇒ Damage number ASA2 099 000 2

Scope 6: Replace front seat cushion (passenger side)

- only relevant for vehicles with the following equipment combination: "Comfort seats front (14-way, electric) with memory package" (M-no. Q2J) and "Front seat ventilation" (M-no. 4D3) or "Front massage function incl. front seat ventilation" (M-no. 4D5)

Labor time:

Replace front seat cushion (passenger side)

Includes: Install and remove front seat

Remove and install control panel trim Remove and install front seat trim panel

Replace front seat cushion

Connect and disconnect Porsche Tester Re-calibrate occupant detection control unit Carry out standardisation of the seat motors

Required parts:

VO4015800DK Repair kit for seat occupancy detection 1 piece

9A700748300 External hexalobular screw 4 pieces

⇒ Damage number ASA2 099 000 2

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.