

GENERAL MOTORS
DCS 7516
URGENT - DISTRIBUTE IMMEDIATELY

Date: June 10, 2026

Subject: N262560680 - Service Update
Transmission Control Body Missing Bolt

Models: 2026 Chevrolet Silverado 2500 HD/3500 HD
2026 GMC Sierra 2500 HD/3500 HD

General Motors is releasing Service Update N262560680 today. The total number of U.S. vehicles involved is 7.

What Should Dealers Do: Dealers should review IVH, or the Dealer Maxis reports for open VINs in their inventory. Dealers can view the attached bulletin, and it will also be displayed in Service Information tomorrow.

The Stock VIN list of vehicles in dealer inventory or in-transit is attached to this message. Note: this list is only accurate at the time of report creation and all VINs should be validated in IVH prior to repair.

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

END OF MESSAGE

Service Update

N262560680 Transmission Control Body Missing Bolt



Release Date: June 2026

Revision: 00

Attention: Please note: There are only 7 VINs involved in this field action. The VINs are located in the VIN Reference table below.

This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire June 2028.

Investigate Vehicle History (IVH) in the GM Global Warranty Management system MUST always be checked to confirm vehicle involvement and MUST be in OPEN status prior to beginning any required inspections and/or repairs. DO NOT use Service Information with VIN search, as it will not verify the VIN eligibility for field actions.

Make	Model	Model Year	
		From	To
Chevrolet	Silverado 2500 HD/3500 HD	2026	2026
GMC	Sierra 2500 HD/3500 HD		

Investigate Vehicle History (IVH) in the GM Global Warranty Management system MUST always be checked to confirm vehicle involvement and MUST be in OPEN status prior to beginning any required inspections and/or repairs. DO NOT use Service Information with VIN search, as it will not verify the VIN eligibility for field actions.

Condition	Certain vehicles listed above may have a condition in which the bolts for the transmission control valve body may be loose or missing.
Correction	Dealers will retorque or replace the suspect valve body bolts.

Parts

Quantity	Part Name	Part No.
As Req'd	Bolt, C//VLV UPPR BODY	11548794
1	Filter Kit, A/TRNS Fluid (W/Seal)	24298004
1	Seal, EXH SYS (Metal O Ring Style) (L8T)	15077362
1	Seal, EXH SYS (Donut Style) (L8T)	20987829
15	Fluid, A/Trans	19352619

Reminder: Parts required to complete this recall are to be obtained from General Motors Customer Care and Aftersales (GMCCA). Parts may be removed from SPRINT and Retail Inventory Management (RIM) and be non-returnable. Dealers should review the affected parts to confirm RIM managed status. Parts may have quantity limiters in effect. There are a small number of vehicles anticipated that will need this fix. Dealers are encouraged not to order these parts for use as shelf stock.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9108481	Retorque Valve Body Bolts L5P L8T	1.8 2.4	ZFAT	N/A

VIN Reference


1GB2KLE77TF286624
1GT4UPEY3TF286697
1GC4KNEY5TF283682
1GC4KNE71TF275621
1GC1KLE72TF286733
1GT3UTEY0TF280540
1GT4UPEY5TF279637

Service Procedure

1. Remove the transmission fluid pan and filter. Refer to *Automatic Transmission Fluid, Fluid Pan and/or Filter Replacement* in SI.

Service Update


N262560680 Transmission Control Body Missing Bolt

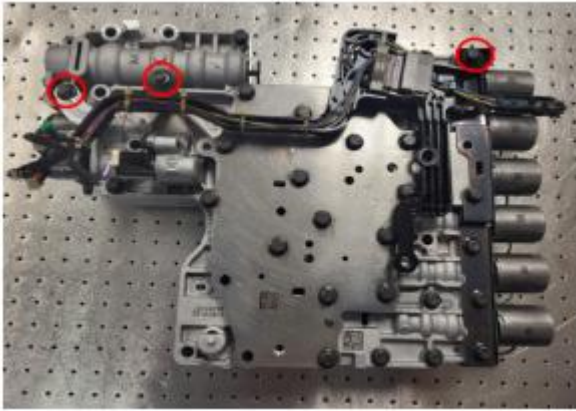

6985470

Note: Please note the location of the harness retaining bolts. The middle bolt is longer than the outside bolts.

2. Remove the three bolts circled above retaining the wiring harness and relocate it out of the way.

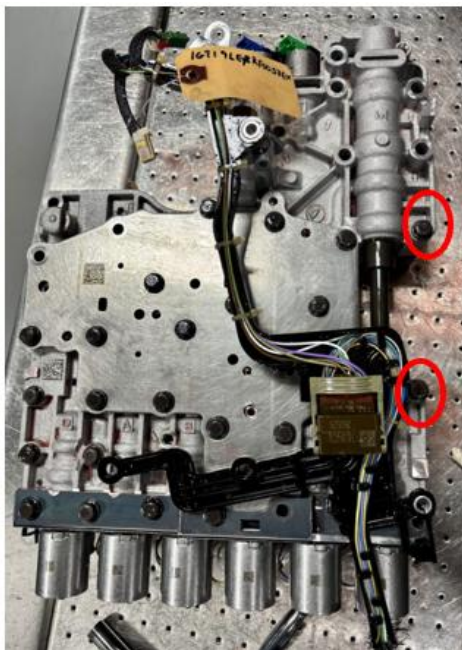

7155314

3. Verify the two valve body bolts circled above are torqued to **9 NM (80 in-lbs)**. Install new bolt(s) if missing.
4. Reposition the wiring harness and torque the three harness bolts to **9 NM (80 in-lbs)**.
5. Install a NEW transmission filter and pump seal before reinstalling the transmission fluid pan. Refer to *Automatic Transmission Fluid, Fluid Pan and/or Filter Replacement* in SI.
6. Fill the transmission to the proper level with NEW transmission fluid. Refer to *Transmission Fluid Fill Procedure* in SI.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service through the end date as noted in the Attention box, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Pre-Owned (CPO), courtesy transportation vehicles, dealer shuttle vehicles, CarBravo, etc. in dealers' possession and subject to this field action must be held and inspected/repared per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

Service Update

N262560680 Transmission Control Body Missing Bolt



All GM Certified Pre-Owned (CPO) vehicles currently in the dealers' inventory within the SHIFT Digital system will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the SHIFT Digital system, or once again be used in the Courtesy Transportation Program.

Dealer Reports – For USA and Export

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary Technician
Certification**