	GROUP **ELE**	MODEL **2014MY Soul (PS)**
	NUMBER **152**	DATE **September 2018**

TECHNICAL SERVICE BULLETIN

SUBJECT: MULTI-FUNCTION SWITCH REPLACEMENT FOR HEADLAMP FLICKERING


This bulletin provides the procedure to replace the multi-function switch on some 2014MY Soul (PS) vehicles, produced from July 21, 2013 through June 20, 2014, which may exhibit intermittent flickering of the low/high beams. To duplicate the concern, repeatedly operate the multi-function switch by activating the following:

1. On/Auto/Off switch,

   (**NOTE**: Prior to proceeding, the headlight switch must be in the 'ON' or 'AUTO' position with the headlights ON to do the next two (2) headlight flicker / intermittent operation evaluations.)

2. RH/LH Turn Signals activation/cancelation, and
3. High/Low Beam activation/cancelation (using different combinations).

If intermittent flickering of the low/high beams is duplicated, replace the multi-function switch by following the procedure outlined in this bulletin.

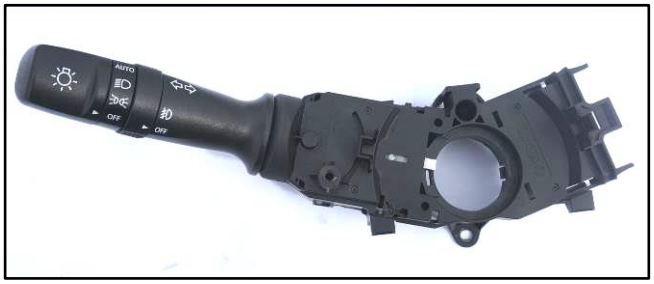


File Under: <Electrical>

Circulate To: ☒ **General Manager** ☒ **Service Manager** ☒ **Parts Manager**
☒ **Service Advisors** ☒ **Technicians** ☒ **Body Shop Manager** ☒ **Fleet Repair**

SUBJECT: MULTI-FUNCTION SWITCH REPLACEMENT FOR HEADLAMP FLICKERING

Replacement Procedure:

1. Replace the multi-function switch (A) by referring to the “Body Electrical Switch → Multifunction Switch → Repair procedures” chapter in the applicable Shop Manual on KGIS.

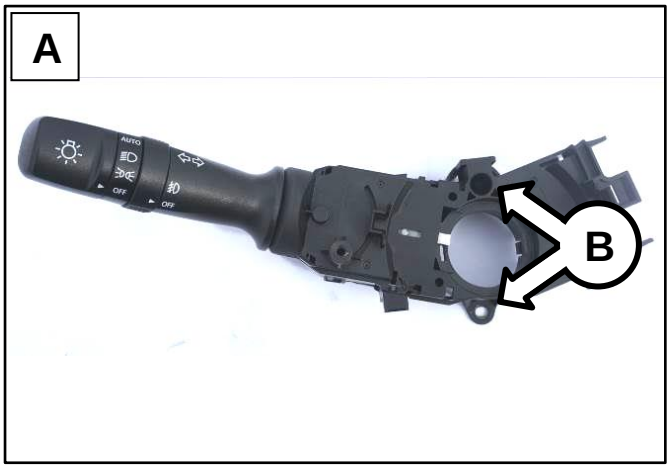

★ IMPORTANT

Be sure to replace the two (2) multi-function switch retaining screws (part no.: 12290 05121) (B) when installing the new switch (A).

SUBJECT:

MULTI-FUNCTION SWITCH REPLACEMENT FOR HEADLAMP FLICKERING

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Soul (PS)	July 21, 2013 through June 20, 2014

REQUIRED TOOL:

Tool Name	Tool Number	Figure	Comments
Generic Steering Wheel Removal	N/A		Locally sourced. This tool can be used in place of SST 09561 11001.

REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Multi-Function Switch	93410 B2001 93410 B2011 93410 B2101 93410 B2111		1
Switch Retaining Screws	12290 05121		2

WARRANTY INFORMATION:

N Code: B11 C Code: ZZ3

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	93410 B2000	0	Multi-Function Switch Replacement	93410F00	0.5 M/H	93410 B2001 93410 B2011 93410 B2101 93410 B2111	1
						12290 05121	2