INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)

STAR Case


Case Number: [redacted]

Release Date: 11/06/2015

Symptom/Vehicle Issue: MIL Lamp On, DTC P0335 Crankshaft Position Sensor

Discussion: Discussion: Check engine lamp is on at times, loss of power or hard starting, DTC p0335 Crankshaft Position Sensor may be stored or active. Inspect the F855 PK/YL and K925 DB/GY circuits at the PCM pins 67,88 Fig 1 or at the sensor pins 1,2 Fig 2. Clean and secure the terminals as needed.

Note: Relearn" Procedure must be performed every time there has been a repair/replacement made to a CMP Sensor and/or CKP sensor circuits.

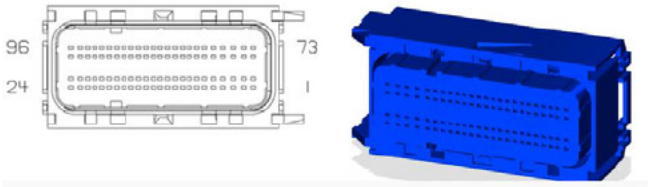

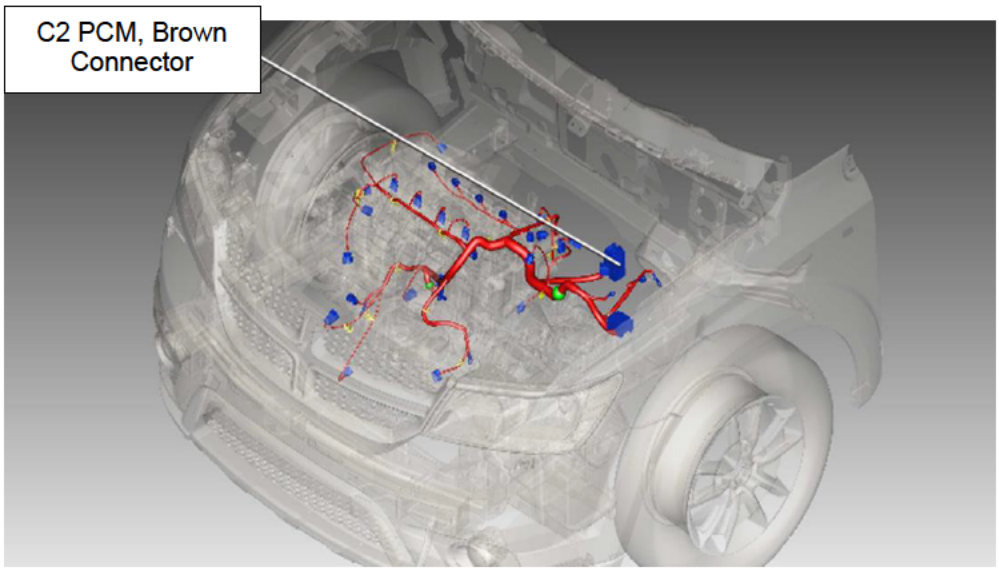
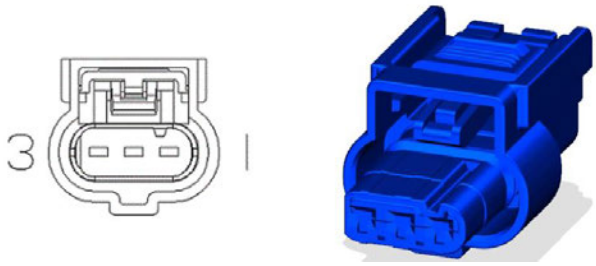


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Center Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via ECCI or eCONTACT ticket if no solution is found

STAR Case



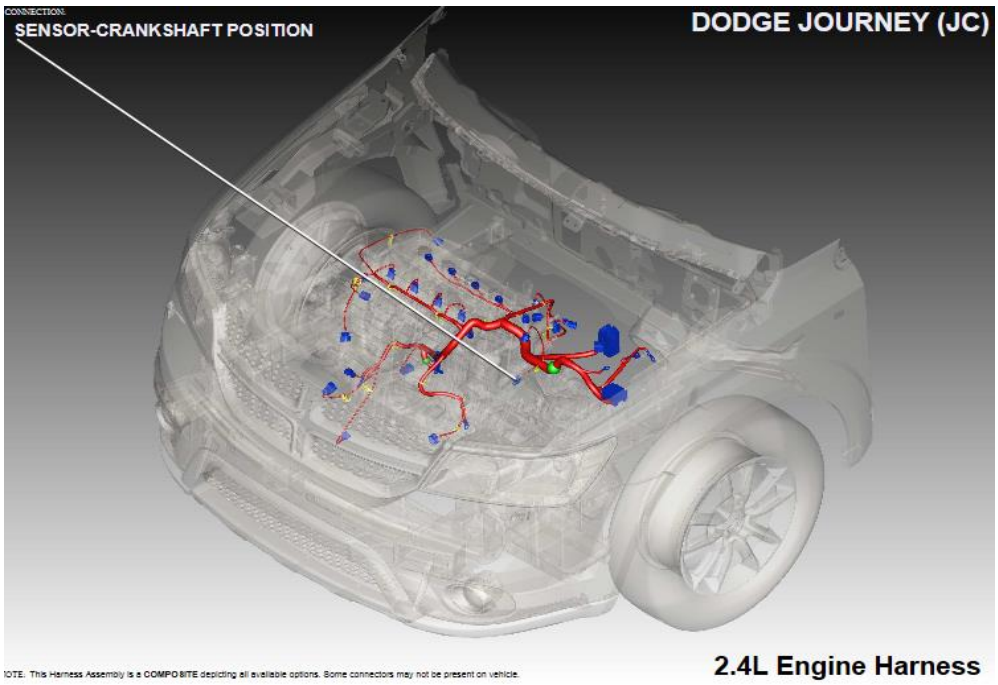


Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Center Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via ECCI or eCONTACT ticket if no solution is found