RECALL 25V361 / 2025-290 REMEDY INSTRUCTIONS

FOREST RIVER	Make(s): COLLINS SCHOOL BUS Model(s): MANY Model Year(s): 2025	Repair Code: RC-034-00-09-004340 Allotted Time: .17 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The vandal lock installed on the rear transit bus egress door may malfunction.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: CB447228-R Part(s) Return: N/A

Place vehicle in (P) Park and engage the Parking Brake. Disconnect the vehicles' battery Positive and Negative. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN – 2023 - 2027 – COLLINS SCHOOL BUS

SUPPLIES NEEDED

KIT NUMBER: FROM COLLINS, SPRING W/LOOP ENDS, 1.50" LONG
TORX PLUS 25 BIT
#10 – 24 X 3/4" PHILLIPS SCREW

STEP 1: PLACE #10 – 24 X ¾" PHILLIPS SCREW THROUGH ONE OF THE CLOSED LOOP ENDS OF THE STEEL EXTENSION SPRING (FIGURE 1);

FIGURE 1

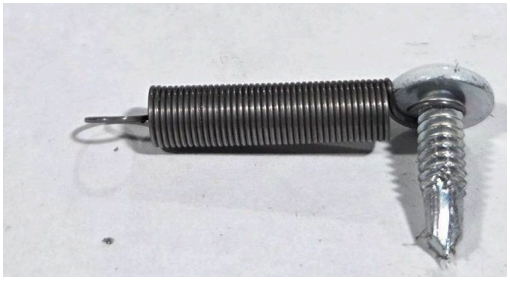

STEP 2: SCREW IN #10 – 24 X ¾" PHILLIPS SCREW AND STEEL EXTENSION SPRING THROUGH THE VANDAL LOCK ASSEMBLY IN THE PILOT HOLE BOTTOM LEFT CORNER. MAKE SURE NOT TO OVER TIGHTEN THE SCREW (FIGURE 2);

FIGURE 2

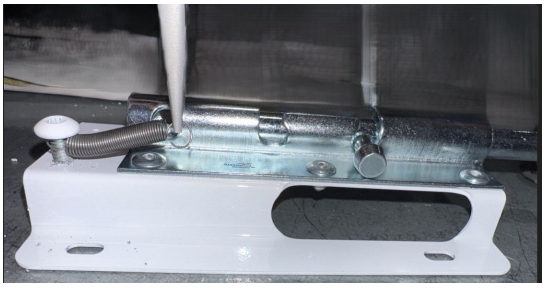

STEP 3: USING NEEDLE NOSE PLIERS WRAP THE OPPOSITE LOOP END OF THE STEEL EXTENSION SPRING AROUND THE GRAB OF THE BOLT LATCH. ENSURE THAT THE OPEN END OF THE LOOP FACES DOWNWARDS (FIGURE 3 & 4);

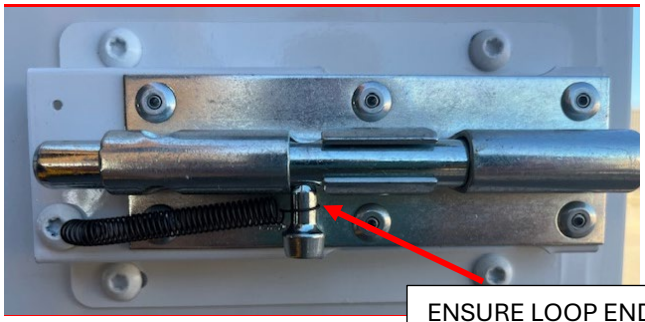

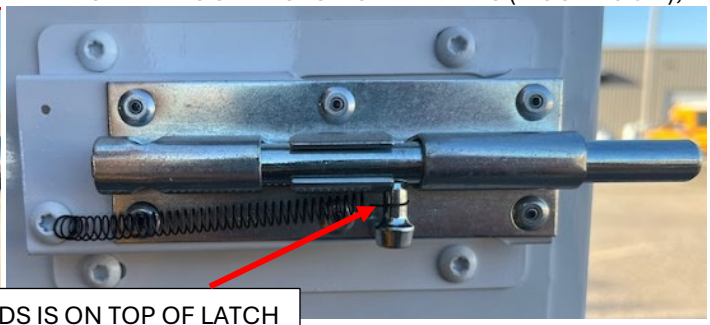

ENSURE LOOP ENDS IS ON TOP OF LATCH
FIGURE 3 FIGURE 4