RECALL 26V563 / 2026-419 REMEDY INSTRUCTIONS

FOREST RIVER	Make(s): VIBE Model(s): 3400XL, 3400SB, 2600RK, 3400BH	Repair Code: RC-024-09-00-004855 Allotted Time:.0.50 HR Inspection Code: RC-024-05-00-004854 Allotted Time:.0.25 HR
	Model Year(s): 2027 Concern: The furnace may not be properly installed against the sidewall, leaving a risk that the exhaust and intake tubes are not properly overlapping the outside flue.	Photo(s) Required: YES Prior Authorization Required: NO Part(s) Kit Number: N/A Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

1. LOCATE THE FURNACE DOOR ON THE OUTSIDE OF THE UNIT AND REMOVE
    a. THIS WILL ALSO REQUIRE THE FURNACE FLUE TO BE REMOVED
2. VISUALLY INSPECT THE FURNACE TO SEE IF IT IS PROPERLY INSTALLED AGAINST THE SIDE WALL (REFER TO FIGURES 1 AND 2 TO SEE HOW THE FURNACE SHOULD BE INSTALLED FOR BOTH VARIATIONS)
3. IF IT IS INSTALLED CORRECTLY, ENSURE THE PLATFORM IS SCREWED TO THE FLOOR OR WALL
    a. REINSTALL FURANCE DOOR AND FURNACE FLUE
    b. CLAIM INSPECTION CODE
4. IF THE FURNACE IS NOT INSTALLED CORRECTLY MOVE TO STEP 5
5. REMOVE ANY SCREWS THAT ATTACH THE PLATFORM TO THE WALL OR FLOOR
    a. THIS MAY REQUIRE REMOVING THE RETURN AIR GRILL FOR THE FURNACE INSIDE THE UNIT TO ACCESS ANY SCREWS IN THE PLATFORM IN THE INTERIOR OF THE UNIT
6. AFTER REMOVING THE SCREWS, PULL THE PLATFORM TO THE SIDEWALL AND SECURE TO THE FLOOR OR WALL
    a. REFER TO FIGURES 1 AND 2 FOR HOW FURNACE SHOULD BE PROPERLY INSTALLED
7. REINSTALL FURNACE DOOR AND FURNACE FLUE
    a. REFER TO FIGURE 3 FOR SUBURBAN'S REQUIRED OVERLAPPING OF EXHAUST AND INTAKE TUBES
8. SEAL ANY COMPONENTS THAT NEED SEALED
    a. REINSTALL RETURN AIR GRILL IF REMOVED
9. CLAIM REPAIR CODE

RECALL 26V563 / 2026-419 REMEDY INSTRUCTIONS

FOREST RIVER

Make(s): VIBE
Model(s): 3400XL, 3400SB, 2600RK, 3400BH

Model Year(s): 2027
Concern: The furnace may not be properly installed against the sidewall, leaving a risk that the exhaust and intake tubes are not properly overlapping the outside flue.

Repair Code: RC-024-09-00-004855
Allotted Time:.0.50 HR
Inspection Code: RC-024-05-00-004854
Allotted Time:.0.25 HR

Photo(s) Required: YES
Prior Authorization Required: NO
Part(s) Kit Number: N/A
Part(s) Return: N/A



Figure 1 Vertical Furnace

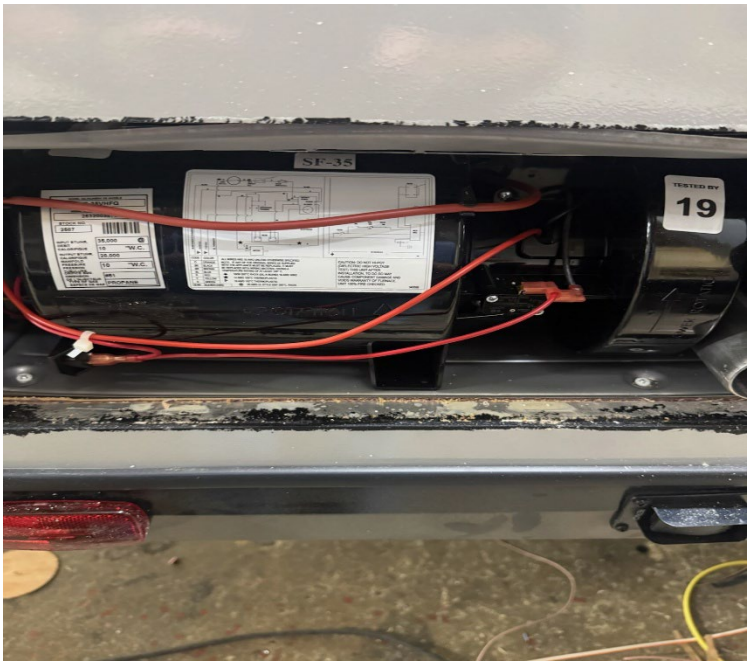


Figure 2 Horizontal Furnace

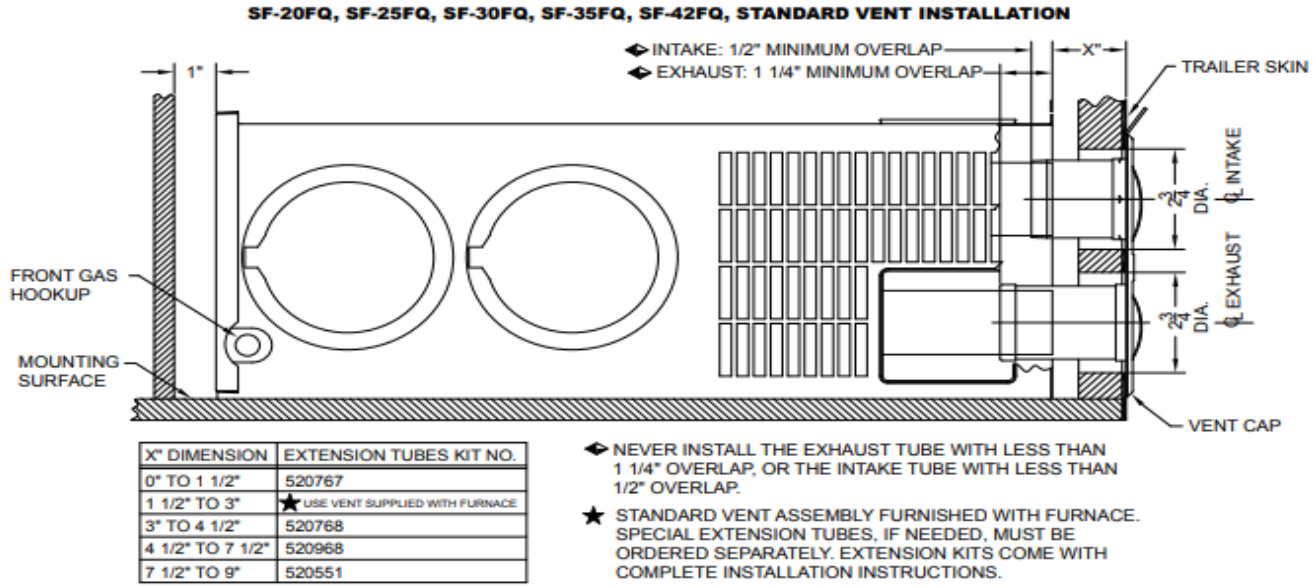


Figure 3 Suburban Install Guidelines