RECALL 26V586 / 2026-435 REMEDY INSTRUCTIONS

FOREST RIVER	Make(s): Salem & Wildwood Model(s): SMT263BHXL & WDT263BHXL Model Year(s): 2027 Concern: The exterior griddle may be stowed while still connected to LP Gas.	Repair Code: RC-096-03-00-004857 Allotted Time:.0.30 HR Inspection Code: RC-096-05-00-004856 Allotted Time:.0.20 HR Photo(s) Required: YES Prior Authorization Required: YES Part(s) Kit Number: Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

1. LOCATE THE OUTSIDE KITCHEN DOOR AND OPEN IT TO EXPOSE THE EXTERIOR GRIDDLE
2. FULLY EXTEND THE EXTERIOR GRIDDLE
   a. REFER TO FIGURES 1 & 2 FOR WHERE THE P CLAMPS SHOULD BE LOCATED
   b. IF BOTH CLAMPS ARE PRESENT THEN CLAIM INSPECTION CODE
3. IF ONLY ONE CLAMP IS PRESENT ON THE BACK SIDE, THEN ADD THE EXTRA 5/8" COATED CLAMP
   a. THE SECOND CLAMP IS TO BE ADDED ON THE UNDERSIDE OF THE GRIDDLE ON THE BACK RIGHT CORNER (REFER TO FIGURE 2)
4. ENSURE THAT THE EXTERIOR GRIDDLE CAN NOT BE STOWED WITH THE LP SUPPLY LINE CONNECTED
5. CLAIM REPAIR CODE

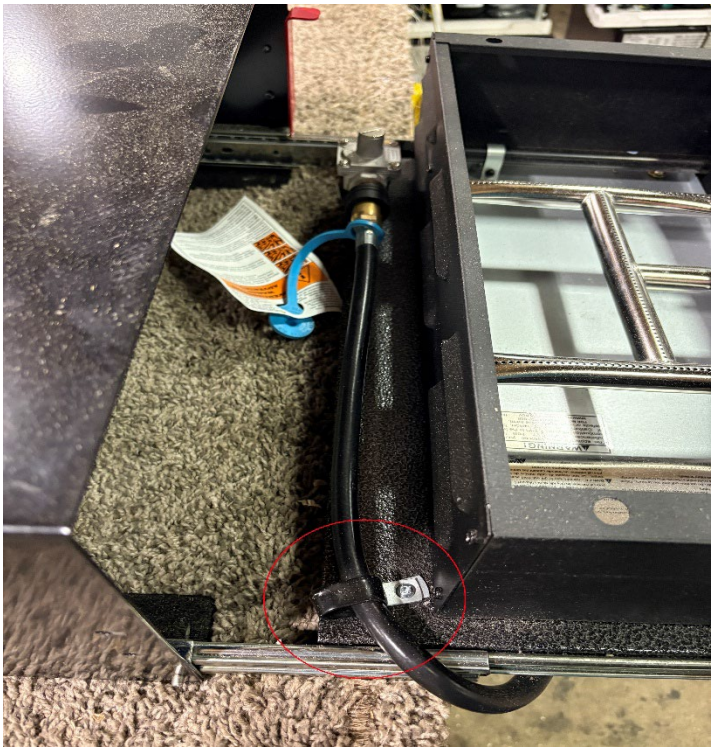


Figure 1 - BACK OF GRIDDLE



Figure 2 - UNDERSIDE OF GRIDDLE