WINNEBAGO

IMPORTANT SAFETY RECALL

** RECALL NOTICE **

NHTSA Safety Recall 26V-601 | Transport Canada NA

TO: **Winnebago Motorhome Dealers**

SUBJECT: **Campaign # 210 – Incorrect Tire and Loading Information Label**

Reason For This Recall

Winnebago Motorhomes has decided that a defect related to motor vehicle safety exists on certain **2027 Winnebago Arka** motorhomes. These vehicles were manufactured **June 4, 2026**, through **August 28, 2026.** These dates are a broad overview and non-sequential.

Winnebago Motorhomes has determined that certain 2027 Winnebago Arka motorhomes have a Tire and Loading Information Label displaying an incorrect rear GAWR and recommended cold tire inflation pressure. Consequently, the label does not provide an inflation pressure supporting the labeled rear GAWR, as required by S5.3.1 of FMVSS No. 120. The labeled rear GAWR of 13,500 pounds exceeds the combined load capacity of the rear tires at the labeled inflation pressure. Operating the motorhome at the labeled GAWR could overload the tires, increasing the risk of tire failure and a crash.

Dealer Campaign Responsibility
DO NOT DELIVER TO A CUSTOMER ANY SUBJECT VEHICLE UNTIL CORRECTIVE ACTION HAS BEEN TAKEN.

Dealers are to service all vehicles subject to this campaign at no charge to owners regardless of mileage, age of vehicle, or ownership from this time forward.

Whenever a vehicle subject to this campaign is taken into new or used vehicle inventory or is in your dealership for service, you should take the steps necessary to complete the recall prior to selling or releasing the vehicle. Dealers should contact owners of vehicles recently sold from their new vehicle inventory and make arrangements to complete the repair according to instructions contained in this recall.

The National Traffic and Motor Vehicle Safety Act, as amended, provides that each vehicle which is subject to a recall campaign of this type must be adequately repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time.

If the condition is not adequately repaired within a reasonable time, the owners may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation.

To avoid having to provide these burdensome solutions, every effort must be made to promptly schedule an appointment with each owner to repair their vehicle as soon as possible. If the condition is not remedied within a reasonable time, they are instructed on how to contact the National Highway Traffic Safety Administration.

Owner Notification
Owner letters with the correct Tire and Loading Information Label are expected to be mailed out one week after this notification.

Repair Procedure:
Refer to the instructions.

Parts Information:
For dealer vehicle inventory, order the parts kit for this recall. Owners are asked to bring their mailed label to their appointments if they want a dealer to remedy their vehicle. If an owner misplaced their label, please order their label prior to their appointment date.

Reimbursement:
When the service has been completed, submit the labor amount and labor operation number listed below. Your repair order must be properly signed by both the dealer and the owner.

All Recall Claims must utilize **SPEC24** as the designated Technical Information Code (TIC) within the Salesforce TIC Code FIELD.

Labor operation numbers can be found in the Warranty section of WinPortal under Vehicle Info

Thank you for your cooperation.

Winnebago Motorhomes
Forest City, Iowa 50436

Recall:	210

Labor Operation:	Recall 207 Incorrect Tire Label			
Operation Number	**Dealer Number**	**Parts Kit Number**	**Time Allowance**	**TIC CODE**
24102101	WG-007972	RC797227710	0.2	SPEC24

Incorrect Tire and Loading Information Label

Classification	Parts Kit Required			
Recall # 210	**Part #**	RC77227710	**Description**	RECALL #210 ARKA TIRE LABEL

Condition

Certain Winnebago vehicles have a Tire and Loading Information Label displaying an incorrect rear GAWR and recommended cold tire inflation pressure.

Correction

Install the corrected Winnebago Tire and Loading Information Label over the existing Winnebago Tire and Loading Information Label.

WGO Model Year	Revision	Make	Model	Model Code(s) (Floorplan)	WGO Built/Manufacturing Dates Impacted
2027	2	Winnebago	Arka	WF720Z2	6/4/2026 – 8/28/2026

Disclaimer: Read the entire instructions carefully before starting the procedure. If you have any questions, please contact the Winnebago Industries Technical Service Department by calling 1-866-653-4329 or by email: techservice@wgo.net . This document is confidential and is intended for dealer use only.

Parts/Kit Image Reference

Parts Required – RC797227710 RECALL #210 ARKA TIRE LABEL

1. Tire and Loading Information Label (087237-02-000) (1)

Shop Supplies

NA


1.




Steps & Procedures

1. Locate the existing Tire and Loading Information Label inside on the Driver's Door.



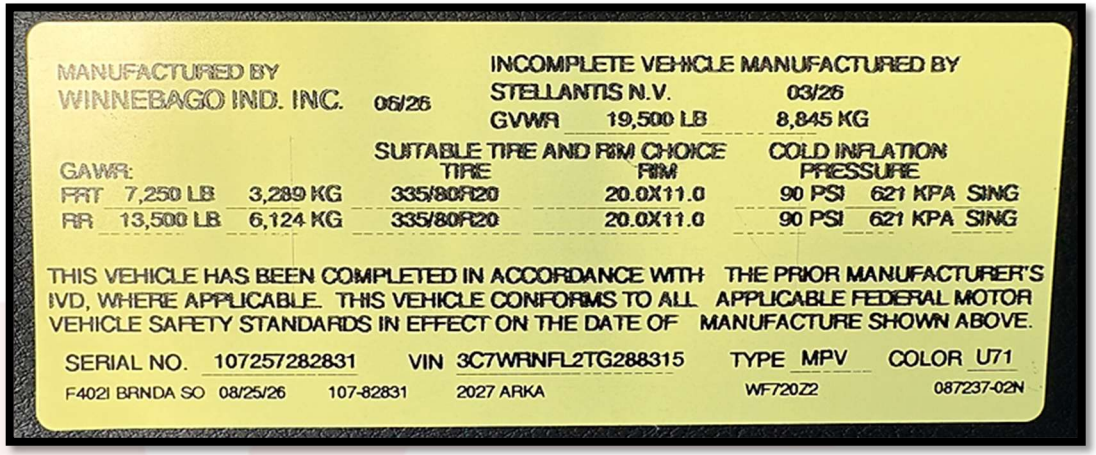

2. Place the New Label over the existing Tire and Loading Information Label.

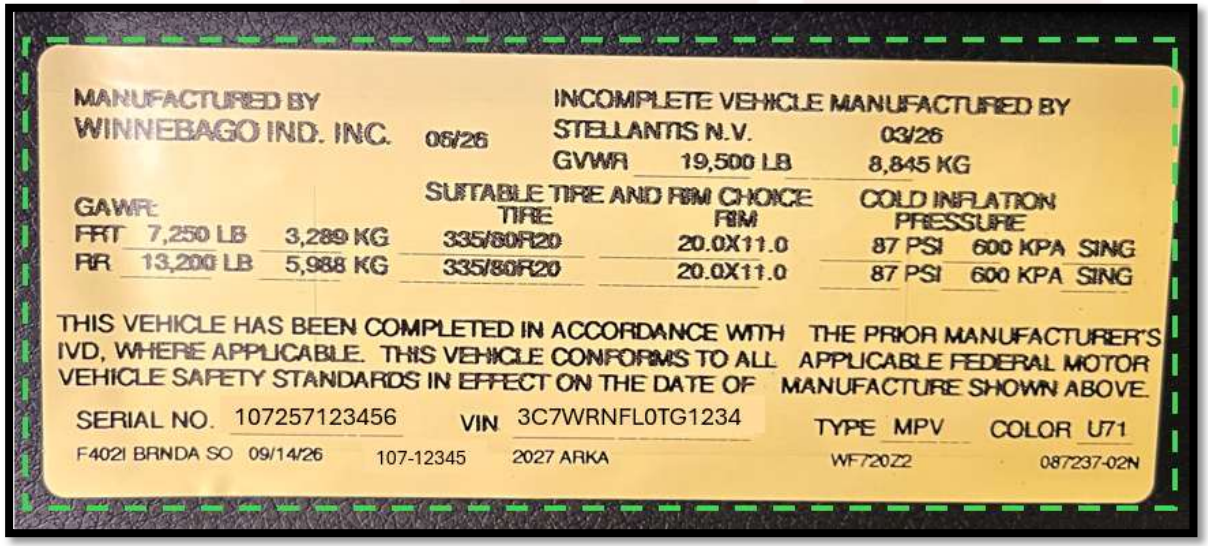

Ensure to place it over the Existing Tire and Loading Information Label, and **NOT** on the "OCCUPANT AND CARGO CARRYING CAPACITY" LABEL.