RECALL 26V603 REMEDY INSTRUCTIONS

FOREST RIVER	Make(s): GRAND SPORT GT Model(s): GGC45CB-600 Model Year(s): 2026 - 2027	Repair Code: RC-744-01-00-004859 Allotted Time: 1.00 HRS. Inspection Code: RC-744-05-00-004858 Allotted Time: .10 HRS.
	Concern: The "Engine Pre-Heat" option was improperly installed.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100898875 Part(s) Return: FIELD DESTROY

Place vehicle in (P) Park and engage the Parking Brake. Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

REMEDY:

ENGINE PREHEAT INSTALLATION CORRECTIONS
1. REPIN OR REPLACE OASIS HARNESS 2041.62
2. RE-ROUT HOSE FROM PUMP TO THE CORRECT SIDE OF OASIS.
3. MAKE SURE RED –BLACK WIRES FROM OASIS MARKED WITH YELLOW TAPE ARE WIRED TO THE PUMP.
4. REPLACE INSTALLED CLEAR HOSE WITH ½" HEATER HOSE TO THE ENGINE PREHEAT PUMP.
5. REPLACE WORM GEAR STYLE CLAMPS WITH ½" CONSTANT TENSION.
6. OPEN VALVES AT ENGINE.
7. LET ENGINE RUN TO PURGE LINES.
8. ADD ENGINE COOLANT.

STEP 1: REPLACE OR REPIN 2041-62 AT THE OASIS (REFERENCE ATTACHED DOCUMENTS); THE HARNESS IS LOCATED IN THE STORAGE BAY TO THE RIGHT OF THE OASIS BAY. IT IS IN THE UPPER LEFT CORNER OF THE STORAGE BAY

STEP 2: RE-ROUT HOSE FROM *RETURN* TO *SUPPLY SIDE* OF THE PUMP (REFERENCE ATTACHED DRAWING);

STEP 3: REPLACE THE CLEAR HOSE INSTALLED AT PUMP WITH PROPER 1/2" HEATER HOSE TO THE ENGINE PREHEAT PUMP;

STEP 4: REPLACE WORM GEAR STYLE CLAMPS WITH 1/2" CONSTANT TENSION CLAMP;

STEP 5: OPEN ENGINE PREHEAT VALVES ON ENGINE TO FILL THE HOSE LINES;

STEP 6: START ENGINE TO PURGE LINE;

STEP 7: REFILL ENGINE COOLANT AS NEEDED;


STEP 8: USE THE MUTIPLEX PANEL TO TURN ON THE ENGINE PREHEAT AND LISTEN FOR PUMP ACTIVATION TO MAKE SURE IT IS OPERATING PROPERLY;

STEP 9: CLAIM REPAIR CODE.


RECALL 26V603 REMEDY INSTRUCTIONS

FOREST RIVER	Make(s): GRAND SPORT GT Model(s): GGC45CB-600 Model Year(s): 2026 - 2027	Repair Code: RC-744-01-00-004859 Allotted Time: 1.00 HRS. Inspection Code: RC-744-05-00-004858 Allotted Time: .10 HRS.
	Concern: The "Engine Pre-Heat" option was improperly installed.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100898875 Part(s) Return: FIELD DESTROY


Harness pinout:

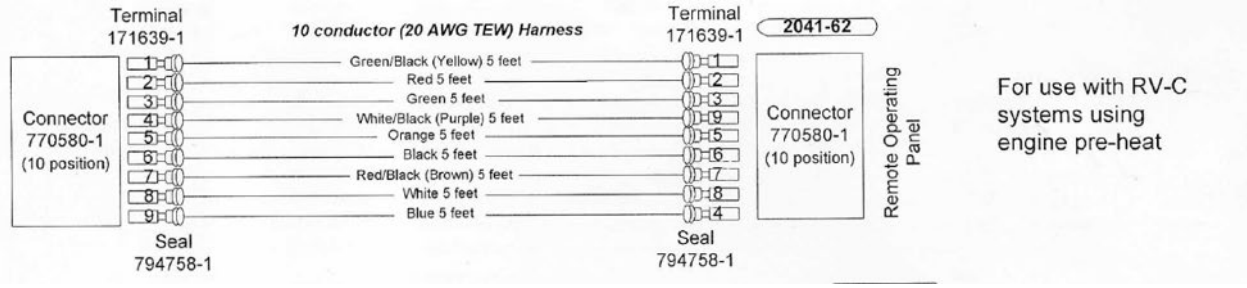

NOTE THE DIFFERENCE IN PIN CONFIGURATION BETWEEN LOCATIONS 4 AND 9 ON THE 770580-1 CONNECTORS.

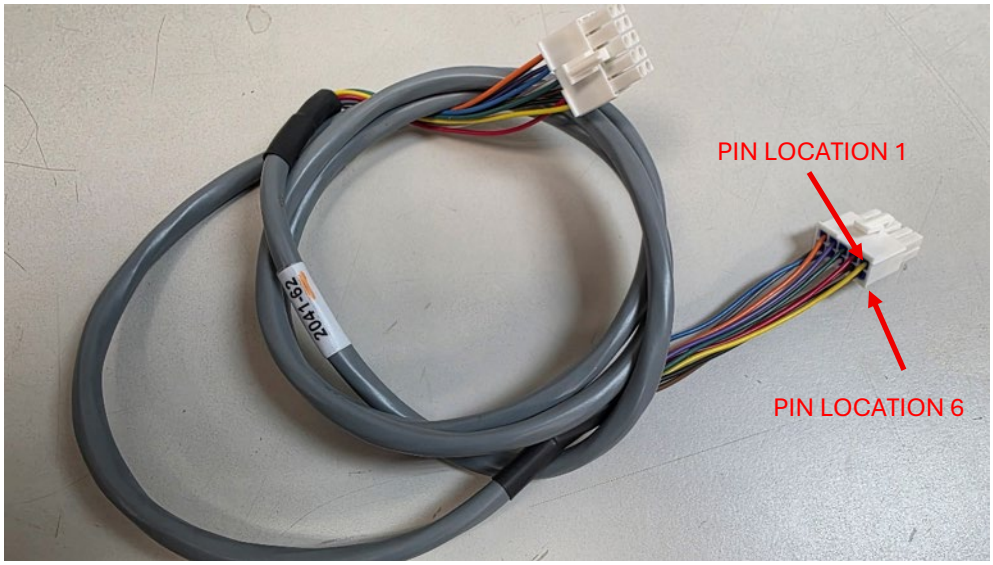

2041-62 RV-C REMOTE OPERATION CABLE BETWEEN ZONE BOARD AND RV-C NODE BOARD.

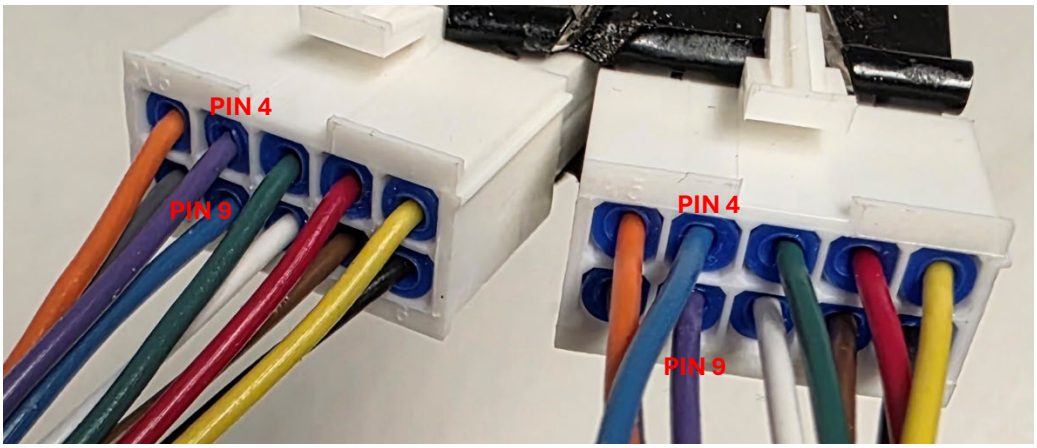

RECALL 26V603 REMEDY INSTRUCTIONS

FOREST RIVER

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027

Concern:
The "Engine Pre-Heat" option was improperly installed.

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: .10 HRS.


Photo(s) Required: NO
Prior Authorization Required: YES
Part(s) Kit Number: F100898875
Part(s) Return: FIELD DESTROY

RECALL 26V603 REMEDY INSTRUCTIONS

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: .10 HRS

YES
875
ROY

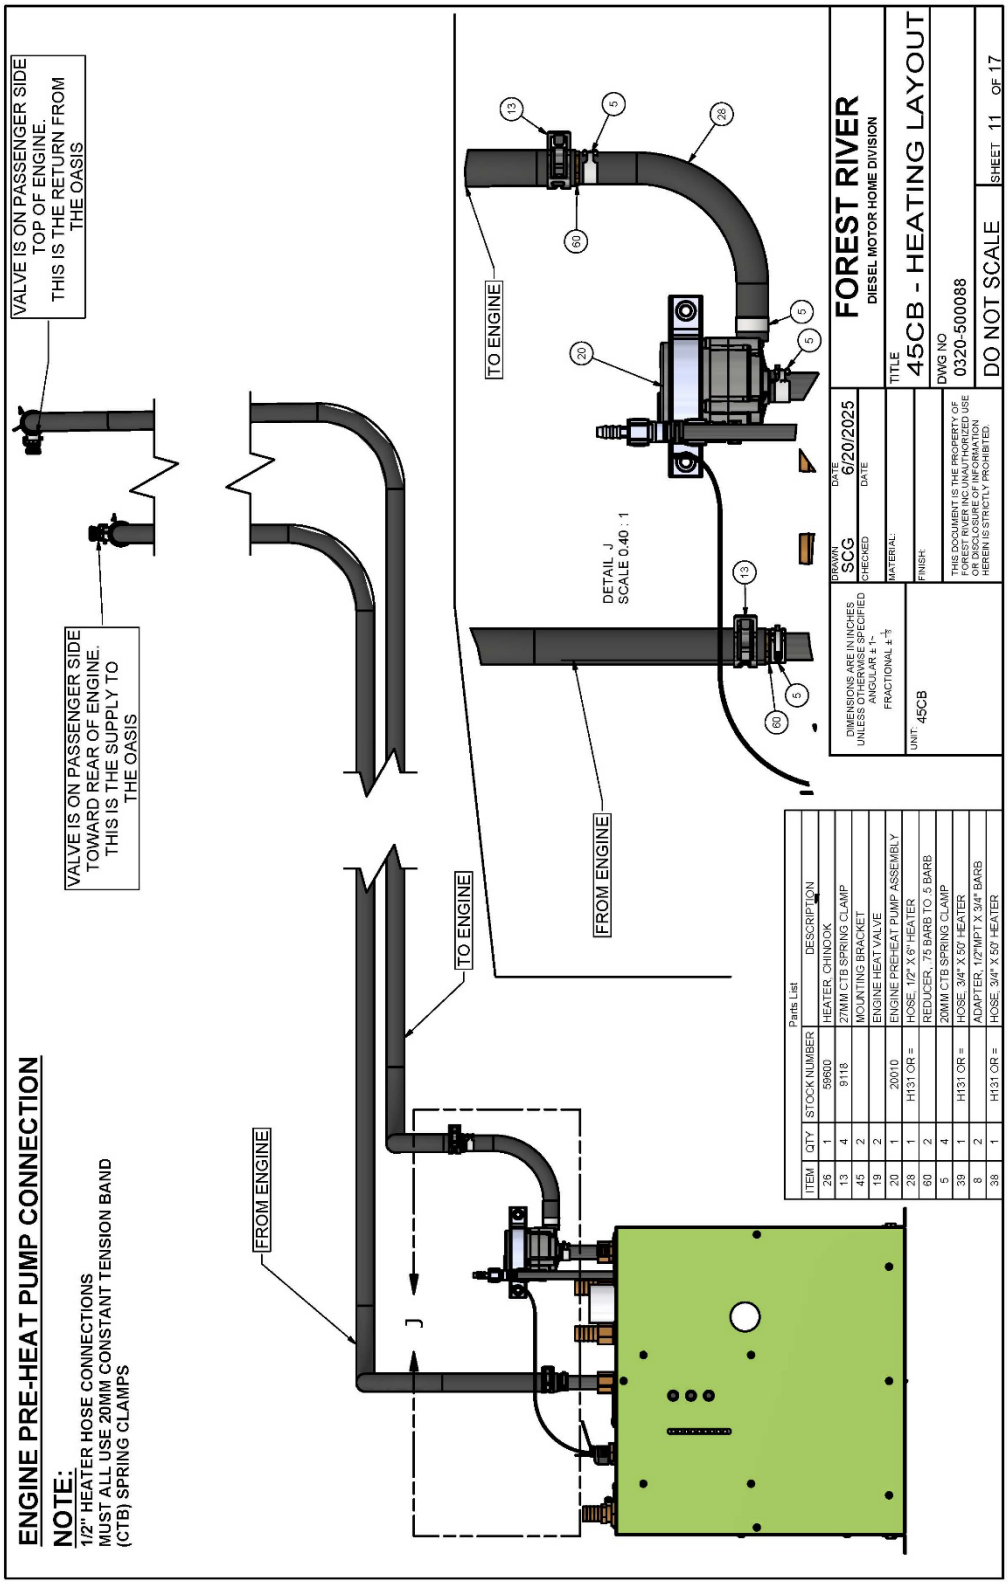


RECALL 26V603 REMEDY INSTRUCTIONS

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: .10 HRS.

YES
875
ROY

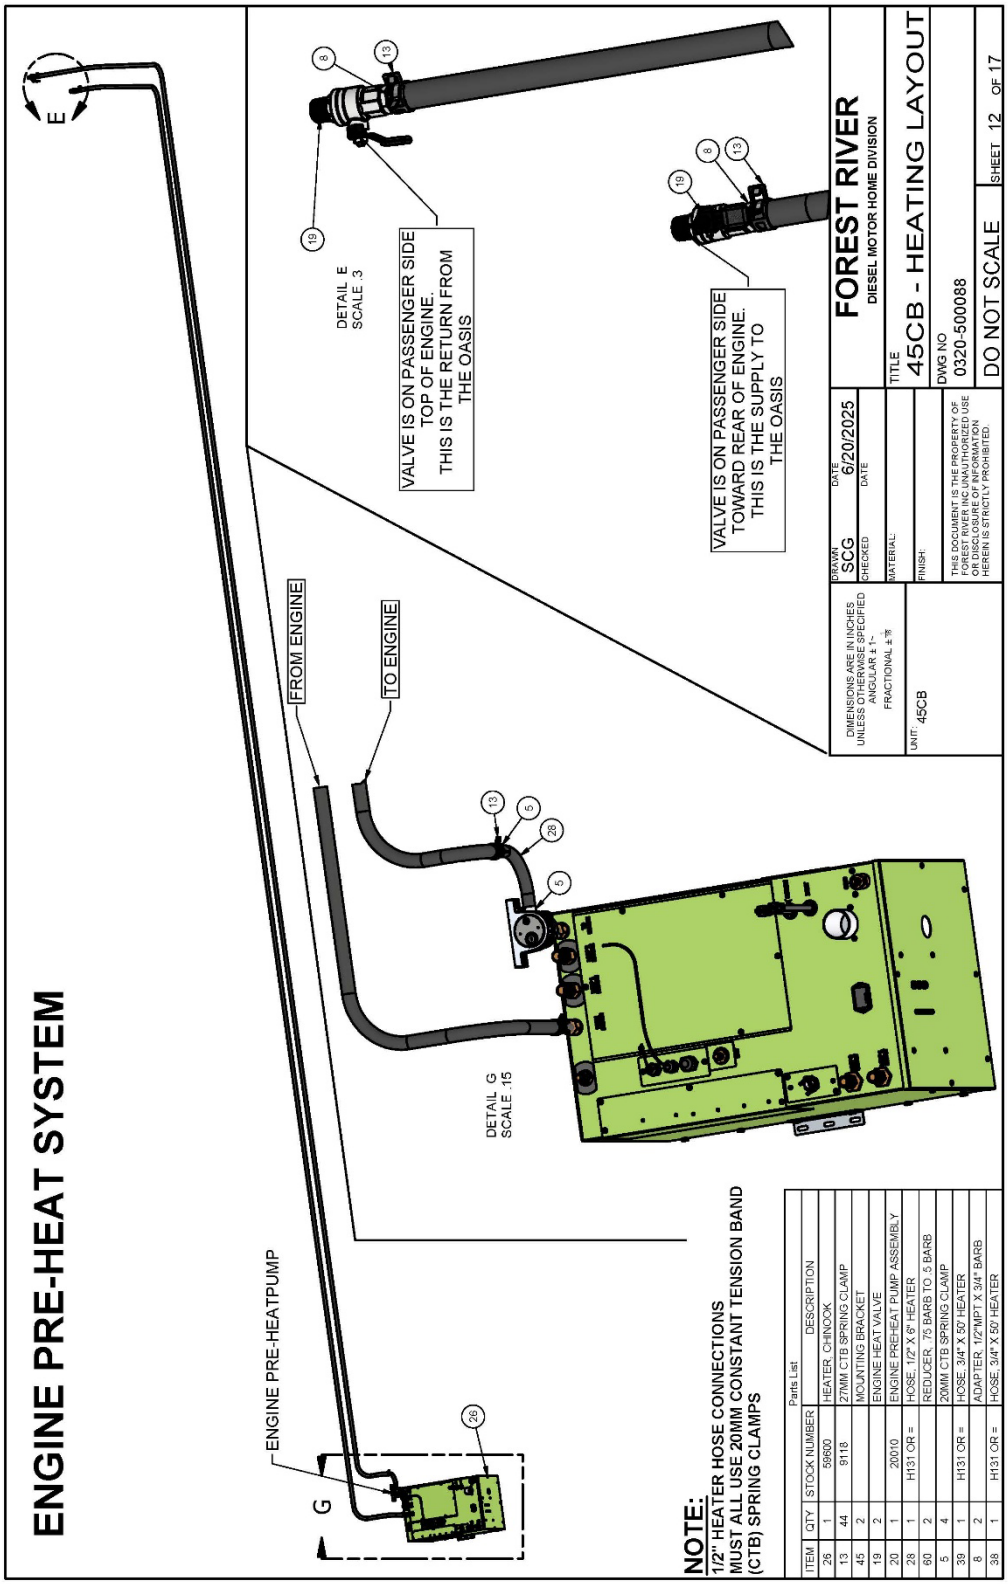


RECALL 26V603 REMEDY INSTRUCTIONS


Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: 10 HRS

YES
875
ROY

ENGINE PRE-HEAT HOSE CONNECTIONS

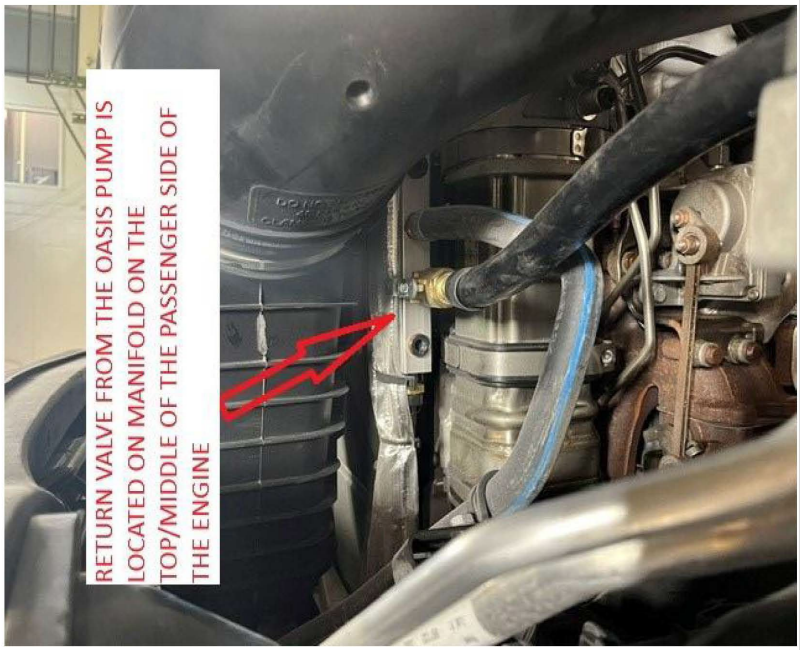

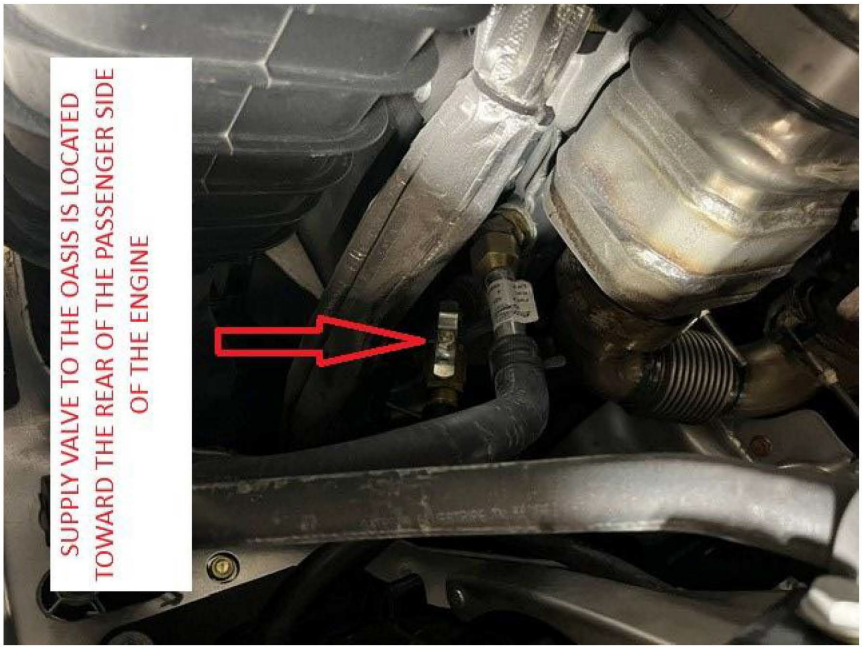

FOREST RIVER
DIESEL MOTOR HOME DIVISION

TITLE

DWG NO 0320-500088

DO NOT SCALE

SHEET 13 OF 17

DRAWN SCG DATE 6/20/2025
CHECKED DATE
MATERIAL:
FINISH:

DIMENSIONS ARE IN INCHES
UNLESS OTHERWISE SPECIFIED
ANGULAR ± 1°
FRACTIONAL ± 1/16

UNIT: 45CB


THIS DOCUMENT IS THE PROPERTY OF FOREST RIVER INC.UNAUTHORIZED USE OR DISCLOSURE OF INFORMATION HEREIN IS STRICTLY PROHIBITED.

RECALL 26V603 REMEDY INSTRUCTIONS

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: 10 HRS

YES
875
ROY

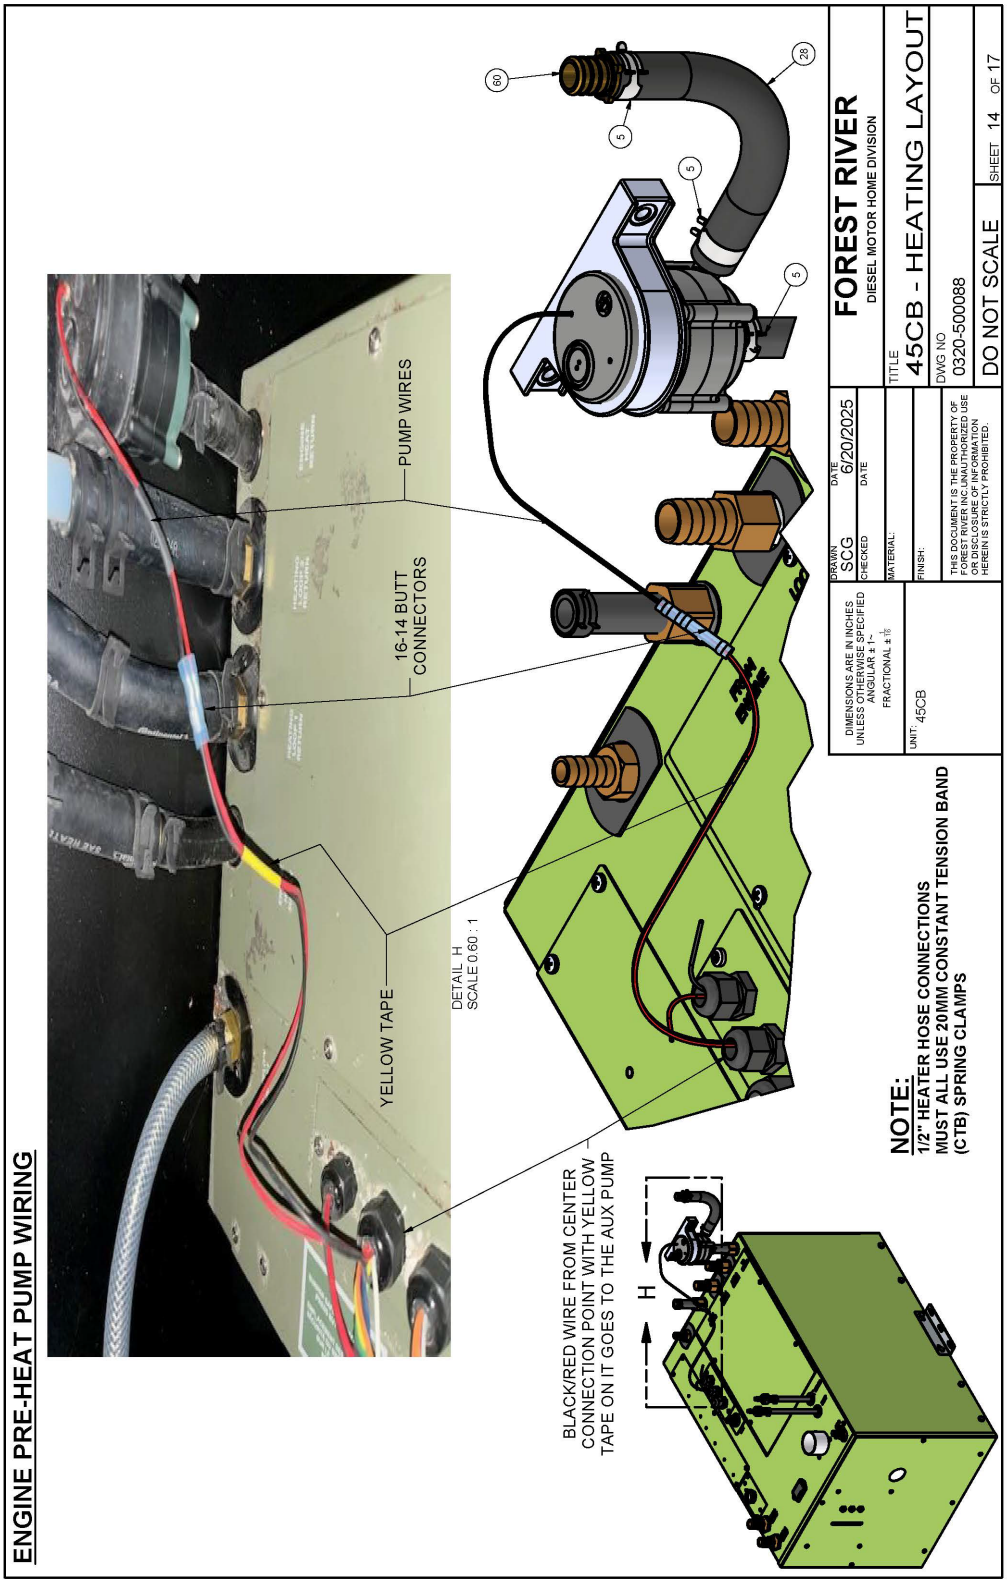


RECALL 26V603 REMEDY INSTRUCTIONS

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: .10 HRS

YES
875
ROY

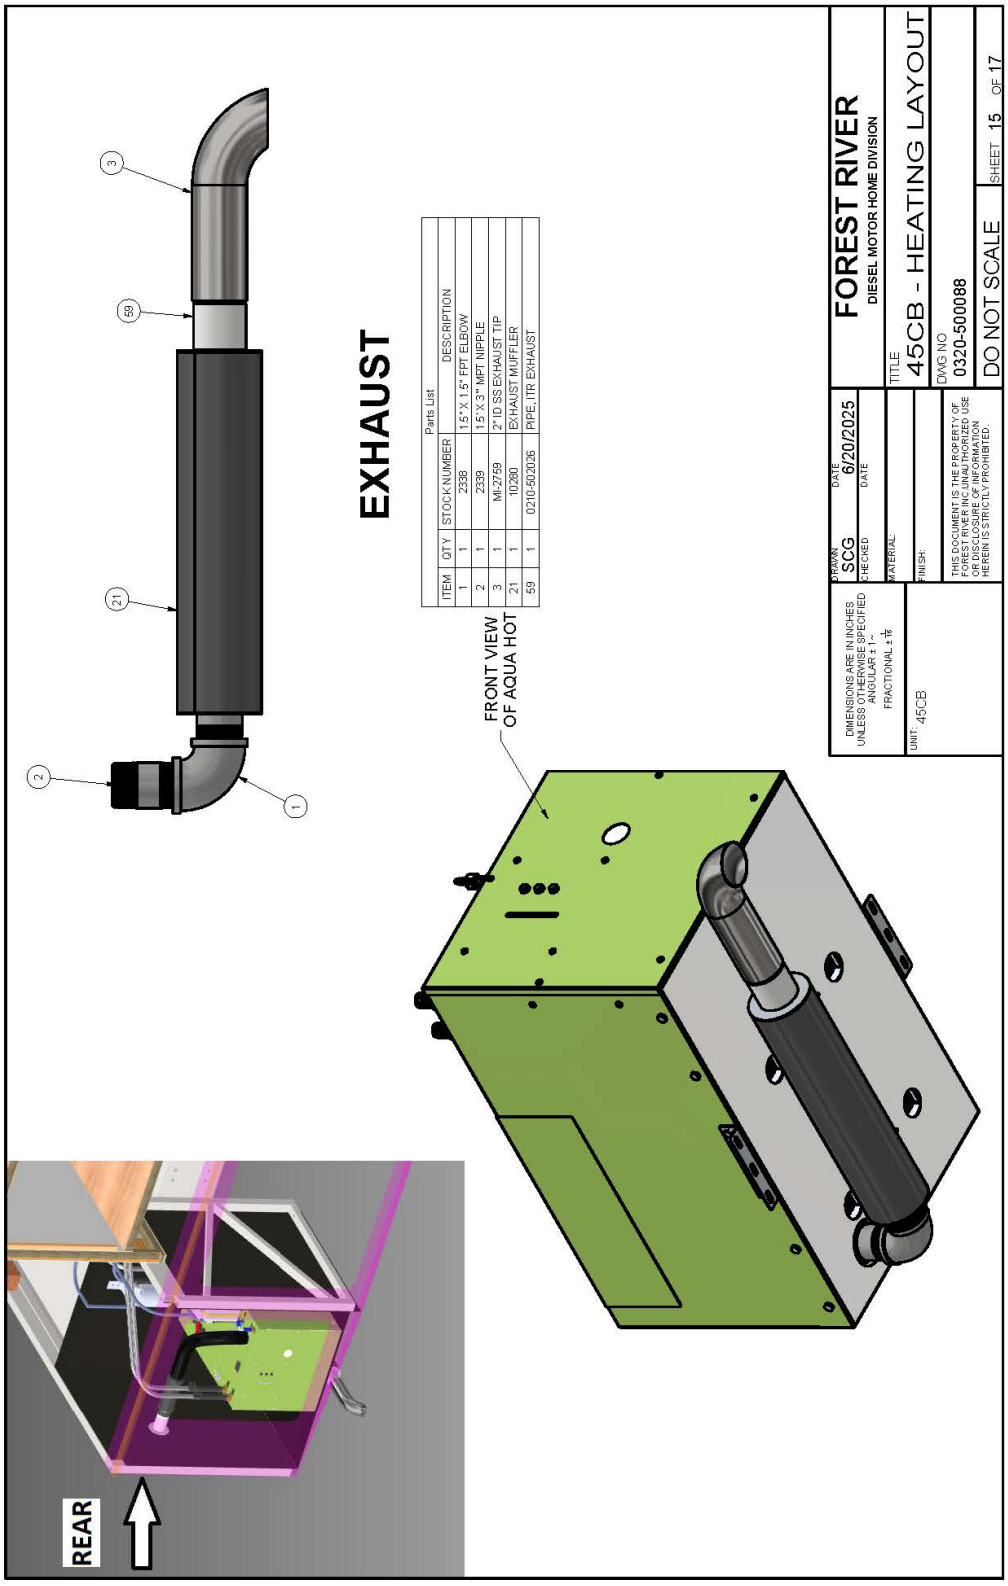

RECALL 26V603 REMEDY INSTRUCTIONS

Make(s): GRAND SPORT GT
Model(s): GGC45CB-600
Model Year(s): 2026 - 2027
Concern:

Repair Code: RC-744-01-00-004859
Allotted Time: 1.00 HRS.
Inspection Code: RC-744-05-00-004858
Allotted Time: 10 HRS

FOREST

INTERNATIONAL LTD
THERMAL RESEARCH

TECHNICAL BULLETIN

YES
375
ROY

Heating Systems	August 10, 2026	Bulletin Identification No.: ETB047-10
Release Type: Public		

Affected Model(s): Systems using Oasis RV-C node and engine pre-heat

Effective Date: August 10, 2026

Effective Serial Number: **N/A**

Description: **Engine pre-heat not functioning**


Part No.: **2041-62 harness**

Description of problem:

This issue only affects RV-C systems that are using the Oasis RV-C node (part number 5481).

Prior to August 10, 2026, the 2041-62 harness could have been manufactured with pins 4 and 9 incorrectly pinned. This will result in the engine pre-heat function not working (i.e. if the system is up to temperature and the user calls for the engine pre-heat function at the main touchscreen interface, the engine pre-heat LED on the zone board will not turn ON, and the engine pre-heat pump will not function).

The 2041-62 harness should be pinned as follows:

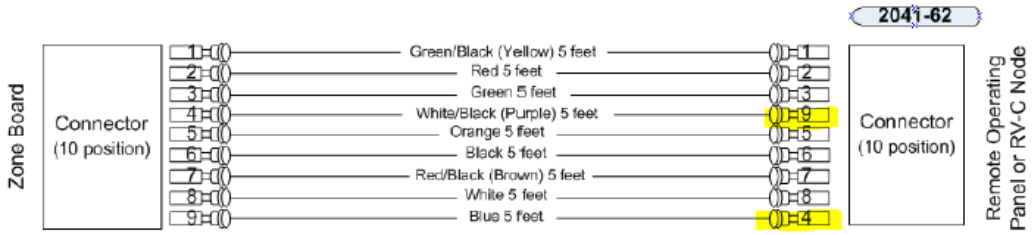

Short description of change:

If the 2041-62 harness installed in the system is not pinned as above, it will need to be corrected (swap pins 9 and 4 on one of the 10 pin connectors), or swapped out with a new 2041-62 harness.

Canada customer contact info:
International Thermal Research Ltd.
2431 Simpson Road,
Richmond, BC, Canada, V6X 2R2
Tel: (604) 278-1272, Fax: (604) 278-1274
Toll Free: 1-800-755-1272

USA customer contact info:
International Thermal Research Inc.
5305 NE 121st Ave, Suite 401
Vancouver, WA, USA, 98682
Tel: (360)-993-4877, Fax: (360)-993-1105
Toll Free: 1-800-993-4402