Fuel 335 - Plumbing Vent thru Roof

Description

There is a possibility that the vent was not completed inside the wall to extend through the roof.

VIN Range Effected

Fuel 335 manufactured between June 18, 2018 and July 23, 2018 the VIN range is 5SFCG4026KE398724 – 5SFCG4029KE400000

Inspection & Repair

The RV in question should have 2 plumbing vents coming up through the roof, if you have 2 vents than nothing is required.

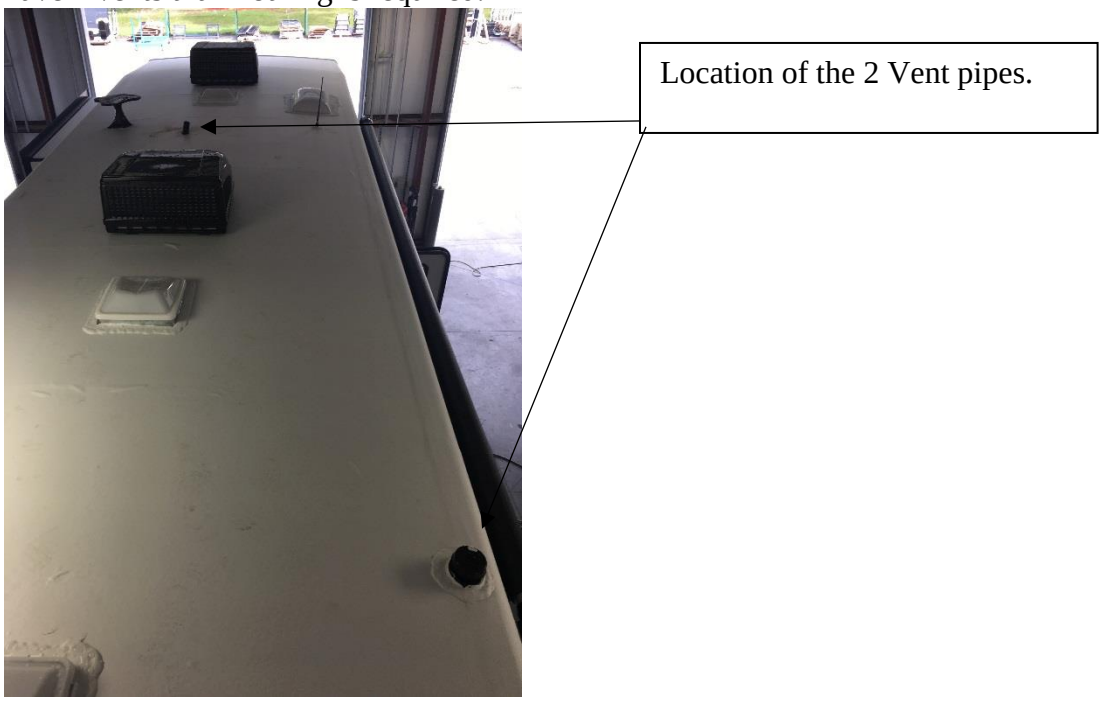

***If only 1 plumbing vent is coming up through the roof than this bulletin applies to this RV.**

The Repair:

- Remove the wall panel trim on the right side, of the wall panel that is on the right side hall as you go up the stairs into the bedroom.

Remove the trim, as the panel and trim will be re-used be careful not to damage or break the trim.

- Remove the ceiling trim.

Same as with the trim use caution as to not damage the roof trim.

- Remove smoke detector.
- Remove thermostat screws only.
- Pop panel loose from wall.

- Using a router cut hole in inside panel. Being careful not to cut into bath wall.

Using a router cut out your opening, use caution and do NOT cut into the adjacent walls.

- Using 2.5” hole saw cut hole in roof approximately 9” in.

- Using a 1” paddle bit with 12” extension, push insulation to side, drill a hole through roof. Be sure to keep the bit angled and as close to the edge of the first hole

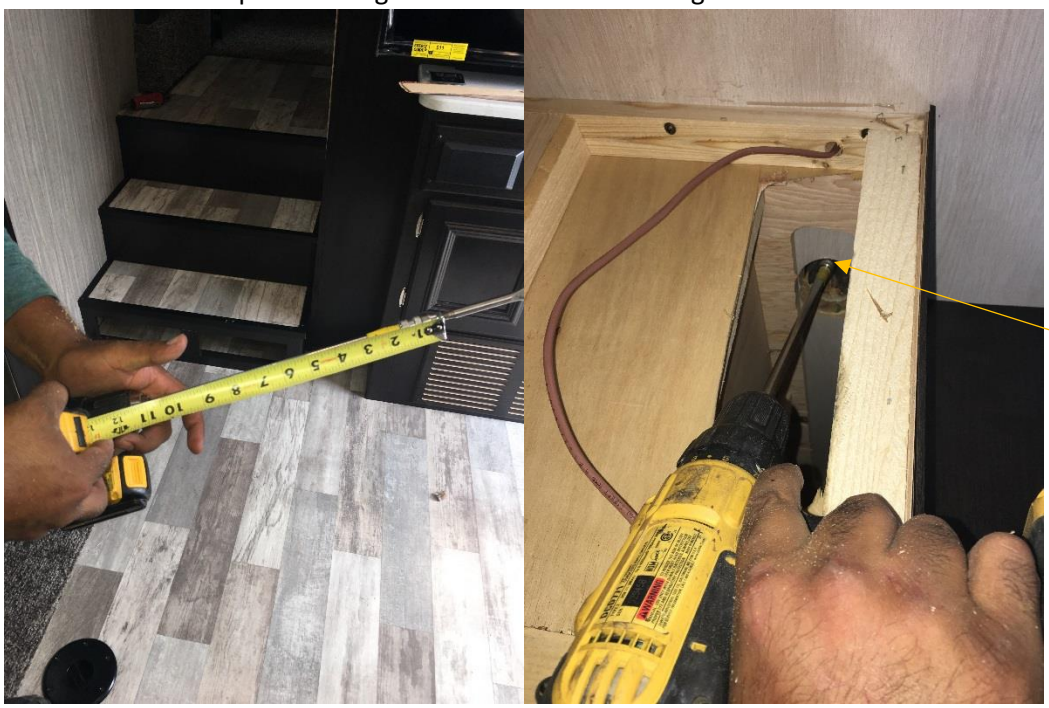

- Drill 2.5” hole in roof from the top using the hole as your center guide.

- Install 24”x1.5” vent pipe through hole and attach to existing connector in wall.

- Install vent cap and seal with self-leveling sealer. Be sure to put seal around the bottom.

- Reinstall wall panel, trim, smoke detector and thermostat.

Parts

DWV Vent Cap Black	**– part # 0101560**
Pipe DWV 1 ½"x 24"	**– Purchase locally**
Butyl tape	**– Purchase locally**
Self-leveling sealer	**– Purchase locally**

Warranty

File claim under 98.01.23 for 1hr
Authorization requirement – Photo of roof showing only one vent

Please refer all questions and authorization requests to Heartland Dealer Services Department 877-262-8032