SS 3119-FTL 2023 P4 New Cascadia PTO Grinding

Applicable Vehicles

P4 New Cascadia vehicles built from 9/9/2019 thru 1/9/2023

Symptoms


PTO grinding noise during operation

Issue

When vehicle is in PTO operation, a parameter (emergency mode) may be incorrectly set allowing the PTO to try to re-engage while in operation.

Solution

If encountering PTO grinding during operation, check the sSAM for the PTO position (screen print example will be for PTO1) programming for Assumed Feedback After x seconds. The parameter should be set to 10s. Make sure the setting applies to the PTO being programmed PTO1, PTO2 or PTO3.

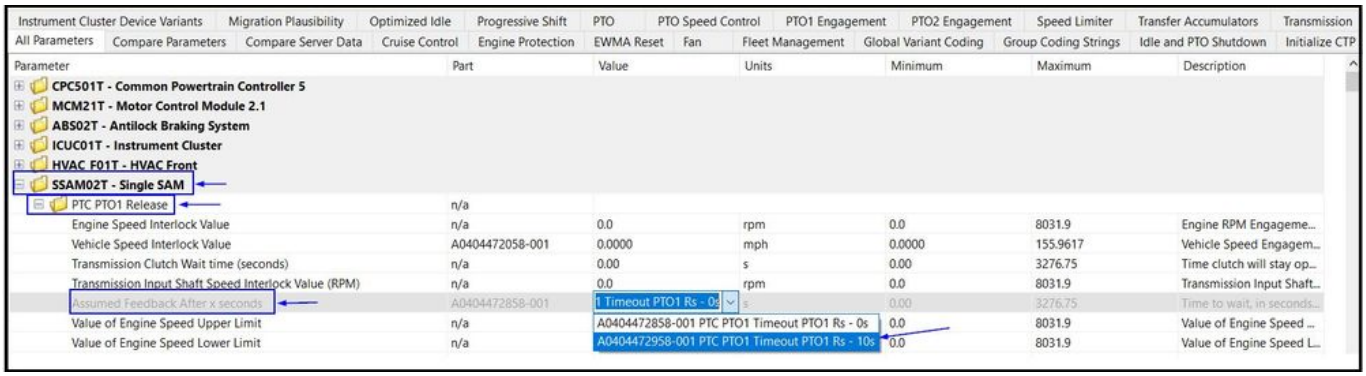

Labels :

Electrical New Cascadia

Add tags

0 Kudos

Comment

Powered by Khoros