SERVICE BULLETIN

L1025 2026-02-25

L1025: PRODUCT PROGRAM 1902 S2 ABS/EHCU MODULE CORRECTION

Reason for Revision

Refer to Table 1.

Table 1. Document History

Date	Rev	Revision (Rev) Description
2026-02-25	-	Initial release

Purpose for Service Bulletin

This bulletin informs dealers that the Anti-lock Braking System / Electro-Hydraulic Control Unit (ABS EHCU) module on some S2 Del Mar and Mulholland vehicles have a software configuration that prevents them from being unlocked. This prevents the ability to perform an ABS service bleed and software updates. It does not affect the operation of Anti-lock Braking System (ABS).

The update is applied by Digital Technician II (DT II) and will apply a seed and key to the Electro Hydraulic Control Unit (EHCU), which enables it to be unlocked via DT II or Firmware Over The Air (FOTA) update. The affected vehicles will also require an EHCU reflash following the update.

Required Dealer Action

Table 2. Required Dealer Action

Category	Description	Required
1	Must Perform Repair	☑
2	Repair If Presenting Symptom	☐
3	Feature Pack- Customer/Dealer Paid	☐
4	Informational Purposes Only	☐

1. The affected motorcycles will require a procedure performed by DT II to write a seed and key into the ABS EHCU module, followed by performing a reflash of the EHCU.

2. Connect DT II to the vehicle. The Vehicle Status screen will display that the EHCU is not configured. See Figure 1.

NOTE

Alternating Current (AC) power adapter and 4 Amperes (A)+ battery tender are required for this procedure

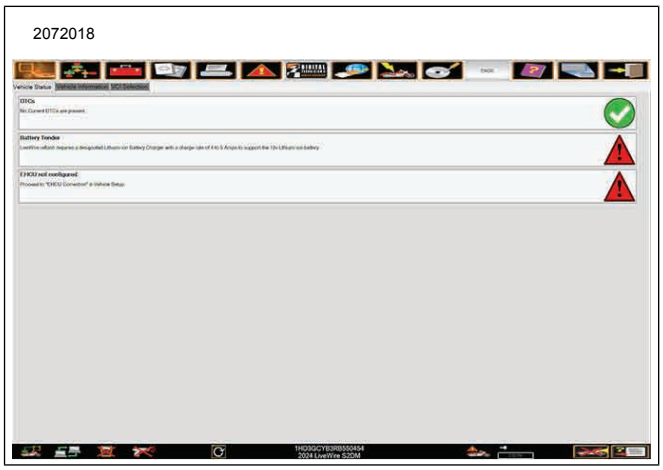

Figure 1. Not Configured

3. **Navigate:** Toolbox > Vehicle Setup.

   a. Select ABS EHCU Correction.

   b. Follow on screen instructions.

4. Once the correction procedure is complete reconnect DT II.

NOTE

If the vehicle displays "Call Service" or "Wait Not Ready" after completing the procedure, it may be necessary to power the vehicle off, remove the 40 amp fuse, wait 10 seconds, then reinstall 40 amp fuse. Power the vehicle on, connect DT II, and clear any Diagnostic Trouble Codes (DTCs).

5. **Navigate:** Reflash menu.

6. Reflash the EHCU.

Vehicles Affected

2024: S2 Del Mar (S2DM), S2 Mulholland (S2MH)

Markets Affected

United States, Canada, (EMEA) Europe, Middle East, Africa

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

Submit a warranty claim per Table 3.

Table 3. Product Program 1902

ITEM	DATA
Claim Type	Recall
Primary Labor Code[(1)]	9519
Customer Concern Code	1902
Condition Code	9981
Problem Part Number	41100111
Model Year	2024
Labor Time	0.6 hours
(1) Download may be required	