MAS005253 RU 26-16

RAPID UPDATE
FROM: Maserati TSO
TO: Maserati Network

Maserati
PERSONAL SERVICE LAB
MASTERS OF CARE

Rapid Update 833
Grecale – Fuel Vapor Filter Inspection

DATE: July 24, 2026

Certain Maserati vehicles listed in MODISCS+ are involved in a Rapid Update to check and, if necessary, restore the correct position of the fuel vapor filter pipes.

VEHICLES INVOLVED: (M182) Grecale MY26

Description
On some vehicles, the fuel vapor filter may be positioned outside the specified routing, which may result in incorrect pipe orientation. If present, this condition may cause the pipes to become pinched and affect component operation. This preventive action is intended to verify the installation and, if necessary, restore the correct routing to help ensure proper system performance.

Required Action
- Perform a visual inspection of the vehicle to verify that the component is correctly installed.
- Perform the corrective operation if a non-compliance is found.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

© 2026 Maserati Americas Aftersales
www.maseratiusa.com

All rights reserved. Reproduction or translation in whole or in part is not permitted without authorization from the publisher. Printed in USA

Technical Procedure

All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to confirm the vehicle is included in this action and that the procedure has not already been completed.

2. Disconnect the battery.
   a. **8.20.001 - BATTERY – Electrical power supply connection/disconnection**

1. Remove the rear LH wheel rim and the front guard of the left rear wheelhouse according to the Workshop Manual instructions.

   a. **6.00.004 - REAR LH WHEEL RIM - Removal and refitting**
   b. **9.13.006 - REAR LH WHEELHOUSE FRONT GUARD - Removal/refitting or replacement**

2. Locate the fuel vapor filter pipes and verify that they are correctly routed.

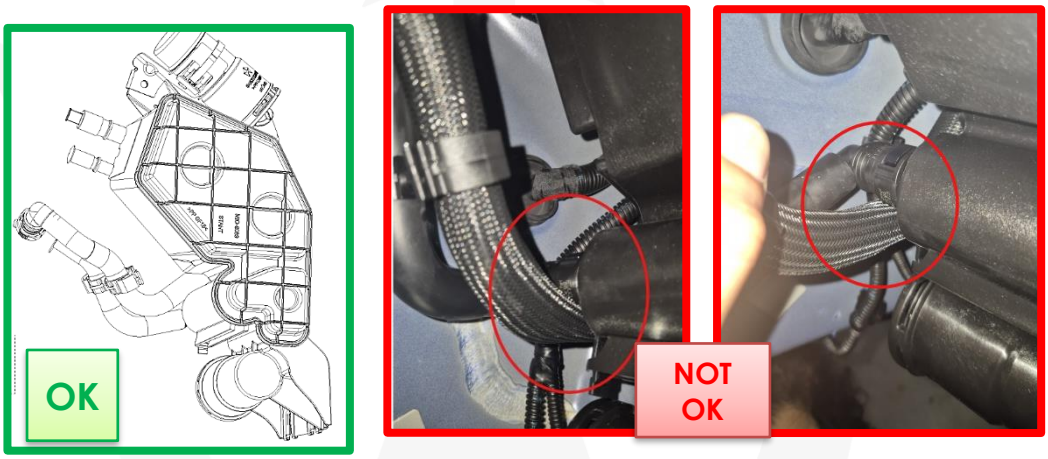

3. If any **non-compliance** is found, **restore** the correct pipe routing.

4. Remove the fuel vapor filter according to the Workshop Manual instructions.

   a. **1.44.001 FUEL VAPOR FILTER – Removal/refitting or replacement**

5. Inspect the pipes for damage and **refit the same component** by reversing the removal sequence.

6. Refit the removed components by reversing the removal procedure.

7. The procedure is complete, and the vehicle may be released.

© 2026 Maserati Americas Aftersales
www.maseratiusa.com

All rights reserved. Reproduction or translation in whole or in part is not permitted without authorization from the publisher. Printed in USA

Parts Information

Replacement is required only if the removed component **is broken or damaged**. This condition is not expected; therefore, do not order parts preventively. The correct spare parts are already available through the supply chain**. Refer to the Spare Parts Catalog using the vin** to identify the **correct Part Number** before ordering.

Warranty Claim Information

Please complete the warranty claim as follows:

Description	Code
Rapid Update Number	833
Warranty Code	23
Error Code	063
Component Code	1.44.001
Operation Code	
▪ Check	1.44.001.A (0,25 h)
▪ Rework	1.44.001.B (0,15 h)

© 2026 Maserati Americas Aftersales
www.maseratiusa.com

All rights reserved. Reproduction or translation in whole or in part is not permitted without authorization from the publisher. Printed in USA