STELLANTIS
PARTS & SERVICES

Technical Service Bulletin (TSB)

Coolant Leak From Obstructed Reservoir Duct

REFERENCE:	**TSB:** 07-008-26 **GROUP:** 07 - Cooling	Date:	October 22, 2026	REVISION:	—

VEHICLES AFFECTED:	MARKET APPLICABILITY:
2026 - 2027 (B1) Jeep Renegade **2026 - 2027 (H1) Jeep Commander** **2026 - 2027 (M1) Jeep Compass** **2026 - 2027 (N4) Ram Rampage** • **This bulletin applies to B1 vehicles built on or after February 02, 2026 (MDH 0202XX) and on or before August 29, 2026 (MDH 0829XX).** • **This bulletin applies to H1 vehicles built on or after February 02, 2026 (MDH 0202XX) and on or before August 24, 2026 (MDH 0824XX).** • **This bulletin applies to M1 vehicles built on or after February 02, 2026 (MDH 0202XX) and on or before September 03, 2026 (MDH 0903XX).** • **This bulletin applies to N4 vehicles built on or after January 30, 2026 (MDH 0130XX) and on or before August 29, 2026 (MDH 0829XX).**	☒ NA ☒ MEA ☐ EE ☐ IAP ☒ SA ☐ CH NOTE: This bulletin applies to North America, South America and Middle East & Africa markets.

CUSTOMER SYMPTOM:	**Customers may experience one or more of the following:** • Coolant is leaking. • Vehicle is overheating.
CAUSE:	**The protective plug on the primary tank duct was not removed during the assembly process, blocking coolant flow**

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-199, date of issue October 22, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting the coolant reservoir primary duct for an obstruction and, if necessary, removing the protective plug.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
07-00-01-94	Coolant, Engine - Inspect (0 - Introduction)	7 - Cooling	0.2 Hrs.
07-00-01-95	Coolant, Engine - Inspect And Adjust Level	7 - Cooling	0.3 Hrs.
Failure Code	ZY	Service Action	

CONSUMABLES:

Qty	Part No.	Description	Notes
(AR)	7092803	Antifreeze, Coolant, Gallon **(Refund Only)**	-

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
Snap-on Vacuum Device	EQ-10353145	

REPAIR PROCEDURE:

1. Open the hood.
2. With the engine cold, remove the coolant recovery bottle cap.
3. Using the hose included in the Snap-on Vacuum Device (EQ-10353145), measure 40 cm (15.75 in) along the length of the hose and make a mark Fig. 1.

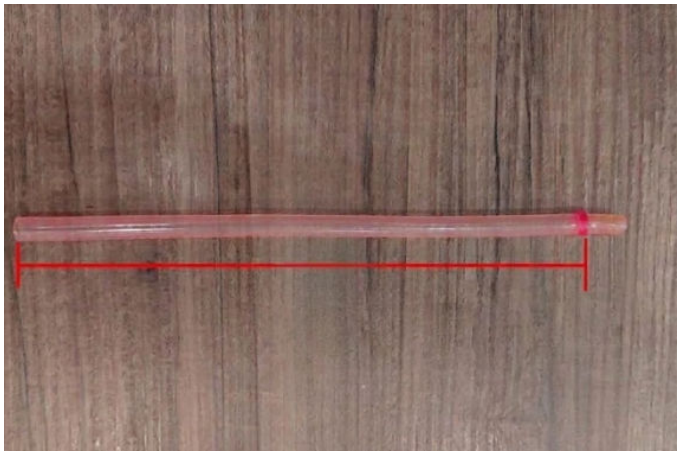


Fig. 1
Probe

4. Insert the probe into the coolant reservoir outlet passage as shown in Fig. 2.

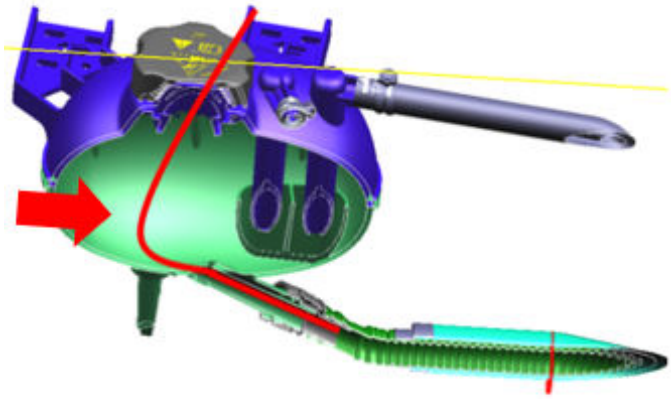


Fig. 2
Path Of Probe

5. Is the probe able to reach a depth of 40 cm (15.75 in) Fig. 3?
   - YES >>> This bulletin has been completed. Use Inspection LOP (07-00-01-94) to close the active RSU.
   - NO >>> Proceed to Step 6.



Fig. 3
Probe At 40 cm (15.75 in)

6. Using special tool **Snap-on Vacuum Device (EQ-10353145)**, remove the coolant from the coolant recovery bottle.
7. Disconnect the quick connector from the coolant recovery bottle and remove the protective plug Fig. 4.

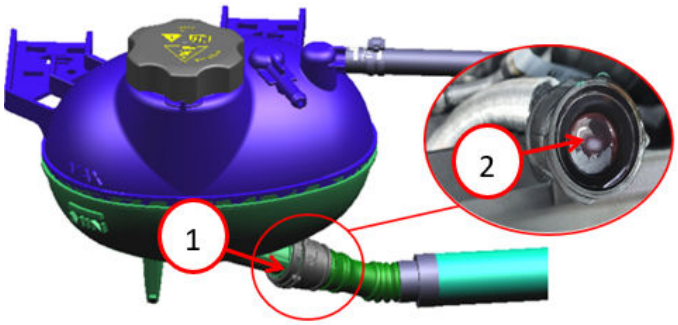


Fig. 4
Protective Plug

1 - Quick Connector
2 - Protective Plug

8. Connect the quick connector to the coolant recovery bottle.
9. Fill the coolant recovery bottle as required.
10. Install the coolant recovery bottle cap.
11. Close the hood.

NOTE: After applying this TSB, it is not necessary to send DID-I or DID-A.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.