Nissan Group of the Americas
Copyright©

VOLUNTARY SERVICE CAMPAIGN

Classification:	Reference:	Date:
HA26-009	NTB26-048	October 5, 2026

VOLUNTARY SERVICE CAMPAIGN
2018-2025 LEAF; HVAC REPROGRAM

CAMPAIGN ID #: P6A16
APPLIED VEHICLES: 2018-2025 LEAF (ZE1)

Check Service COMM or Dealer Business Systems (DBS) National Service History to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting this voluntary service campaign on certain specific model year 2018-2025 LEAF vehicles to inspect the current HVAC part number and, if applicable, reprogram the HVAC. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number P6A16 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

Dealers are to repair vehicles falling within range of this campaign that enter the service department. This includes vehicles purchased from private parties, vehicles presented by transient (tourists) owners, and vehicles in a dealer's inventory.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

IMPORTANT: If applicable, complete Campaign R24B2 or R25C8 BEFORE performing this Campaign.

1. Using CONSULT, confirm the current **HVAC Control Unit** part number and write it on the repair order.

   - If it matches one of the part numbers in **Table A**, proceed to step 2 to Reprogram the HVAC Control Unit.
   - If it does not match one of the part numbers in **Table A**, skip to **CLAIMS INFORMATION**.

Table A

CONTROL UNIT	CURRENT HVAC CONTROL UNIT PART NUMBER: 27500-
HVAC	5SA0A, 5SA0D, 5SE0A, 5SE0B, 5SE1B, 6WK0A, 6WK0C, 6WK4A, 6WK4B

WARNING **CAUTION** **NOTICE**

If you are not familiar with the CONSULT Reprogramming procedure, refer to the CONSULT Operation Manual and the Electronic Service Manual (ESM) for steps to reprogram an Electronic Control Unit (ECU). Follow all precautions in both manuals to prevent possible personal injury or death and/or damage to the ECU.

2. Reprogram the **HVAC Control Unit**.

   IMPORTANT:

   - When using CONSULT-III plus, select **Re/programming, Configuration** to reprogram the ECU. Perform "ADDITIONAL SERVICE" per the ESM when required.
   - If the reprogramming stops and does not complete, follow **HVAC Control Unit Reprogramming Operation is Unsuccessful (Recovery)** on page 3.

3. After erasing all DTCs, print a copy of the CONSULT screen showing the before and after part numbers of the control unit and attach it to the repair order.

HVAC Control Unit Reprogramming Operation is Unsuccessful (Recovery)

<u>Do not disconnect the VI or shut down CONSULT if reprogramming does not complete</u>.

If reprogramming does <u>not</u> complete and the "!?" icon displays, as shown in Figure 1:

- Check battery voltage (12.0 - 13.5 V).
- EV is in Ready Mode.
- External Bluetooth® devices are OFF.
- **All** electrical loads are OFF.
- Select **Retry** and follow the on screen instructions.
- **<u>Retry</u>** <u>may not go through on first attempt and can be selected more than once</u>.

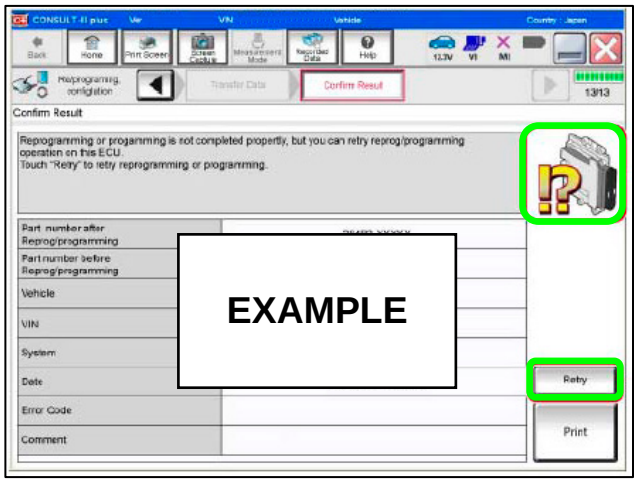


Figure 1

If reprogramming does <u>not</u> complete and the "X" icon displays, as shown in Figure 2:

- Check battery voltage (12.0 - 13.5 V).
- CONSULT A/C adapter is plugged in.
- EV is in Ready Mode.
- Transmission is in Park.
- All CONSULT VI cables are securely connected.
- All C-III plus updates are installed.
- Select **Home**, and restart the reprogram procedure from the beginning.

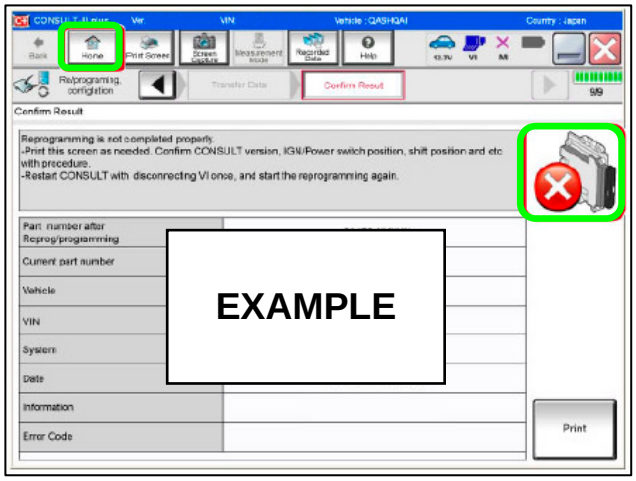


Figure 2

CLAIMS INFORMATION

Submit a “CM” line claim using the following claims coding:

CAMPAIGN (“CM”) ID	DESCRIPTION	OP CODE	FRT
P6A16	Reprogram HVAC	P6A160	0.5
	Reprogram Not Needed	P6A161	0.3

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
October 5, 2026	NTB26-048	Original bulletin published